


AD A138 418


ALL THAT REMAINS THE TRADITIONAL ARCHITECTURE AND
HISTORIC ENGINEERING ST... (U) NATIONAL PARK SERVICE
ATLANTA GA ARCHEOLOGICAL SERVICES BRANC... L H WORTHY
1983 F/G 5/6

1/3

UNCLASSIFIED

NL

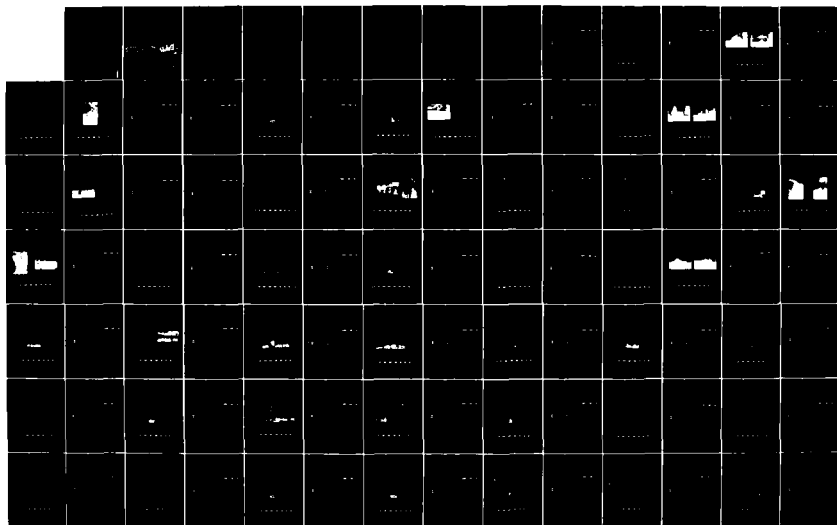

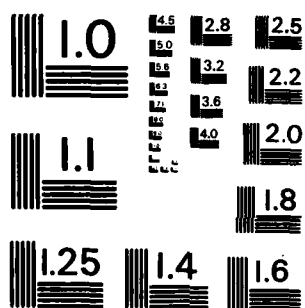

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

AD A138418

(2)

ALL THAT REMAINS

THE TRADITIONAL ARCHITECTURE AND
HISTORIC ENGINEERING STRUCTURES
RICHARD B. RUSSELL MULTIPLE RESOURCE AREA

APPENDIX A: THE INVENTORY



DTIC FILE COPY

FUNDED BY THE SAVANNAH DISTRICT U.S. ARMY CORPS OF ENGINEERS

RUSSELL PAPERS 1983

PREPARED BY ARCHEOLOGICAL SERVICES BRANCH, ATLANTA
NATIONAL PARK SERVICE

UNITED STATES DEPARTMENT OF THE INTERIOR

DTIC
ELECTE
FEB 29 1984
S A

This document has been approved
for public release and sale; its
distribution is unlimited.

84 02 27 074

50272-101

REPORT DOCUMENTATION PAGE		1. REPORT NO.	2.	3. Recipient's Accession No.
4. Title and Subtitle APPENDIX A: The Inventory ALL THAT REMAINS: The Traditional Architecture and Historic Engineering Structures of the Richard B. Russell Multiple Resource Area, Georgia and South Carolina			5. Report Date September 1983	
7. Author(s)			6.	
9. Performing Organization Name and Address Archeological Services Branch National Park Service Southeast Regional Office 75 Spring Street, S. W. Atlanta, Georgia 30303			8. Performing Organization Rept. No.	
12. Sponsoring Organization Name and Address Same			10. Project/Task/Work Unit No.	
			11. Contract(C) or Grant(G) No. (C) (G)	
			13. Type of Report & Period Covered	
			14.	
15. Supplementary Notes Funded by the Savannah District U. S. Army Corps of Engineers				
16. Abstract (Limit: 200 words) The Office of Archeology and Historic Preservation inventory for prepared by Historic American Buildings Survey (HABS) and Historic American Engineering Record (HAER) personnel for the Richard B. Russell Multiple Resource Area are presented here as a resource to be used in subsequent historic structures studies. The field survey conducted in 1979 recorded 93 domestic buildings and 8 engineering structures. The original forms are housed in the Office of the National Register in Washington, D. C.				
17. Document Analysis a. Descriptors				
b. Identifiers/Open-Ended Terms				
c. COSATI Field/Group				
18. Availability Statement		19. Security Class (This Report)	21. No. of Pages 200	
		20. Security Class (This Page)	22. Price	

(See ANSI-Z39.18)

See Instructions on Reverse

OPTIONAL FORM 272 (4-77)
(Formerly NTIS-35)
Department of Commerce

ALL THAT REMAINS:
The Traditional Architecture
and
Historic Engineering Structures
of the
Richard B. Russell Multiple Resource Area
Georgia and South Carolina

APPENDIX A:
The Inventory

Prepared by Archeological Services, Atlanta
National Park Service
United States Department of the Interior

Funded by the Savannah District
U. S. Army Corps of Engineers

1983



Project Title	Richard B. Russell Multiple Resource Area
Project Number	100-100000-1000
Project Location	Georgia and South Carolina
Project Status	Completed
Project Date	1983
Project Author	Archeological Services, Atlanta
Project Reviewer	U. S. Army Corps of Engineers
Project Approval	Approved
Project Signature	[Signature]
Project Date	1983
Project Page	A-1

The following Office of Archeology and Historic Preservation (OAHP) inventory forms were prepared for those extant structures more than 50 years of age located within the boundaries of the Richard B. Russell Multiple Resource Area (MRA) and are presented here as an appendix to the report outlining that resource (ALL THAT REMAINS: The Traditional Architecture and Historic Engineering Structures of the Richard B. Russell Multiple Resource Area, Georgia and South Carolina, Worthy 1983). The MRA includes those portions of Elbert and Hart counties, Georgia, and Abbeville and Anderson counties, South Carolina, adjacent to the Savannah River and between Clarks Hill Reservoir and Hartwell Dam.

The criteria for selection of structures within these boundaries to be included in the inventory followed the standard procedures for selection for the National Register of Historic Places and the National Park Service. These standards specify that buildings less than 50 years of age as a rule are not recorded, and that all complexes containing at least one structure within the minimum age criterion are inventoried as a whole. Exceptions may be made, however, if specific significant conditions occur. Exceptions in this instance were made when structures within the complexes were too deteriorated or overgrown with weeds to merit inclusion. Additionally, some significant structures were included in the inventory, although the actual acquisition lines had not been drawn or were unknown. In these cases, an arbitrary distance of 1000 ft was marked off on USGS topographic maps from the average lake level (480 MSL gradient), and the area surveyed for structures. In a few cases, particularly significant structures were included in the inventory

because of the physical and visual impact of Russell Lake, even though the buildings lie outside the acquisition area. Special note was also taken of structures of architectural or historical significance that were severely deteriorated and would not survive to be noted by future surveys.

The field survey was carried out between January 23, 1979 and May 1, 1979, by John Linn Hopkins and Emily J. Harris, with the result that 93 domestic structures and 8 engineering elements were inventoried. Subsequently, recommendations were made regarding the eligibility of each property to be listed in the National Register of Historic Places.

The OAHP forms are presented here in numerical order relative to the inventory identification number. This number consists of a two-letter county abbreviation followed by the Real Estate Tract Number employed by the U.S. Army Corps of Engineers. In cases where more than one complex existed within a tract, a further identifying number was assigned. Individual buildings within each complex were designated by a letter. Structures within a given complex that were extremely deteriorated were located on the sketch-site plans to provide a complete understanding of the complex, but were not further recorded. The forms are presented here in their original form.

As a means of cross-reference, Table 1 indicates the sites by OAHP identification number, HABS/HAER recording number (when applicable), and the site numbers applied by IAS-Atlanta to facilitate incorporation into the RBR computerized data bank.

Table 1. Cross Reference of Inventoried Structures.

OAHP Number	IAS Number	HABS/HAER	Site Name	Eligible
<u>Georgia</u>				
EB418A-C	9Eb50	HABS GA-31	Dye-White	x
EB432	9Eb404			
EB500A-C	9Eb48	HABS GA-34	Allen/Beverly	1975
EB501	9Eb201	HAER GA-42	Pearle Mill	x
EB505	9Eb49			
EB507	9Eb427	HABS GA-33	Eureka/Grogan	DOE 1978
EB510A-D	9Eb96			
EB525	9Eb97			
EB526	9Eb95			
EB731-1A-B	9Eb105	HABS GA-32	R.J. Anderson	x
EB731-2	9Eb106	HABS GA-35	W.F. Anderson	x
EB1512A-C	9Eb98			
EB1513A-C	9Eb99			
EB1514A-D	9Eb101	HABS GA-30	Alex./Cleveland	1977
EB1515A-D	9Eb100			
EB1516A-B	9Eb102			
EB1518	9Eb104		Gulley	
	9Eb55	HAER GA-41	Blackwell Bridge	x
	9Eb53	HAER SC-6	SCL RR Bridge	x
		GA-43		
	9Eb103	HAER SC-2	Sander's Ferry Bridge	x
		GA-37		
	9Ha10	HAER SC-4	Smith-McGee Bridge	x
		GA-39		

Table 1 (Continued)

OAHP Number	IAS Number	HABS/HAER	Site Name	Eligible
<u>South Carolina</u>				
AB201	38Ab307			
AB204E	38Ab308			
AB1002	38Ab309			
AB1006A-B	38Ab310			
AB1101-1A-B	38Ab311			
AB1110A-B	38Ab110			
AB1115-2	38Ab313			
AB1123-1	38Ab314			
AB1123-2	38Ab315		Trask	
AB1220	38Ab316			
AB1227A-C	38Ab317		Rampey	
AB1300A-B	38Ab287			
AB1300-1A-B	38Ab220			
AB1301A-G	38Ab319	HABS SC-382	Caldwell-Hutchison	x
AB1301-2A-B	38Ab237	HABS SC-383	Long-Hutchison	x
AB1301-3	38Ab318			
AB1304A-K	38Ab21	HABS SC-379	Harper-Featherstone	x
AB1304-2A-B	38Ab320	HABS SC-381	Featherstone Tenant	x
AB1304-3A-B	38Ab321	HABS SC-380	Harper-Featherstone Tenant Farm	x
-----	38Ab323	HAER SC-5	Abbeville Hydroelectric (Lake Secession Dam)	x
-----	38An36	HAER SC-7	Gregg Shoals Dam and Power Plant	x
-----	38An173		Route 187 Bridge	

GEORGIA

PHR 8 230 June 1978

OAHIP INVENTORY


Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1. SITE ID NO E B 4 1 8 - A		2. CLASSIFICATION Residence		3. DATE CA. 1890		4. DANGER OF DEMOLITION <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
5. NAME (SEE OTHER SIDE) Residence		6. OWNER'S NAME United States of America		7. OWNER'S ADDRESS % Richard B. Russell RE Project Office P. O. Box 1050 Elberton, GA 30635		8. COUNTY Elbert	
9. STATE GA		10. CITY/VICINITY Elbert		11. COUNTY Elbert		12. CITY/VICINITY Elberton	
13. ADDRESS (SEE OTHER SIDE) Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245, proceed generally north and east on Co. 245 4.6 miles to the intersection with Co. 244, then southwest on Co. 244 (Con't Reverse)		14. EXISTING SURVEYS <input type="checkbox"/> FRR <input type="checkbox"/> NPS <input type="checkbox"/> HAER <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER-2 <input type="checkbox"/> NPS <input type="checkbox"/> CLE		15. SPECIAL FEATURES (SEE OTHER SIDE BELOW) <input type="checkbox"/> INTERIOR INTAL <input type="checkbox"/> EXTERIOR INTAL <input checked="" type="checkbox"/> ENVIRONMENTAL		16. QUAD NAME Heardmont, GA - SC	
17. OWNER John Linn Hopkins, Emily J. Harris		18. AFFILIATION Historic American Buildings Survey		19. DATE May 1, 1979		20. OTHER INFORMATION One story, balloon framed dwelling with front porch and rear shed additions. 38' (three bays) x 56' (three bays). Steep hip roof with two front gables, covered with asphalt shingles, boxed eaves; clapboard siding, bay window on front facade, 4 x 4 sash windows; foundation of log piers. Original plan was one room on either side of central hall, two rooms deep, with one room rear addition. Two interior brick chimneys. Associated with this structure are 12 outbuildings (two recorded, remainder extremely deteriorated), as follows: B) one-story garage, CA. 1930; C) one-story barn with loft, CA. 1930. The rest of the farm complex is in extremely deteriorated condition, and would be difficult to preserve.	

(CONT OVER)

21. ORIGINAL USE Residence		22. PRESENT USE Residence		23. ADAPTIVE USE	
24. REFERENCES (SEE OTHER SIDE) Unknown		25. REGION Region		26. PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
27. OTHER INFORMATION (SEE OTHER SIDE) Unknown		28. NAME		29. DISTRICT ID NO	

(CONT OVER)

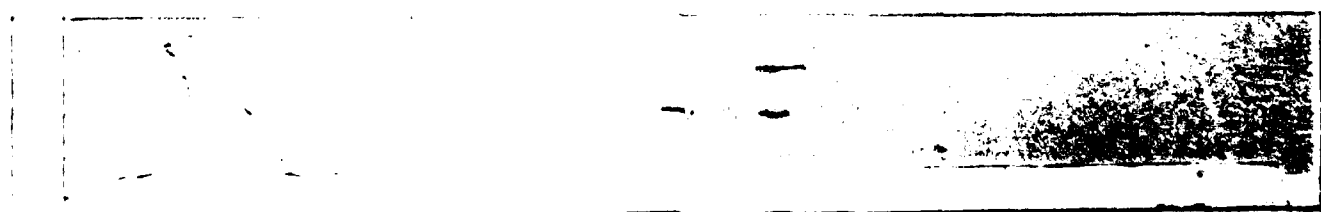

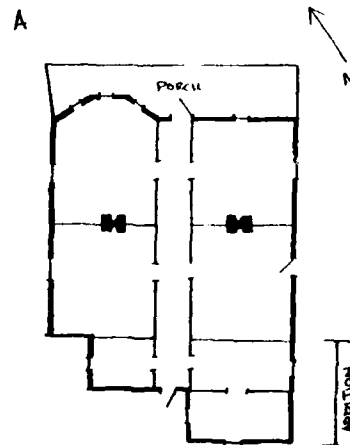

This a well preserved example of the type of house constructed for small-scale farmers in this area in the late nineteenth and early twentieth century. Although common in the southeastern United States, this is the only structure of this type in the project area. The integrity of the structure is intact. It continues to be used as the dwelling for a small farm complex. Prior to acquisition by the Corps of Engineers (1979) this farm complex was owned by a black family for at least 50 years. As of this inventory, this is the only known example of black ownership in the project area.

1.4 miles to an unpaved private road, then southwest on the unpaved road .1 mile to the site.

[illegible]

FHR-8-230 June 1978

OAHMP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										E B 4 1 8 - A																																																																																									
2 Classification Residence - Continuation										3 PRIORITY										4 DANGER OF DEMOLITION? (SPECIFY THREAT)										<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN																																																																					
										5 DATE										6 GOVT SOURCE OF THREAT										OWNER ADMIN																																																																					
																				7 OWNER/ADMIN																																																																															
8 NAME(S) OF STRUCTURE																				9 OWNER'S ADDRESS																																																																															
10 STATE										COUNTY NAME										CITY/VICINITY										CONG DIST										STATE										COUNTY NAME										CITY/VICINITY										CONG DIST																													
11 SITE ADDRESS (STREET & NO.)																				12 EXISTING SURVEYS										<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6																																																																					
																				<input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER																																																																															
																				13 SPECIAL FEATURES (DESCRIBE BELOW)										<input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT																																																																					
14 UTM ZONE										EASTING										NORTHING										SIGN										SCALE										<input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5										QUAD NAME																																							
																																																		<input type="checkbox"/> OTHER																																																	
15 CONDITION										70 <input type="checkbox"/> EXCELLENT										71 <input type="checkbox"/> GOOD										72 <input type="checkbox"/> FAIR										73 <input type="checkbox"/> DETERIORATED										74 <input type="checkbox"/> RUINS										75 <input type="checkbox"/> UNEXPOSED										76 <input type="checkbox"/> ALTERED										82 <input type="checkbox"/> DESTROYED										85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY																				AFFILIATION																				DATE																																																											
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.																																																																																																			

(CONT OVER)

18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE																			
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER																																							

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input type="checkbox"/> NO										21 NEWS Region										22 PUBLIC ACCESSIBILITY										<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT?										<input type="checkbox"/> YES <input type="checkbox"/> NO										NAME										DISTRICT ID NO																			

25 PHOTOS AND SKETCH MAP OF LOCATION

EB418-A



Significance

REFERENCES (CONTINUED)

ABSTRACT																			
HAZ. NO.	LC	TECH REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRWG	HIST. DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
ST 00 000000 0000



FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 202401 SITE ID NO **E B 4 1 8 - B**2 Classification
Garage

3 PRIORITY

4 DANGER OF DEMOLITION
SPECIFY THREAT☒ YES ☐ NO ☐ UNKNOWN**Corps of Engineers (Demolition)**5 DATE
CA. 1930

6 GOVT SOURCE OF THREAT

8 NAME(S) OF STRUCTURE

Garage

7 OWNER ADMIN

U. S. Army Corps of Engineers

9 OWNER'S ADDRESS

**% Richard B. Russell RE Project Office
P. O. Box 1050
Elberton, GA 30635**10 STATE **GA** COUNTY NAME **Elbert**CITY VICINITY **Heardmont**

CONG DIST

1 0STATE **GA** COUNTY NAME **Elbert**CITY VICINITY **Elberton****1 0**11 SITE ADDRESS (STREET & NO.) **Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245, proceed generally north and east on Co. 245 4.6 miles to the intersection with Co. 244, then southwest on Co. 244 1.4 miles to an unpaved private road, then southwest on the unpaved (don't rev)**

12 EXISTING SURVEYS

☐ NAD ☐ NAD ☐ NAD ☐ NAD ☐ NAD ☐ NAD☐ STATE ☐ STATE ☐ STATE ☐ STATE ☐ STATE ☐ STATE

13 SPECIAL FEATURES DESCRIBE BELOW

☒ INTERIOR ☐ EXTERIOR ☐ EXTERIOR☒ EXTERIOR ☐ EXTERIOR ☐ EXTERIOR

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☒ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED77 ☐ DESTROYED78 ☐ REMOVED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS EXANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

One-story, balloon frame garage 12' x 14'. Gabel roof covered with asphalt shingles, clapboard siding, foundations of brick piers. One room. The structure is in a fair state of preservation. It is associated with 12 other structures as part of a small farm complex. See site EB418-A.

CONT OVER

18 ORIGINAL USE

Garage

PRESENT USE

Garage

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

CONT OVER

20 URBAN AREA 50 000
POP OR MORE?☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

NDEYER


24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

PHOTOS AND SKETCH MAP OF LOCATION

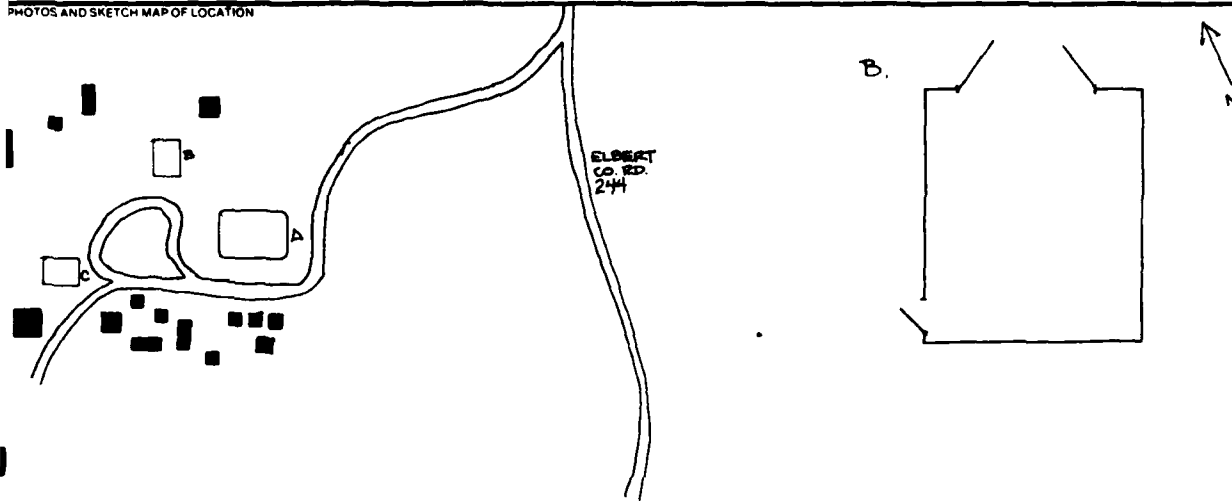

Significance This garage is typical of early twentieth century small farm outbuildings through out the project area and the southeastern United States. For general comments see site EB418-A.

11. Site Address (Street & No) (Continued)

road .1 mile to the site.

ABSTRACT																							
HATCH NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM												

INT 4575-78

25 PHOTOS AND SKETCH MAP OF LOCATION

EB418-B



Significance

REFERENCES (CONTINUED)

ABSTRACT																			
HAZARD	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
100 000000 000

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										E B 4 1 8 - B										2 Classification										3 PRIORITY										4 DANGER OF DEMOLITION? (SPECIFY THREAT)										<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN																																																	
Garage - Continuation																														5 DATE										6 GOVT SOURCE OF THREAT										OWNER										ADMIN																																							
																																								7 OWNER ADMIN																																																											
																																								9 OWNER'S ADDRESS																																																											
10 STATE										COUNTY NAME										CITY VICINITY										CONG DIST										STATE										COUNTY NAME										CITY VICINITY										CONG DIST																													
11 SITE ADDRESS STREET & NO																																								12 EXISTING SURVEYS										<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HAR <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> OLP										<input type="checkbox"/> NONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER																																							
																																								13 SPECIAL FEATURES: DESCRIBE BELOW										<input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT																																																	
14 UTM ZONE										EASTING										NORTHING										SIGN										SCALE										<input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5										QUAD NAME																																							
																																																		<input type="checkbox"/> OTHER																																																	
UTM ZONE										EASTING										NORTHING										SIGN										SCALE										<input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5										QUAD NAME																																							
																																																		<input type="checkbox"/> OTHER																																																	
15 CONDITION										70 <input type="checkbox"/> EXCELLENT										71 <input type="checkbox"/> GOOD										72 <input type="checkbox"/> FAIR										73 <input type="checkbox"/> DETERIORATED										74 <input type="checkbox"/> RUINS										75 <input type="checkbox"/> UNEXPOSED										76 <input type="checkbox"/> ALTERED										82 <input type="checkbox"/> DESTROYED										85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY																														AFFILIATION																				DATE																																																	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S) HISTORICAL DATE(S) PHYSICAL DIMENSIONS MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC																																																																																																			

18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE										(CONT OVER)																													
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER																																																											
20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input type="checkbox"/> NO										21 NCAS Region										22 PUBLIC ACCESSIBILITY										<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR										INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input type="checkbox"/> NO										NAME										DISTRICT ID NO																																							

FHR-8-230 June 1978

1 SITE ID NO

E B 4 1 8 - C

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Barn

3 PRIORITY

4 DATE
CA. 19305 DANGER OF DEMOLITION
SPECIFIC THREAT☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 NAMES OF STRUCTURE

Garage

OWNER ADMIN

U. S. Army Corps of Engineers

OWNER'S ADDRESS

% Richard B. Russell RE Project Office
P. O. Box 1050
Elberton, GA 30635

8 STATE

GA

COUNTY NAME

Elbert

CITY VICINITY

Heardmont

CONG DIST

10

STATE

GA

COUNTY NAME

Elbert

CITY VICINITY

Elberton

CONG DIST

10

9 SITE ADDRESS STREET AND NO

Beginning at the intersection of Georgia
State Highway 72 and Elbert County Road 245, proceed generally
north and east on Co. 245 4.6 miles to the intersection with
Co. 244, then southwest on Co. 244 1.4 miles to an unpaved
private road, then southwest on the unpaved (Con't Reversed)

10 EXISTING SURVEY

☐ NPL ☐ NPL ☐ HABR ☐ HAER ☐ HAER ☐ NPS ☐ NPL☐ ONE ☐ STATE ☐ COUNTY ☐ LOCAL ☐ OTHER

11 SPECIAL FEATURES

INTERIOR INTACT

EXTERIOR INTACT

ENVIRONMENT INTACT

12 UTM ZONE

EASTING

344240

NORTHING

3773735

SIGN

SCALE

1:24

1:24

OTHER

QUAD NAME

Heardmont, GA - SC

13 UTM ZONE

EASTING

344240

NORTHING

3773735

SIGN

SCALE

1:24

1:24

OTHER

QUAD NAME

Heardmont, GA - SC

15 CONDITION

☐ EXCELLENT☐ GOOD☐ FAIR☐ DETERIORATED☐ RUINS☐ UNEXPOSED☐ ALTERED☐ DESTROYED☐ DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS,
MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETCOne-story, balloon frame barn, with loft, and post and frame additions, 37' x 36'. Gable roof covered with asphalt
shingles, clapboard siding, no foundations. Original structure one room. The structure is in a fair state of
preservation. It is associated with 12 other structures as part of a small farm complex. See site EB418-A.

18 ORIGINAL USE

Barn

PRESENT USE

Barn

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

20 URBAN AREA 50 000
POP OR MORE?☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?


☐ YES☒ NO

NAME

DISTRICT ID NO

CONT OVER

25. PHOTOS AND SKETCH MAP OF LOCATION

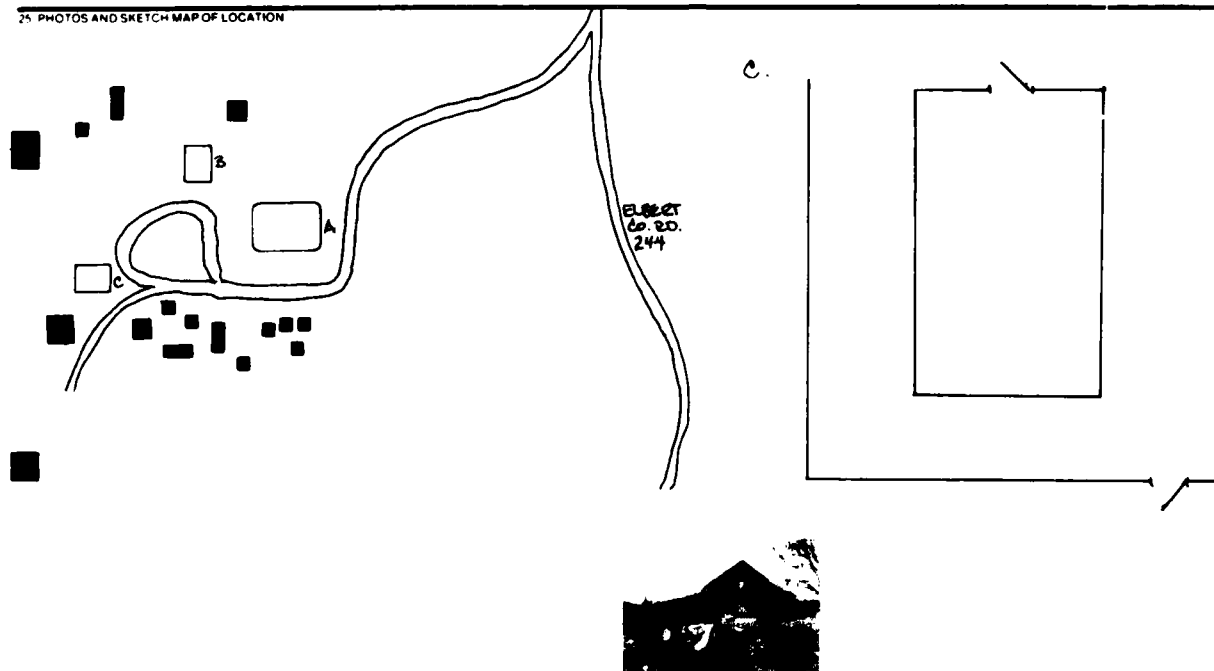

Significance This barn is typical of early twentieth century small farm outbuildings throughout the project area and the southeastern United States. For general comments see site EB418-A.

~~XXXXXXXX~~ CONTINUED: 11. Site Address (Street & No) (Continued)

road .1 mile to the site.

ABSTRACT																							
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM												

INT 4575-78
file extension

OAHMP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 4 3 2		2 PRIORITY		4 DANGER OF DEMOLITION? SPECIFY THREAT		YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
3 Classification		Residence		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1900					
8 NAME OF STRUCTURE		Residence		9 OWNER'S ADDRESS		U. S. Army Corps of Engineers			
				c/o Richard B. Russell Real Estate Project Office					
				P. O. Box 1050					
				Elberton, Georgia 30635					
10 STATE		G A		COUNTY NAME		Elbert		CITY VICINITY	
COUNT				CONG DIST		1 0			
11 SITE ADDRESS, STREET AND NO		Beginning at the intersection of Georgia State Highway 72 and Elbert County Highway 245, proceed generally north and east on Co. 245 4.6 miles to the intersection with		12 EXISTING SURVEYS		13 SPECIAL FEATURES DESCRIBE BELOW			
				14 UTM ZONE		15 CONDITION		16 INVENTORIED BY	
				EASTING		70 <input type="checkbox"/> EXCELLENT		John L. Hopkins, Emily J. Harris	
				NORTHING		71 <input type="checkbox"/> GOOD		Affiliation	
				SIGN		72 <input type="checkbox"/> FAIR		Historic American Buildings Survey	
				SCALE		73 <input checked="" type="checkbox"/> DETERIORATED		DATE	
				17 1 7 3 4 3 3 0 5 3 7 7 4 1 1 0		74 <input type="checkbox"/> RUINS		May 1, 1979	
				UTM ZONE		75 <input type="checkbox"/> UNEXPOSED			
				EASTING		76 <input type="checkbox"/> ALTERED			
				NORTHING		77 <input type="checkbox"/> DESTROYED			
				SIGN		78 <input type="checkbox"/> DEMOLISHED			
				SCALE					
				18 ORIGINAL USE					
				Residence					
				PRESENT USE					
				ADAPTIVE USE					
				19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER					

One-story, balloon frame dwelling with rear addition, four bays wide, one bay deep. Gable roof covered with asphalt shingles; clapboard siding, 4 X 4 sash windows; foundation of log piers. Originally two room central chimney plan with front door for each room, irregularly laid out rear addition connected to original structure by breezeway. Chimney laid in brick upon a fieldstone granite foundation; interior sheathed throughout. Structure not measured due to salvage demolition. Small frame storage building associated with this structure, gable roof, clapboard siding, demolished for salvage.

20 URBAN AREA 50 000 POP OR MORE? YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>		21 NCRS Region		22 PUBLIC ACCESSIBILITY		YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? YES <input type="checkbox"/> NO <input type="checkbox"/>		NAME		DISTRICT ID NO					

25. PHOTOS AND SKETCH MAP OF LOCATION

Sketch map showing a location. The map includes a winding road or path. Key features labeled include 'HOUSE' (a central rectangular building), 'SHOP' (two small squares, one above and one to the right of the house), and 'CRUISE' (a small boat icon on the left side of the road). Several other small black squares are scattered along the road and near the house.


This structure was typical of the small farm houses found throughout the project area and the Southeastern United States. This structure is now in the process of demolition for salvage, and most significant fabric has already been removed. Two remaining outbuildings on the site are suffering similar fates.

11. (continued)

Co. 244, then southeast on Co. 244 .8 mile to an unpaved road, then west .5 mile to the site.

ABSTRACT											
HAND NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILE

INT 4575-78

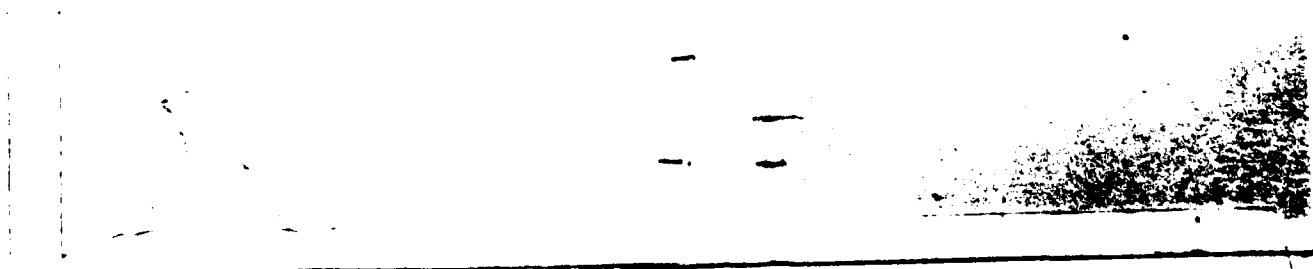

EB432 (Continued)



REFERENCES (CONTINUED)

[illegible]

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										E B 4 3 2									
2 Classification Residence - Continuation										3 PRIORITY									
4 DANGER OF DEMOLITION SPECIFY THREAT										5 DATE									
6 GOVT SOURCE OF THREAT										7 OWNER ADMIN									
8 NAME OF STRUCTURE										9 OWNER'S ADDRESS									
10 STATE COUNTY										11 STATE COUNTY									
12 EXISTING SURVEYS										13 SPECIAL FEATURES DESCRIBE BELOW									
14 UTM ZONE EASTING NORTHING SIGN SCALE										15 CONDITION									
16 INVENTORIED BY										17 AFFILIATION									
18 ORIGINAL USE										19 PRESENT USE									
20 URBAN AREA 50,000 POP OR MORE										21 NCRS Region									
22 PUBLIC ACCESSIBILITY										23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT										25 DISTRICT ID NO									

(CONT OVER)

(CONT OVER)



OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 0 0 - A		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Residence		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1802, 1820				E. Chandler Brown	
8 NAME(S) OF STRUCTURE				9 OWNER'S ADDRESS					
Beverly Plantation				Route 6 Elberton, Georgia 30635					
10 STATE		GA		COUNTY NAME		Elbert		CONG DIST	
								1 0	
11 SITE ADDRESS (STREET & NO.)				12 EXISTING SURVEYS					
Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245, proceed north on Co. 245 1.9 miles to an unpaved private road, then west on the unpaved road .1 mile to the site.				<input checked="" type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLA <input type="checkbox"/> COPE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER					
13 SPECIAL FEATURES (DESCRIBE BELOW)				14 UTM ZONE					
				EASTING: 1 7 3 4 0 4 5 0 NORTHING: 3 7 7 4 8 7 5 SCALE: <input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5 QUAD NAME: Heardmont, GA. - S.C.					
15 CONDITION				16 INVENTORIED BY					
70 <input type="checkbox"/> EXCELLENT 71 <input checked="" type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED				John L. Hopkins, Emily J. Harris					
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS/ENGINEERS, ETC.				AFFILIATION					
Two-story, hewn-frame plantation house with additions, 47' (five bays) X 51' (six bays). Gable and shed roofs covered with sheetmetal, boxed cornice; clapboard siding, 9x9 windows, exterior brick chimneys laid in common bond on fieldstone foundations; foundations of fieldstone granite. Front elevation features a two-story pedimented portico with fanlight, double doors surrounded with transom and sidelights, fluted columns of no order. Plan is irregular, two rooms wide divided by central stair-hall, three rooms deep. Interior finish is of original hand-planed sheathing and dado paneling, detailed fireplace mantels, and original doors with some original hardware. This structure is in a good state of repair, although it is beginning to suffer some water damage. The preservation of this structure could be easily accomplished. Associated with this structure are three outbuildings, only two of which were recorded: (b) Well House, CA. 1910; 1920; (c) Barn, CA. 1900. The final outbuilding is a concrete block garage, CA. 1950. The recorded outbuildings are in good and fair states of preservation, respectively.				Historic American Buildings Survey					
18 ORIGINAL USE				DATE					
Residence				May 1, 1979					
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER				ADAPTIVE USE					
See National Register Nomination Form				Residence					
20 URBAN AREA 50,000 POP OR MORE?				21 NCAS Region				22 PUBLIC ACCESSIBILITY	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO								<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
23 LOCATED IN AN HISTORIC DISTRICT?				24 EDITOR				25 INDEXER	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO									
NAME				DISTRICT ID NO					

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

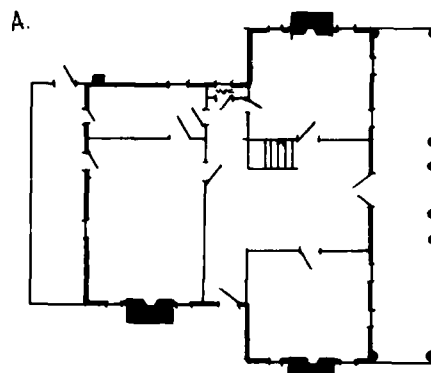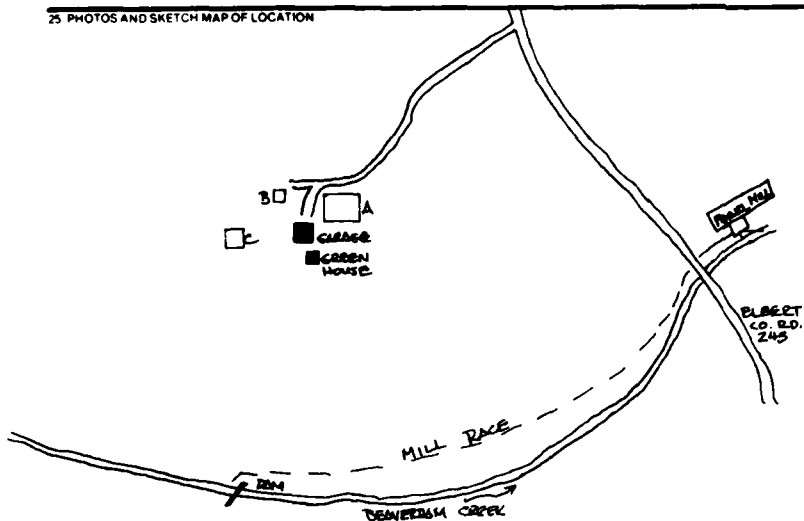

Significance

This superior home is certainly the most impressive structure in the project area, and is among the few such grand plantation houses remaining in Elbert County. Although not directly impacted by the construction and flooding of the Russell Dam, this house site (already listed on the National Register of Historic Places) will be surrounded on three sides by the waters of the proposed lake, which will reach to within 300 feet of the house. This structure has been included in this inventory because of the overwhelming visual impact of the proposed lake upon the site.

REFERENCES/CONTINUED:

ABSTRACT																			
HAZARD	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11

25 PHOTOS AND SKETCH MAP OF LOCATION

EB500-A (Continued)



Significance

REFERENCES (CONTINUED)

ABSTRACT																				
MA	NO	LC	TECH	REPOR	HIST	REPOR	CONTEMP	PHOTO	HIST	PHOTO	CONTEMP	DRWG	HIST	DRWG	COLOR	PLATE	PHOTO	GRAM	SW	FILM

JNT 4575-78
1100 0000000000

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										E B 5 0 0 - A										OAHF INVENTORY										Office of Archeology and Historic Preservation Department of the Interior, Washington, D.C. 20240																																																																					
Classification										Residence - Continuation										1 PRIORITY										4 DANGER OF DEMOLITION? (SPECIFY THREAT)										<input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN																																																											
2 DATE										5 GOVT SOURCE OF THREAT										OWNER										ADMIN																																																																					
3 NAME OF PROPERTY										Beverly Plantation - Continuation										7 OWNER ADMIN										8 OWNER'S ADDRESS																																																																					
10 STATE										COUNTY NAME										CITY VICINITY										CONG DIST										STATE										COUNTY NAME										CITY VICINITY										CONG DIST																													
11 SITE ADDRESS STREET & NO										12 EXISTING SURVEYS										<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6										<input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER																																																																					
13 SPECIAL FEATURE: DESCRIBE BELOW										<input type="checkbox"/> INTERIOR INTACT										<input type="checkbox"/> EXTERIOR INTACT										<input type="checkbox"/> ENVIRONS INTACT																																																																					
14 UTM ZONE										EASTING										NORTHING										SIGN										SCALE										<input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5										QUAD NAME																																							
15 CONDITION										<input type="checkbox"/> EXCELLENT										<input type="checkbox"/> GOOD										<input type="checkbox"/> FAIR										<input type="checkbox"/> DETERIORATED										<input type="checkbox"/> RUINS										<input type="checkbox"/> UNEXPOSED										<input type="checkbox"/> ALTERED										<input type="checkbox"/> DESTROYED										<input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY										AFFILIATION										DATE																																																																															
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.																																																																																																			

(CONT OVER)

18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE																			
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER																																							

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE?										<input type="checkbox"/> YES <input type="checkbox"/> NO										21 NCRS Region										22 PUBLIC ACCESSIBILITY										<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR										INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT?										<input type="checkbox"/> YES <input type="checkbox"/> NO										NAME										DISTRICT ID NO																																							

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 0 0 - B		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Well House				5 DATE CA. 1910-1930		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Beverly Plantation				9 OWNER'S ADDRESS Route 6 Elberton, Georgia 30635					
10 STATE G A		COUNTY NAME Elbert		VICINITY Pearl		CONG DIST 1 0		12 EXISTING SURVEYS	
11 SITE ADDRESS: STREET & NO. Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245, proceed north on Co. 245 1.9 miles to an unpaved private road, then west on the unpaved								13 SPECIAL FEATURE: DESCRIBE BELOW	
14 UTM ZONE 1 7		EASTING 3 4 0 4 5 0		NORTHING 3 7 7 4 8 7 5		SIGN		15 CONDITION	
16 INVENTORIED BY John L. Hopkins, Emily J. Harris				AFFILIATION Historic American Buildings Survey				DATE May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.									

One-story, post-and-frame well house, 7' X 12'. Gable roof covered with asphalt shingles; vertical board roof apron, wooden shingles on enclosed portion; fieldstone granite piers as foundations. Plan of an open-sided covering for the well, with added storage room. Interior inaccessible. This structure is in a fair state of preservation and could easily be restored. Associated with this structure are three other structures. See EB500-A for general comments.


(CONT OVER)

18 ORIGINAL USE Well House		PRESENT USE Well House		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO				INDEXER	

25 PHOTOS AND SKETCH MAP OF LOCATION

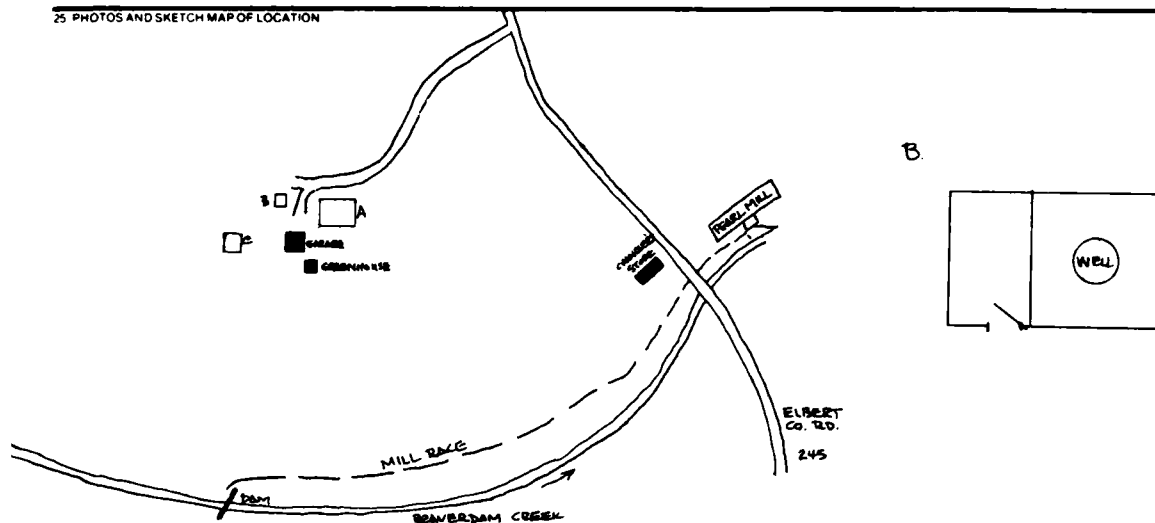

Significance

This well house is a unique structure within the project area, although the singular nature of this structure derives completely from the addition of the storage room at rear. See EB500-A for general comments.

11. (continued) road .1 mile to the site.

ABSTRACT																				
HA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COL. DRG. A	PH. PROGRAM	SW	FILM								

INT 4575-78
GPO : 1964 O - 618-800

25 PHOTOS AND SKETCH MAP OF LOCATION

EB500-B (Continued)




Significance

REFERENCES: CONTINUED:

ABSTRACT														
HA AND	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRAWG	HIST DRAWG	COLOR PLATE	PHOTOCAM	SW	FILM			

TNT 4575-78
100 0000000000

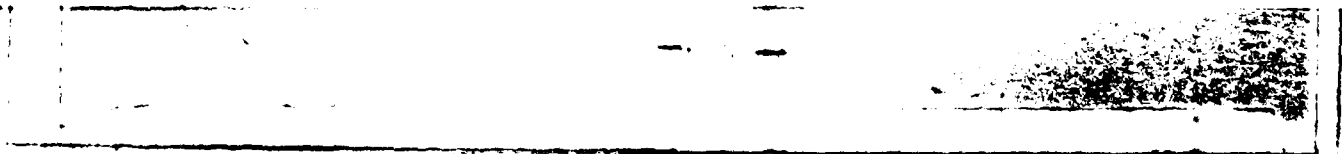

FHR-8-230 June 1978

1 SITE ID NO

E B 5 0 0 - B

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

Classification Well House - Continuation		3 PRIORITY	4 DANGER OF DEMOLITION SPECIFY THREAT <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
		5 DATE	6 GOVT SOURCE OF THREAT OWNER ADMIN	
			7 OWNER ADMIN	
8 NAME - STRUCTURE Beverly Plantation - Continuation		9 OWNER'S ADDRESS		
10 STATE	11 COUNTY NAME	12 CITY VICINITY	13 CONG DIST	
14 STATE	15 COUNTY	16 COUNTY NAME	17 CITY VICINITY	18 CONG DIST
19 EXISTING SURVEYS <input type="checkbox"/> NHP <input type="checkbox"/> NML <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		20 SPECIAL FEATURES DESCRIBE BELOW: <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT		
21 FOUNDATION	22 EARTHING	23 ROOFING	24 SIGN	25 SCALE
26 FOUNDATION	27 EARTHING	28 ROOFING	29 SIGN	30 SCALE
31 FOUNDATION	32 EARTHING	33 ROOFING	34 SIGN	35 SCALE
36 FOUNDATION	37 EARTHING	38 ROOFING	39 SIGN	40 SCALE
41 FOUNDATION	42 EARTHING	43 ROOFING	44 SIGN	45 SCALE
46 FOUNDATION	47 EARTHING	48 ROOFING	49 SIGN	50 SCALE
51 FOUNDATION	52 EARTHING	53 ROOFING	54 SIGN	55 SCALE
56 FOUNDATION	57 EARTHING	58 ROOFING	59 SIGN	60 SCALE
61 FOUNDATION	62 EARTHING	63 ROOFING	64 SIGN	65 SCALE
66 FOUNDATION	67 EARTHING	68 ROOFING	69 SIGN	70 SCALE
71 FOUNDATION	72 EARTHING	73 ROOFING	74 SIGN	75 SCALE
76 FOUNDATION	77 EARTHING	78 ROOFING	79 SIGN	80 SCALE
81 FOUNDATION	82 EARTHING	83 ROOFING	84 SIGN	85 SCALE
86 FOUNDATION	87 EARTHING	88 ROOFING	89 SIGN	90 SCALE
91 FOUNDATION	92 EARTHING	93 ROOFING	94 SIGN	95 SCALE
96 FOUNDATION	97 EARTHING	98 ROOFING	99 SIGN	100 SCALE
101 FOUNDATION	102 EARTHING	103 ROOFING	104 SIGN	105 SCALE
106 FOUNDATION	107 EARTHING	108 ROOFING	109 SIGN	110 SCALE
111 FOUNDATION	112 EARTHING	113 ROOFING	114 SIGN	115 SCALE
116 FOUNDATION	117 EARTHING	118 ROOFING	119 SIGN	120 SCALE
121 FOUNDATION	122 EARTHING	123 ROOFING	124 SIGN	125 SCALE
126 FOUNDATION	127 EARTHING	128 ROOFING	129 SIGN	130 SCALE
131 FOUNDATION	132 EARTHING	133 ROOFING	134 SIGN	135 SCALE
136 FOUNDATION	137 EARTHING	138 ROOFING	139 SIGN	140 SCALE
141 FOUNDATION	142 EARTHING	143 ROOFING	144 SIGN	145 SCALE
146 FOUNDATION	147 EARTHING	148 ROOFING	149 SIGN	150 SCALE
151 FOUNDATION	152 EARTHING	153 ROOFING	154 SIGN	155 SCALE
156 FOUNDATION	157 EARTHING	158 ROOFING	159 SIGN	160 SCALE
161 FOUNDATION	162 EARTHING	163 ROOFING	164 SIGN	165 SCALE
166 FOUNDATION	167 EARTHING	168 ROOFING	169 SIGN	170 SCALE
171 FOUNDATION	172 EARTHING	173 ROOFING	174 SIGN	175 SCALE
176 FOUNDATION	177 EARTHING	178 ROOFING	179 SIGN	180 SCALE
181 FOUNDATION	182 EARTHING	183 ROOFING	184 SIGN	185 SCALE
186 FOUNDATION	187 EARTHING	188 ROOFING	189 SIGN	190 SCALE
191 FOUNDATION	192 EARTHING	193 ROOFING	194 SIGN	195 SCALE
196 FOUNDATION	197 EARTHING	198 ROOFING	199 SIGN	200 SCALE
201 FOUNDATION	202 EARTHING	203 ROOFING	204 SIGN	205 SCALE
206 FOUNDATION	207 EARTHING	208 ROOFING	209 SIGN	210 SCALE
211 FOUNDATION	212 EARTHING	213 ROOFING	214 SIGN	215 SCALE
216 FOUNDATION	217 EARTHING	218 ROOFING	219 SIGN	220 SCALE
221 FOUNDATION	222 EARTHING	223 ROOFING	224 SIGN	225 SCALE
226 FOUNDATION	227 EARTHING	228 ROOFING	229 SIGN	230 SCALE
231 FOUNDATION	232 EARTHING	233 ROOFING	234 SIGN	235 SCALE
236 FOUNDATION	237 EARTHING	238 ROOFING	239 SIGN	240 SCALE
241 FOUNDATION	242 EARTHING	243 ROOFING	244 SIGN	245 SCALE
246 FOUNDATION	247 EARTHING	248 ROOFING	249 SIGN	250 SCALE
251 FOUNDATION	252 EARTHING	253 ROOFING	254 SIGN	255 SCALE
256 FOUNDATION	257 EARTHING	258 ROOFING	259 SIGN	260 SCALE
261 FOUNDATION	262 EARTHING	263 ROOFING	264 SIGN	265 SCALE
266 FOUNDATION	267 EARTHING	268 ROOFING	269 SIGN	270 SCALE
271 FOUNDATION	272 EARTHING	273 ROOFING	274 SIGN	275 SCALE
276 FOUNDATION	277 EARTHING	278 ROOFING	279 SIGN	280 SCALE
281 FOUNDATION	282 EARTHING	283 ROOFING	284 SIGN	285 SCALE
286 FOUNDATION	287 EARTHING	288 ROOFING	289 SIGN	290 SCALE
291 FOUNDATION	292 EARTHING	293 ROOFING	294 SIGN	295 SCALE
296 FOUNDATION	297 EARTHING	298 ROOFING	299 SIGN	300 SCALE
301 FOUNDATION	302 EARTHING	303 ROOFING	304 SIGN	305 SCALE
306 FOUNDATION	307 EARTHING	308 ROOFING	309 SIGN	310 SCALE
311 FOUNDATION	312 EARTHING	313 ROOFING	314 SIGN	315 SCALE
316 FOUNDATION	317 EARTHING	318 ROOFING	319 SIGN	320 SCALE
321 FOUNDATION	322 EARTHING	323 ROOFING	324 SIGN	325 SCALE
326 FOUNDATION	327 EARTHING	328 ROOFING	329 SIGN	330 SCALE
331 FOUNDATION	332 EARTHING	333 ROOFING	334 SIGN	335 SCALE
336 FOUNDATION	337 EARTHING	338 ROOFING	339 SIGN	340 SCALE
341 FOUNDATION	342 EARTHING	343 ROOFING	344 SIGN	345 SCALE
346 FOUNDATION	347 EARTHING	348 ROOFING	349 SIGN	350 SCALE
351 FOUNDATION	352 EARTHING	353 ROOFING	354 SIGN	355 SCALE
356 FOUNDATION	357 EARTHING	358 ROOFING	359 SIGN	360 SCALE
361 FOUNDATION	362 EARTHING	363 ROOFING	364 SIGN	365 SCALE
366 FOUNDATION	367 EARTHING	368 ROOFING	369 SIGN	370 SCALE
371 FOUNDATION	372 EARTHING	373 ROOFING	374 SIGN	375 SCALE
376 FOUNDATION	377 EARTHING	378 ROOFING	379 SIGN	380 SCALE
381 FOUNDATION	382 EARTHING	383 ROOFING	384 SIGN	385 SCALE
386 FOUNDATION	387 EARTHING	388 ROOFING	389 SIGN	390 SCALE
391 FOUNDATION	392 EARTHING	393 ROOFING	394 SIGN	395 SCALE
396 FOUNDATION	397 EARTHING	398 ROOFING	399 SIGN	400 SCALE
401 FOUNDATION	402 EARTHING	403 ROOFING	404 SIGN	405 SCALE
406 FOUNDATION	407 EARTHING	408 ROOFING	409 SIGN	410 SCALE
411 FOUNDATION	412 EARTHING	413 ROOFING	414 SIGN	415 SCALE
416 FOUNDATION	417 EARTHING	418 ROOFING	419 SIGN	420 SCALE
421 FOUNDATION	422 EARTHING	423 ROOFING	424 SIGN	425 SCALE
426 FOUNDATION	427 EARTHING	428 ROOFING	429 SIGN	430 SCALE
431 FOUNDATION	432 EARTHING	433 ROOFING	434 SIGN	435 SCALE
436 FOUNDATION	437 EARTHING	438 ROOFING	439 SIGN	440 SCALE
441 FOUNDATION	442 EARTHING	443 ROOFING	444 SIGN	445 SCALE
446 FOUNDATION	447 EARTHING	448 ROOFING	449 SIGN	450 SCALE
451 FOUNDATION	452 EARTHING	453 ROOFING	454 SIGN	455 SCALE
456 FOUNDATION	457 EARTHING	458 ROOFING	459 SIGN	460 SCALE
461 FOUNDATION	462 EARTHING	463 ROOFING	464 SIGN	465 SCALE
466 FOUNDATION	467 EARTHING	468 ROOFING	469 SIGN	470 SCALE
471 FOUNDATION	472 EARTHING	473 ROOFING	474 SIGN	475 SCALE
476 FOUNDATION	477 EARTHING	478 ROOFING	479 SIGN	480 SCALE
481 FOUNDATION	482 EARTHING	483 ROOFING	484 SIGN	485 SCALE
486 FOUNDATION	487 EARTHING	488 ROOFING	489 SIGN	490 SCALE
491 FOUNDATION	492 EARTHING	493 ROOFING	494 SIGN	495 SCALE
496 FOUNDATION	497 EARTHING	498 ROOFING	499 SIGN	500 SCALE
501 FOUNDATION	502 EARTHING	503 ROOFING	504 SIGN	505 SCALE
506 FOUNDATION	507 EARTHING	508 ROOFING	509 SIGN	510 SCALE
511 FOUNDATION	512 EARTHING	513 ROOFING	514 SIGN	515 SCALE
516 FOUNDATION	517 EARTHING	518 ROOFING	519 SIGN	520 SCALE
521 FOUNDATION	522 EARTHING	523 ROOFING	524 SIGN	525 SCALE
526 FOUNDATION	527 EARTHING	528 ROOFING	529 SIGN	530 SCALE
531 FOUNDATION	532 EARTHING	533 ROOFING	534 SIGN	535 SCALE
536 FOUNDATION	537 EARTHING	538 ROOFING	539 SIGN	540 SCALE
541 FOUNDATION	542 EARTHING	543 ROOFING	544 SIGN	545 SCALE
546 FOUNDATION	547 EARTHING	548 ROOFING	549 SIGN	550 SCALE
551 FOUNDATION	552 EARTHING	553 ROOFING	554 SIGN	555 SCALE
556 FOUNDATION	557 EARTHING	558 ROOFING	559 SIGN	560 SCALE
561 FOUNDATION	562 EARTHING	563 ROOFING	564 SIGN	565 SCALE
566 FOUNDATION	567 EARTHING	568 ROOFING	569 SIGN	570 SCALE
571 FOUNDATION	572 EARTHING	573 ROOFING	574 SIGN	575 SCALE
576 FOUNDATION	577 EARTHING	578 ROOFING	579 SIGN	580 SCALE
581 FOUNDATION	582 EARTHING	583 ROOFING	584 SIGN	585 SCALE
586 FOUNDATION	587 EARTHING	588 ROOFING	589 SIGN	590 SCALE
591 FOUNDATION	592 EARTHING	593 ROOFING	594 SIGN	595 SCALE
596 FOUNDATION	597 EARTHING	598 ROOFING	599 SIGN	600 SCALE
601 FOUNDATION	602 EARTHING	603 ROOFING	604 SIGN	605 SCALE
606 FOUNDATION	607 EARTHING	608 ROOFING	609 SIGN	610 SCALE
611 FOUNDATION	612 EARTHING	613 ROOFING	614 SIGN	615 SCALE
616 FOUNDATION	617 EARTHING	618 ROOFING	619 SIGN	620 SCALE
621 FOUNDATION	622 EARTHING	623 ROOFING	624 SIGN	625 SCALE
626 FOUNDATION	627 EARTHING	628 ROOFING	629 SIGN	630 SCALE
631 FOUNDATION	632 EARTHING	633 ROOFING	634 SIGN	635 SCALE
636 FOUNDATION	637 EARTHING	638 ROOFING	639 SIGN	640 SCALE
641 FOUNDATION	642 EARTHING	643 ROOFING	644 SIGN	645 SCALE
646 FOUNDATION	647 EARTHING	648 ROOFING	649 SIGN	650 SCALE
651 FOUNDATION	652 EARTHING	653 ROOFING	654 SIGN	655 SCALE
656 FOUNDATION	657 EARTHING	658 ROOFING	659 SIGN	660 SCALE
661 FOUNDATION	662 EARTHING	663 ROOFING	664 SIGN	665 SCALE
666 FOUNDATION	667 EARTHING	668 ROOFING	669 SIGN	670 SCALE
671 FOUNDATION	672 EARTHING	673 ROOFING	674 SIGN	675 SCALE
676 FOUNDATION	677 EARTHING	678 ROOFING	679 SIGN	680 SCALE
681 FOUNDATION	682 EARTHING	683 ROOFING	684 SIGN	685 SCALE
686 FOUNDATION	687 EARTHING	688 ROOFING	689 SIGN	690 SCALE
691 FOUNDATION	692 EARTHING	693 ROOFING	694 SIGN	695 SCALE
696 FOUNDATION	697 EARTHING	698 ROOFING	699 SIGN	700 SCALE
701 FOUNDATION	702 EARTHING	703 ROOFING	704 SIGN	705 SCALE
706 FOUNDATION	707 EARTHING	708 ROOFING	709 SIGN	710 SCALE
711 FOUNDATION	712 EARTHING	713 ROOFING	714 SIGN	715 SCALE
716 FOUNDATION	717 EARTHING	718 ROOFING	719 SIGN	720 SCALE
721 FOUNDATION	722 EARTHING	723 ROOFING	724 SIGN	725 SCALE
726 FOUNDATION	727 EARTHING	728 ROOFING	729 SIGN	730 SCALE
731 FOUNDATION	732 EARTHING	733 ROOFING	734 SIGN	735 SCALE
736 FOUNDATION	737 EARTHING	738 ROOFING	739 SIGN	740 SCALE
741 FOUNDATION	742 EARTHING	743 ROOFING	744 SIGN	745 SCALE
746 FOUNDATION	747 EARTHING	748 ROOFING	749 SIGN	750 SCALE
751 FOUNDATION	752 EARTHING	753 ROOFING	754 SIGN	755 SCALE
756 FOUNDATION	757 EARTHING	758 ROOFING	759 SIGN	760 SCALE
761 FOUNDATION	762 EARTHING	763 ROOFING	764 SIGN	765 SCALE
766 FOUNDATION	767 EARTHING	768 ROOFING	769 SIGN	770 SCALE
771 FOUNDATION	772 EARTHING	773 ROOFING	774 SIGN	775 SCALE
776 FOUNDATION	777 EARTHING	778 ROOFING	779 SIGN	780 SCALE
781 FOUNDATION	782 EARTHING	783 ROOFING	784 SIGN	785 SCALE
786 FOUNDATION	787 EARTHING	788 ROOFING	789 SIGN	790 SCALE
791 FOUNDATION	792 EARTHING	793 ROOFING	794 SIGN	795 SCALE
796 FOUNDATION	797 EARTHING	798 ROOFING	799 SIGN	800 SCALE
801 FOUNDATION	802 EARTHING	803 ROOFING	804 SIGN	805 SCALE
806 FOUNDATION	807 EARTHING	808 ROOFING	809 SIGN	810 SCALE
811 FOUNDATION	812 EARTHING	813 ROOFING	814 SIGN	815 SCALE
816 FOUNDATION	817 EARTHING	818 ROOFING	819 SIGN	820 SCALE
821 FOUNDATION	822 EARTHING	823 ROOFING	824 SIGN	825 SCALE
826 FOUNDATION	827 EARTHING	828 ROOFING	829 SIGN	830 SCALE
831 FOUNDATION	832 EARTHING	833 ROOFING	834 SIGN	835 SCALE
836 FOUNDATION	837 EARTHING	838 ROOFING	839 SIGN	840 SCALE
841 FOUNDATION	842 EARTHING	843 ROOFING	844 SIGN	845 SCALE
846 FOUNDATION	847 EARTHING	848 ROOFING	849 SIGN	850 SCALE
851 FOUNDATION	852 EARTHING	853 ROOFING	854 SIGN	855 SCALE
856 FOUNDATION	857 EARTHING	858 ROOFING	859 SIGN	860 SCALE
861 FOUNDATION	862 EARTHING	863 ROOFING	864 SIGN	865 SCALE
866 FOUNDATION	867 EARTHING	868 ROOFING	869 SIGN	870 SCALE
871 FOUNDATION	872 EARTHING	873 ROOFING	874 SIGN	875 SCALE
876 FOUNDATION	877 EARTHING	878 ROOFING	879 SIGN	880 SCALE
881 FOUNDATION	882 EARTHING	883 ROOFING	884 SIGN	885 SCALE
886 FOUNDATION	887 EARTHING	888 ROOFING	889 SIGN	890 SCALE
891 FOUNDATION	892 EARTHING	893 ROOFING	894 SIGN	895 SCALE
896 FOUNDATION	897 EARTHING	898 ROOFING	899 SIGN	900 SCALE
901 FOUNDATION	902 EARTHING	903 ROOFING	904 SIGN	905 SCALE
906 FOUNDATION	907 EARTHING	908 ROOFING	909 SIGN	910 SCALE
911 FOUNDATION	912 EARTHING	913 ROOFING	914 SIGN	915 SCALE
916 FOUNDATION	917 EARTHING	918 ROOFING	919 SIGN	920 SCALE
921 FOUNDATION	922 EARTHING	923 ROOFING	924 SIGN	925 SCALE
926 FOUNDATION	927 EARTHING	928 ROOFING	929 SIGN	930 SCALE
931 FOUNDATION	932 EARTHING	933 ROOFING	934 SIGN	935 SCALE
936 FOUNDATION	937 EARTHING	938 ROOFING	939 SIGN	940 SCALE
941 FOUNDATION	942 EARTHING	943 ROOFING	944 SIGN	945 SCALE
946 FOUNDATION	947 EARTHING	948 ROOFING	949 SIGN	950 SCALE
951 FOUNDATION	952 EARTHING	953 ROOFING	954 SIGN	955 SCALE
956 FOUNDATION	957 EARTHING	958 ROOFING	959 SIGN	960 SCALE
961 FOUNDATION	962 EARTHING	963 ROOFING	964 SIGN	965 SCALE
966 FOUNDATION	967 EARTH			



FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 0 0 - C		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Barn		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1900					
8 NAME OF STRUCTURE		Beverly Plantation		9 OWNER'S ADDRESS		Route 6 Elberton, Georgia 30635			
10 STATE		G A		COUNTY NAME		Elbert		VICINITY	
COUNTY		Pearl		CONG DIST		1 0			
11 SITE ADDRESS (STREET NO.)		Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245, proceed north on Co. 245 1.9 miles to an unpaved private road, then west on the unpaved road .1 mile to the site.		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS			
						<input type="checkbox"/> ONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER			
				13 SPECIAL FEATURES: DESCRIBE BELOW		<input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT			
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 4 0 4 5 0		3 7 7 4 8 7 5				1:24 1:625	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								1:24 1:625	
15 CONDITION		20 EXCELLENT		21 GOOD		22 FAIR		23 DETERIORATED	
								24 RUINS 25 UNEXPOSED 26 ALTERED 27 DESTROYED 28 DEMOLISHED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.									
One-story (with loft), post-and-frame barn, 17' X 20'. Gable roof covered with sheetmetal; clapboard siding with wooden shingle gable ends; foundations of fieldstone granite piers. Plan of two rooms. This structure is in a fair state of repair, and could be easily restored. This structure is associated with three other structures on this site, see EB500-A for general comments.									
(CONT OVER)									
18 ORIGINAL USE		Barn		PRESENT USE		Barn		ADAPTIVE USE	
19 REFERENCES: HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER		Unknown							
(CONT OVER)									
20 URBAN AREA 50,000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
						<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

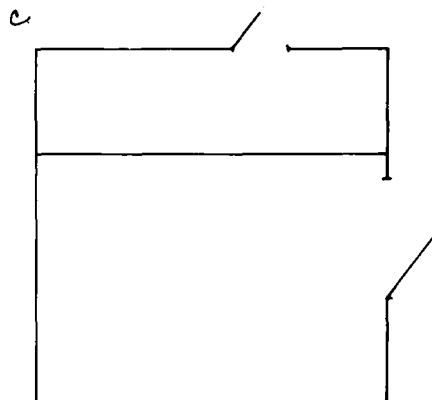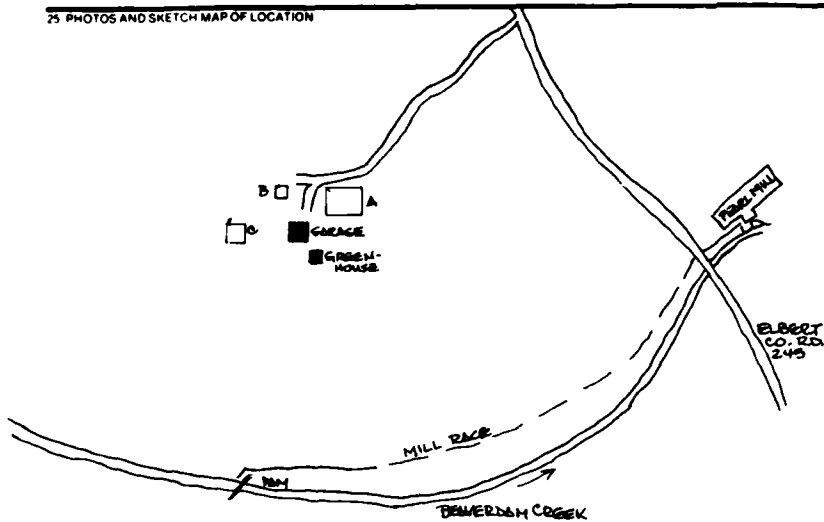

Significance

This small barn is typical of such structures found throughout the project area and in the surrounding regions. See EB500-A for associated significance.

REFERENCES (CONTINUED)

ABSTRACT																			
NA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM							

INT 4575-78
11 00 000000 0000

1 SITE ID NO										E B S O I										OAHPS INVESTIGATION										OFFICE OF HISTORIC PRESERVATION, U.S. DEPARTMENT OF THE INTERIOR, WASHINGTON, D.C. 20240									
2 CLASSIFICATION										3 PRIORITY										4 DANGER OF DEMOLITION SPECIFY THREAT										5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>									
Bulk Products (Food)										1 3 2 0										Demolition--In flood pool of new dam																			
Bulk Products (Text)										1 5 0 0										6 GOVT SOURCE OF THREAT										OWNED <input type="checkbox"/> ADMIN <input type="checkbox"/>									
										DATE 1807; 1889 1900										7 OWNER ADMIN										United States Federal Government									
8 NAME(S) OF STRUCTURE										Gray-Pearl Mill										9 OWNER'S ADDRESS										c/o Richard B. Russell Project P.O. Box 1050, Elberton, GA									
10 STATE G A COUNTY NAME Elbert CITY VICINITY Elberton CONG DIST 1 D										STATE G A COUNTY NAME Elbert CITY VICINITY Elberton CONG DIST 1 D																													
11 SITE ADDRESS (STREET & NO.)										Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245, proceed north on Co. Road 245 1.7 mile to the site, on Beaverdam Creek.										12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLP <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER										13 SPECIAL FEATURES DESCRIBE BELOW <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT									
14 UTM ZONE EASTING NORTHING SIGN SCALE <input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62,500 QUAD NAME										1 7 3 4 0 5 4 5 3 7 7 2 8 2 0																													
UTM ZONE EASTING NORTHING SIGN SCALE <input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62,500 QUAD NAME																																							
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED																																							
16 INVENTORIED BY										John L. Hopkins, Emily J. Harris										AFFILIATION HABS										DATE May 1, 1979									
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS MATERIALS EXANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC. According to informant evidence, this site was a cotton manufactory of 5,000 spindles used in the production of cotton yarns, thread and hatting. The earliest known use of the site was Gray's Mill documented to exist in 1811 on property purchased in 1809 by Joseph Gray, Sr. The mill was still in existence in 1889, when it was purchased and extensively enlarged for use as the Heardmont Cotton Mill by William Mattox and J.W. McCalla. The mill burned in September of 1890 after only three months of production. The mill was sold in 1895 to the Swift brothers, and was placed back in production in the spring of 1900. It is believed that parts of the original structure Gray's Mill were incorporated into the 1889 extensions, and are still in evidence on the site today. The mill operated until ca. 1934 under the name of the Pearl Cotton Mills, when it burned for the last time. See HABS report "The Industrial History of the Russell Project Area" for further description, documentation and sources. The mill ruins still retain much of their integrity and the site is likely to yield much important information on 19th century, (CONT. OVER)																																							
18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE																			
Grist Mill and Cotton Mill										Ruins										Reservoir																			
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER																																							
See HABS report "The Industrial History of the Russell Project Area"																																							
20 URBAN AREA 40,000 SQ FT OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO										21 NERS Region										22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO										NAME										DISTRICT NO																			

Mill
Site



XXXXXXXXXXXX Southern mill design and technology.

[illegible]

INT 4575-78

FHR-8-230 June 1978

1 SITE ID NO

E B 5 0 5

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

Classification

Barn

2 PRIORITY

3 DATE
CA. 18704 DANGER OF DEMOLITION
SPECIFY THREAT☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

5 GOVT SOURCE OF THREAT

OWNER

ADMIN

6 OWNER ADMIN

U. S. Army Corps of Engineers

7 NAME OF STRUCTURE

Barn

8 OWNER'S ADDRESS

c/o Richard B. Russell Real Estate Project Office
P. O. Box 1050
Elberton, Georgia 30635

9 STATE

G A

COUNTY NAME

Elbert

10 COMMUNITY

Middleton

11 LONG

DIST

1 0

12 STATE

G A

COUNTY NAME

Elbert

13 CITY

Elberton

14 CONG

DIST

1 0

15 SITE ADDRESS (STREET NO) Beginning at the intersection of Georgia
State Highway 72 and Elbert County Road 245 proceed north-
west on Georgia State Highway 72 0.5 mile to an unpaved
road, then northeast on the unpaved private road 1.2 miles

16 EXISTING

☐ NR ☐ NHL ☐ HABS ☐ HAER ☐ HAER ☐ NPS ☐ CLS

17 SPECIAL FEATURES (ENTER WHERE BELOW)

☒ INTERIOR INTACT☒ EXTERIOR INTACT☐ ENVIRONS INTACT

18 UTM ZONE

EASTING

NORTHING

19 SCALE

20 QUAD

21 NAME

Elberton East, Georgia

22 UTM ZONE

EASTING

NORTHING

23 SCALE

24 QUAD

25 NAME

26 CONDITION

☐ EXCELLENT☐ GOOD☐ FAIR☐ DETERIORATED

27 RUINS

☐ UNEXPOSED☐ ALTERED

28 DESTROYED

29 DEMOLISHED

30 INVENTORIED BY

John L. Hopkins, Emily J. Harris

31 AFFILIATION

Historic American Buildings Survey

32 DATE

May 1, 1979

33 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETCTwo-story balloon frame barn, with side shed addition, 31' X 22'. Gable roof covered with sheetmetal; horizontal
sheathing on original, vertical sheathing on addition; foundation of milled granite piers. Plan of three rooms.
This structure is fairly well preserved, although it is deteriorating rapidly. It is the only surviving structure
on the site.

34 ORIGINAL USE

Barn

35 PRESENT USE

Barn

36 ADAPTIVE USE

37 REFERENCES (HISTORICAL REFERENCES PERSONAL CONTACTS AND OTHER)

Unknown

38 URBAN AREA 50 000

POP OR MORE?

☐ YES ☒ NO

39 NCRS Region

40 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

41 EDITOR

42 INDEXER

43 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO


NAME

DISTRICT ID NO

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

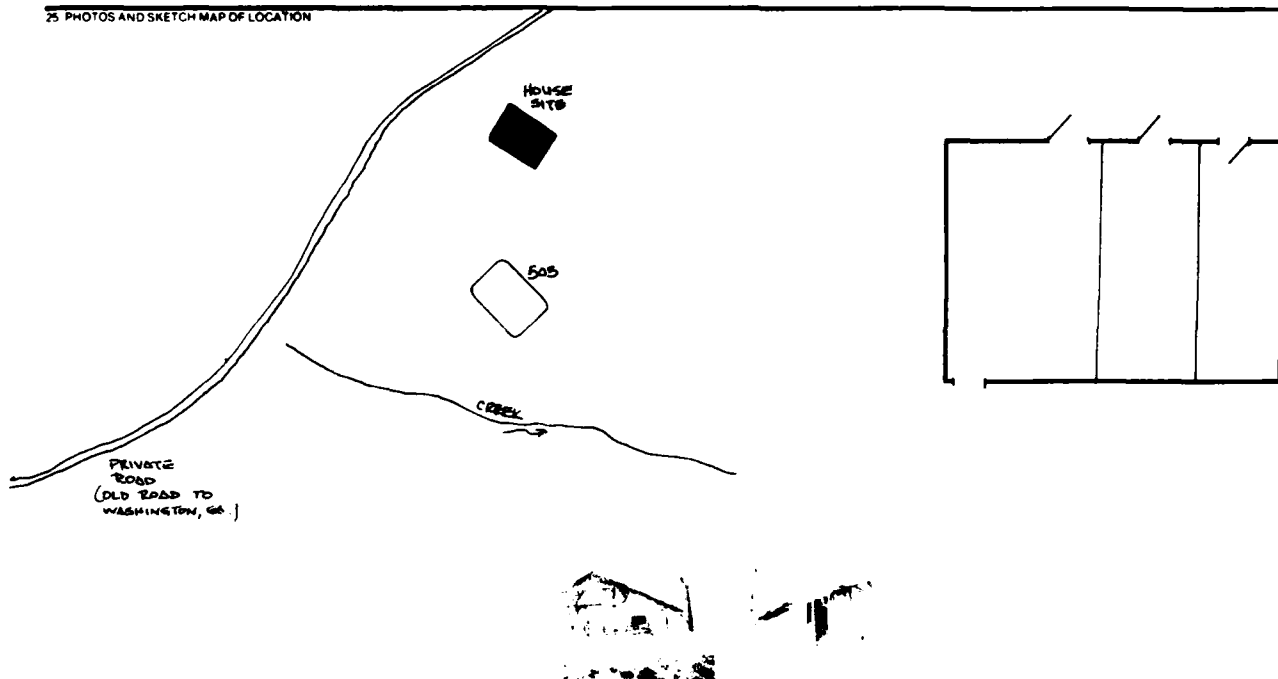

Significance

This is a typical example of a late nineteenth century barn found throughout the project area and the Southeastern United States. It is the only surviving structure from a small farm complex, once located on the same site.

11. (continued) to the site.

ABSTRACT																			
HIST. NO.	LC	TECH. REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRWG	HIST. DRWG	CO. SECT. ART	PH. DRAW	SA	FLM								

INT 4575-78
11. (continued) to the site.

FHR 8730 June 1978

UNITED NO

E B 5 0 5

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

Classification

Barn

PROPERTY

CA. 1870

Corps of Engineers (Demolition)

U. S. Army Corps of Engineers

Barn

c/o Richard B. Russell Real Estate Project Office
P. O. Box 1050
Elberton, Georgia 30635

COUNTY G A Elbert MIDDLETON

COUNTY G A Elbert Elberton

Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 245 proceed northwest on Georgia State Highway 72 0.5 mile to an unpaved road, then northeast on the unpaved private road 1.2 miles

17 33 95 00 377 14 50 377 34 50

Elberton East, Georgia

John L. Hopkins, Emily J. Harris

Historic American Buildings Survey

May 1, 1979

Two-story balloon frame barn, with side shed addition, 31' X 22'. Gable roof covered with sheetmetal; horizontal sheathing on original, vertical sheathing on addition; foundation of milled granite piers. Plan of three rooms. This structure is fairly well preserved, although it is deteriorating rapidly. It is the only surviving structure on the site.

Barn

Barn

Unknown

NCRS Region

YES NO

NCRS Region

PUBLIC ACCESSIBILITY

YES LIMITED NO

YES UNLIMITED UNKNOWN

23 FLOOR

24 FLOOR

25 FLOOR

26 FLOOR

27 FLOOR

24. PHOTOGRAPH AND KEY TO MAP OF LOCATION





Significance

This is a typical example of a late nineteenth century barn found throughout the project area and the Southeastern United States. It is the only surviving structure from a small farm complex, once located on the same site.

NEWPORT NEWS RECORDING

11. (continued) to the site.

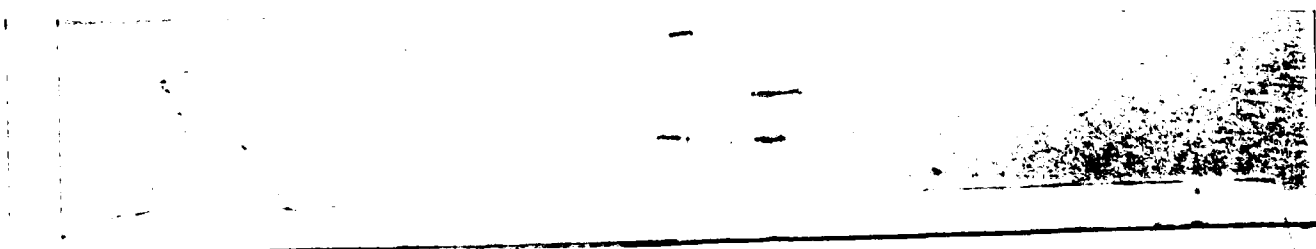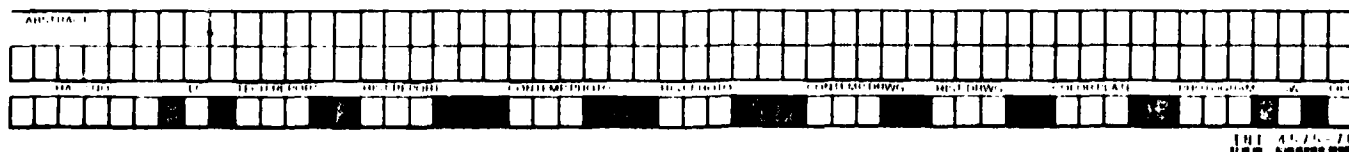

FHR-8-230 June 1978

DOE'D 1978
OAHMP INVENTORYOffice of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO E E 5 0 7																		
2 Classification Residence					3 PRIORITY		4 DANGER OF DEMOLITION* (SPECIFY THREAT) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Salvage by owner											
					4 DATE CA. 1840		6 GOVT SOURCE OF THREAT OWNER ADMIN											
8 NAME S OF STRUCTURE Eureka House					9 OWNER'S ADDRESS c/o Mr. Peyton S. Hawes, Jr., Cofer, Beauchamp & Hawes Suite 200, Peachtree and Broad Building Atlanta, Georgia 30303													
10 STATE G A		COUNTY NAME Elbert			VICINITY Middleton		CONG DIST 10		STATE G A		COUNTY NAME Atlanta			VICINITY Atlanta		CONG DIST		
11 SITE ADDRESS STREET AND NO Beginning at the intersection of Georgia State Highway 72, and Elbert County Highway S2218, proceed northeast on Co. S2218 1.7 miles to the site.																		
14 UTM ZONE 17				EASTING 337890				NORTHING 3775030				SIGN		SCALE 1:24		QUAD NAME Elberton East, Georgia		
UTM ZONE				EASTING				NORTHING				SIGN		SCALE 1:24		QUAD NAME		
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input checked="" type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 80 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED																		
16 INVENTORIED BY John L. Hopkins, Emily J. Harris										AFFILIATION Historic American Buildings Survey				DATE May 1, 1979				
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS MATERIALS EX-TANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC One and one-half story, hewn-frame dwelling, 46' (three bays) X 81' (five bays). Gable roofs covered with asphalt singles over wood shingles. Single dormer on either side of projecting pedimented porch roof, boxed cornice; clapboard siding, 9 X 9 sash windows, front and rear surrounded with transom and sidelights; foundations of massive quarried granite piers. Plan is T-shaped, two rooms wide divided by central hall, two rooms deep, with breezeway dividing main portion from rear kitchen wing. Three interior chimneys laid of quarried granite through second floor narrowing to brick flues; interior finish is of split lath and plaster in major rooms, remainder is sheathed with hand-planed boards. Though deteriorated by vandalism and neglect, this structure could easily be preserved. Most important architectural fabric survives intact, while good photographic evidence of the missing fabric exists. Associated with this structure is a deteriorated privy (not recorded), a well adjacent to kitchen.																		
18 ORIGINAL USE Residence					PRESENT USE Abandoned					ADAPTIVE USE								
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown																		
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO																		
21 NCAS Region				22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN				23 EDITOR INDEXER										
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO NAME DISTRICT ID NO																		

This site is an extremely important building for the project area, as it is one of few Antebellum homes still in existence. The architectural quality of the building, though deteriorated through vandalism and neglect, is easily detectable and would be as easily restored. Historically, this house is as important as its architectural significance. It is believed that this home was the plantation house for the Grogan estate. At one time, the "Eureka" Mill was included in this property on the Beaverdam Creek, which was one of the early water-powered industrial sites in this area. The use of quarried granite in the construction of the piers and chimneys of this house may also be the earliest known use of the stone in this area, which later became the largest industry in Elbert County.

17. (continued) wing, and formal landscape composition of site.

[illegible]

INT 4575-78

EB507 (Continued)



Signi



REFERENCES/CONTINUED:

ABSTRACT																			
HALF NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PH TOGRAM	SW	FILM								

INT 4575-78
ST 40 41 42 43 44 45 46 47 48 49 50

OTOS AND SKETCH MAP OF LOCATION

EB507 (Continued)



gnifi

REFERENCES (CONTINUED)

ABSTRACT																			
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRAW	HIST DRAW	NO. OF PAGES	DATE	BY	REV	SY	FILE						

INT 4571-78
1100 610000 0000

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 1 0 - A		2 PRIORITY		3 DANGER OF DEMOLITION SPECIFY THREAT		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
4 Classification Residence				5 DATE CA. 1920		6 GUY SOURCE OF THREAT OWNER ADMIN		<input type="checkbox"/> OWNER <input type="checkbox"/> ADMIN Gaines T. Anderson	
7 NAME (S) OF STRUCTURE Residence				8 OWNER ADDRESS Route 6 Elberton, Georgia 30635					
9 STATE G A		COUNTY NAME Elbert		TOWNSHIP Middleton Vic.		10 DIST 1 0			
11 UTM ZONE 1 7		EASTING 3 3 7 1 6 5		NORTHING 3 7 7 4 0 8 0		12 UTM ZONE 1 7		EASTING 3 3 7 1 6 5	
13 UTM ZONE 1 7		EASTING 3 3 7 1 6 5		NORTHING 3 7 7 4 0 8 0		14 UTM ZONE 1 7		EASTING 3 3 7 1 6 5	
15 CONDITION		<input type="checkbox"/> EXCELLENT <input type="checkbox"/> GOOD <input type="checkbox"/> FAIR <input type="checkbox"/> POOR <input type="checkbox"/> VERY POOR		16 INVENTORIED BY John L. Hopkins, Emily J. Harris		17 ASSOCIATION Historic American Buildings Survey		18 DATE May 1, 1979	
19 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING LIMITATIONS, AGENCIES, HISTORICAL, ART, PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDING ENGINEERING, ETC.									
One story balloon frame dwelling, 32' (three bays) X 21' (one bay). Gable roof covered with sheet metal; asphalt siding over vertical sheathing, 6X6 sash windows; foundation of milled granite piers. Plan is two rooms wide, one room deep divided by central chimney of brick laid on milled granite foundation. Porch added to front.									


(CONT OVER)

18 ORIGINAL USE Residence		PRESENT USE Residence		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

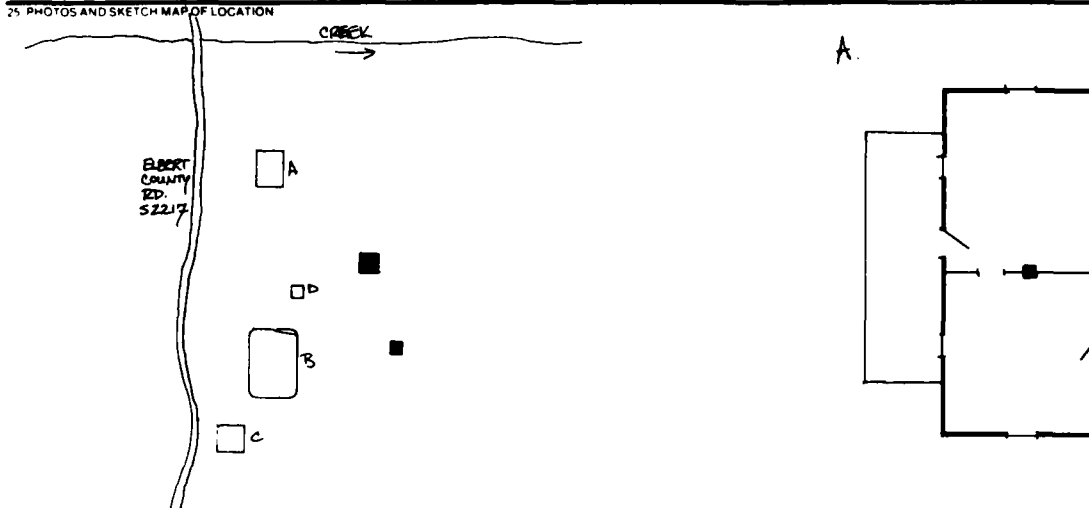

Significance This structure is typical of small tenant dwellings found throughout the project area and the southeastern United States. It is adjacent to a similar tenant house (510 B). Though somewhat deteriorated, this structure contains much of its original fabric and integrity, and could be easily preserved.

XXXXXXXXXXXXXXXXXXXX

11. (continued)
southeast on Co. S2217 .2 mile to the site.

ARBITRARY																			
HA	SNP	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM							

INT 4575-78
1100 00000000

FHR 8-230 June 1978

OAHMP INVENTORY



Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 1 0 - B		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Residence				5 DATE CA. 1930		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Residence				7 OWNER ADMIN Gaines T. Anderson		9 OWNER'S ADDRESS Route 6 Elberton, Georgia 30635			
10 STATE G A COUNTY NAME Elbert VICINITY Middleton CONG DIST 1 0		STATE G A COUNTY NAME Elbert VICINITY Middleton CONG DIST 1 0		12 EXISTING SURVEYS		13 SPECIAL FEATURES DESCRIBE BELOW			
11 SITE ADDRESS STREET & NO Beginning at the intersection of Georgia State Highway 72 and Elbert County Road S2218, proceed north on Co. S2218 .9 mile to the intersection with County S2217, then southeast on Co. S2217 .2 mile to the site.		12 EXISTING SURVEYS		13 SPECIAL FEATURES DESCRIBE BELOW		14 INTERIOR INTACT		15 EXTERIOR INTACT	
14 UTM ZONE EASTING NORTHING SIGN SCALE 8 1 24 1 6 1 1 0 3 3 7 1 9 0 3 7 7 4 0 1 0		14 UTM ZONE EASTING NORTHING SIGN SCALE 8 1 24 1 6 1 1 0 3 3 7 1 9 0 3 7 7 4 0 1 0		15 CONDITION		16 INVENTORIED BY		17 DATE	
15 CONDITION 70 EXCELLENT 71 GOOD 72 FAIR 73 DETERIORATED 74 RUINS 75 UNEXPOSED 76 ALTERED 82 DESTROYED 85 DEMOLISHED		16 INVENTORIED BY John L. Hopkins, Emily J. Harris		17 DATE May 1, 1979		18 ORIGINAL USE		19 PRESENT USE	
18 ORIGINAL USE Residence		19 PRESENT USE Residence		20 URBAN AREA 50 000 POP OR MORE? YES NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY	
20 URBAN AREA 50 000 POP OR MORE? YES NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR		24 INDEXER	
23 EDITOR		24 INDEXER		25 LOCATED IN AN HISTORIC DISTRICT?		26 NAME		27 DISTRICT ID NO	

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

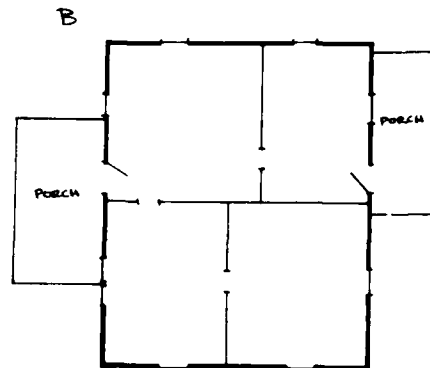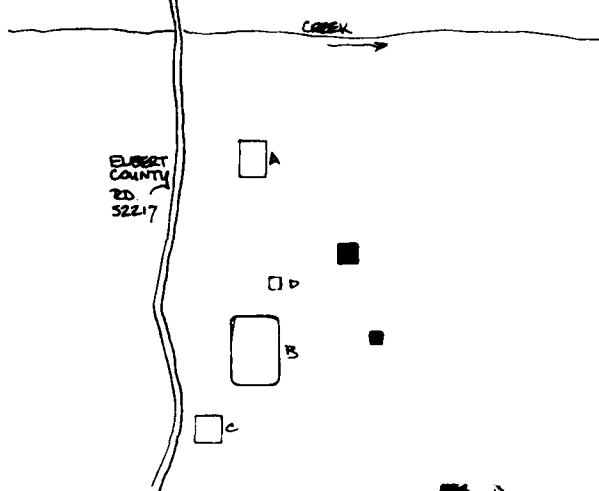

Significance

This structure is typical of small tenant dwellings found throughout the project area and the southeastern United States. It is adjacent to a similar tenant house (510 A). Though much of the original interior fabric remains intact, some structural deterioration has taken place.

REFERENCES (CONTINUED)

ABSTRACT																			
HAZARD	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLAT	PHOTOGRAM	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11

HR-8-230 June 1978

1 SITE ID NO **E B 5 1 0 - C**

OAHMP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification Garage	3 PRIORITY	4 DANGER OF DEMOLITION? (SPECIFY THREAT)
	5 DATE CA. 1930	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN
	6 GOVT SOURCE OF THREAT	OWNER ADMIN
	7 OWNER ADMIN Gaines T. Anderson	

8 NAME(S) OF STRUCTURE Garage	9 OWNER'S ADDRESS Route 6 Elberton, Georgia 30635
---	---

10 STATE G A COUNTY NAME Elbert VICINITY Middleton CONG DIST 1 0	10 STATE G A COUNTY NAME Elbert VICINITY Middleton CONG DIST 1 0
--	--

11 SITE ADDRESS-STREET & NO: Beginning at the intersection of Georgia State Highway 72 and Elbert County Road S2218, proceed north on Co. S2218 .9 mile to the intersection with County S2217, then southeast on Co. S2217 .2 mile to the site.	12 EXISTING SURVEYS <input type="checkbox"/> NHP <input type="checkbox"/> NHC <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLM <input type="checkbox"/> ONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER
13 SPECIAL FEATURES (SEE WIRE BELOW) <input checked="" type="checkbox"/> INTERIOR INT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	

14 UTM ZONE EASTING NORTHING SIGN SCALE 1 7 3 3 7 1 9 0 3 3 7 4 0 0 0	14 UTM ZONE EASTING NORTHING SIGN SCALE 1 7 3 3 7 1 9 0 3 3 7 4 0 0 0
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED	QUAD NAME Elberton East, Georgia


16 INVENTORIED BY John L. Hopkins, Emily J. Harris	AFFILIATION Historic American Buildings Survey	DATE May 1, 1979
--	--	----------------------------

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATES; HISTORICAL DATES; PHYSICAL DIMENSIONS
MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

One-story balloon frame garage, 10' (one bay) X 20'. Gable roof covered with sheet metal; vertical board sheathing. One room. There are two additional outbuildings and a house associated with this site.

18 ORIGINAL USE Garage	PRESENT USE Storage	ADAPTIVE USE
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown		

20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	21 NCRS Region	22 PUBLIC ACCESSIBILITY <input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	23 EDITOR INDEXER
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO NAME	DISTRICT ID NO		

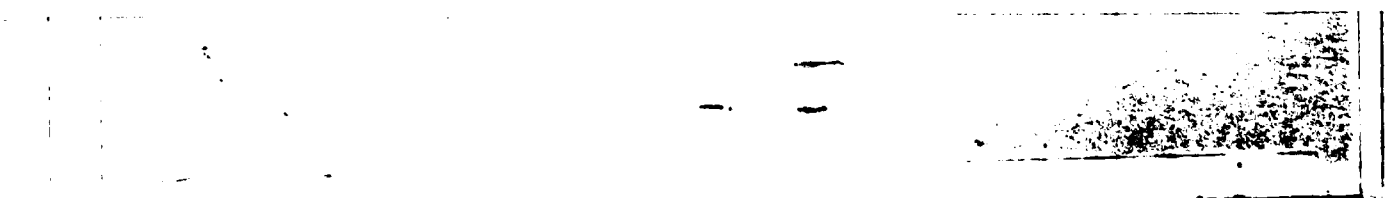


One-story, open-sided post and frame well house, 8' X 8'. Gable roof covered with sheet metal, vertical board apron. Wooden well cover.

(CONT OVER

(CONT OVER)

20 URRAN AREA 50 000 POP OR MORF?		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		<input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED		<input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		<input type="checkbox"/> INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		NAME		DISTRICT ID NO			
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO							

25 PHOTOS AND SKETCH MAP OF LOCATION

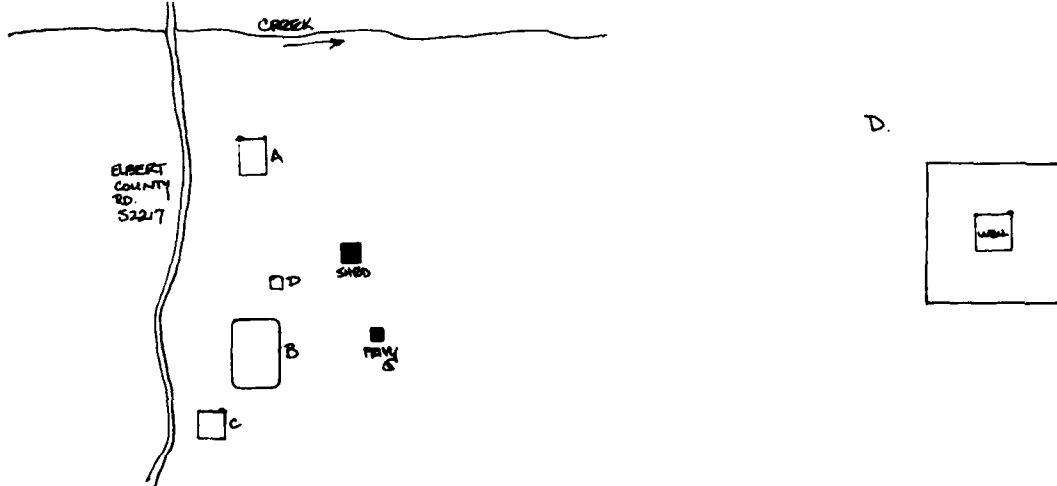

Significance

This structure is typical of well houses found throughout the project area and the southeastern United States, and is in a good state of preservation.

REFERENCES (CONTINUED)

ABSTRACT																			
NA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FLV							

INT 4575-78
GPO : 1975 O-300-000

OAHHP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 2 5		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>		Corps of Engineers (Demolition)	
2 Classification Residence				5 DATE CA. 1920		6 GOVT SOURCE OF THREAT		OWNER		ADMIN	
8 NAME S. OF STRUCTURE Residence						7 OWNER ADMIN U. S. Army Corps of Engineers		4 OWNER'S ADDRESS c/o Richard B. Russell Real Estate Project Office P. O. Box 1050 Elberton, Georgia 30635			
10 STATE		G A		COUNTY NAME Elbert		CITY VICINITY Middleton		CONG DIST 10		STATE	
COUNTY										COUNTY NAME Elbert	
CITY										City Elberton	
11 SITE ADDRESS, STREET & NO.		Beginning at the intersection of Georgia State Highway 72 and Elbert County Road S2218, proceed northeast on Co. S2218 2.1 miles, then turn west on an unpaved private road .1 mile to the site.		12 EXISTING SURVEYS		<input type="checkbox"/> NH <input type="checkbox"/> NPL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAEP <input type="checkbox"/> NPS <input type="checkbox"/> USFS <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES, LIST HERE BELOW		<input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE		QUAD NAME	
17		338060		3775440				1:100		Elberton East, Georgia	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE		QUAD NAME	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED		74 <input type="checkbox"/> RUINS	
		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		77 <input type="checkbox"/> DESTROYED		78 <input type="checkbox"/> DEMOLISHED			
16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979							
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC. One-story, balloon-frame house with additions, 32' (four bays) X 31' (three bays). Gable roof covered with sheet metal, boxed eaves; clapboard siding, 4 X 4 sash windows with board shutters; foundations of milled granite piers. Original plan is two rooms wide divided by central chimney, one room deep; addition of two rooms across rear with further addition of one room and porch at rear, and pedimented front porch. Interior chimney of brick laid on fieldstone granite foundation; interior finish is sheathed throughout. Associated with this structure is a post-and-frame wellhouse, not recorded due to advanced deterioration.											
(CONT OVER)											
18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE							
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown											
(CONT OVER)											
20 URBAN AREA 50,000 - POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		<input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO.					

25. PHOTOS AND SKETCH MAP OF LOCATION

BEAVER DAM CREEK


SABODAS CREEK AND ST. LINDA RIVER

ELBERT COUNTY RD. 52218

ELBERT CO RD 267

513

WELL

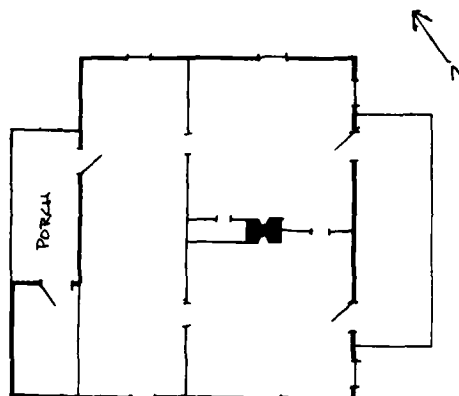

This structure is a typical farmhouse seen throughout the project area and the southeastern United States. Though much of the original fabric remains intact, this structure is slowly deteriorating through vandalism and neglect. Much of this deterioration is taking place in the interior from water damage, and some structural fabric has been greatly affected.

REFERENCES CONTINUED

[illegible]

INT 4575-71

EB525 (Continued)




Significance

REFERENCES (CONTINUED)

AIRCRAFT		TECH REPORT		HIST REPORT		CONTEMP PHOTO		HIST PHOTO		CONTEMP DRAWG		HIST DRAWG		COLOR PLATE		PHOTOGRAM		SW		FILM	

INT 4575-78
11 11

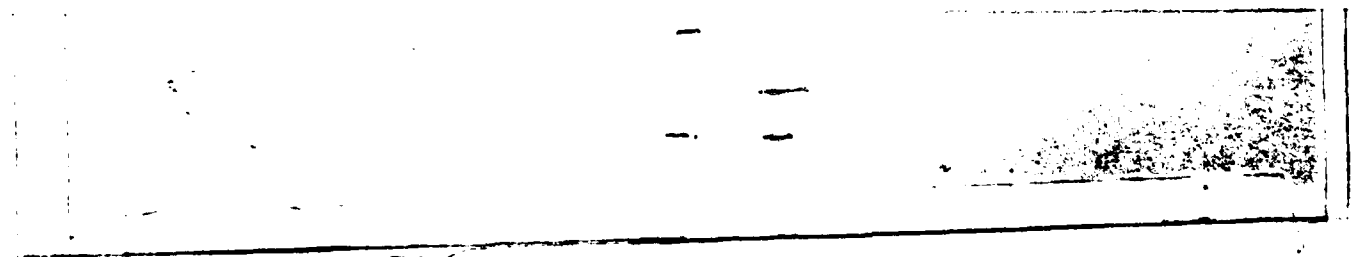

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO E B 5 2 5		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Residence - Continuation		5 DATE		6 GOVT SOURCE OF THREAT OWNER ADMIN	
8 NAME(S) OF STRUCTURE		9 OWNER'S ADDRESS		7 OWNER ADMIN	
10 STATE COUNTY		CITY VICINITY		CONG DIST	
11 SITE ADDRESS (STREET & NO.)		12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAEP <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> OTHER <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL		13 SPECIAL FEATURES DESCRIBE BELOW <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14 UTM ZONE EASTING NORTHING SIGN		SCALE <input type="checkbox"/> 1:24 <input type="checkbox"/> 1:625 <input type="checkbox"/> OTHER		QUAD NAME	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 80 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED		16 INVENTORIED BY		AFFILIATION DATE	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S) HISTORICAL DATE(S) PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC					

(CONT OVER)

18 ORIGINAL USE	PRESENT USE	ADAPTIVE USE
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER		

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input type="checkbox"/> NO	21 NCRS Region	22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	23 EDITOR INDEXER
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input type="checkbox"/> NO		NAME	DISTRICT ID NO

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 5 2 6		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification Residence				5 DATE CA. 1920		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Residence						7 OWNER ADMIN Wilbur Dye			
9 OWNER'S ADDRESS c/o Mr. Dan Dye Route 4, Box 315 Elberton, Georgia 30635									
10 STATE COUNTY		GA Elbert		CITY VICINITY Middleton		CONG DIST 1 0			
11 SITE ADDRESS, STREET & NO		Beginning at the intersection of Georgia State Highway 72 and Elbert County Road S2218, proceed northeast on Co. S2218 2.4 miles to an unpaved private road, then southeast .5 mile to the site.		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NML <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER			
13 SPECIAL FEATURES DESCRIBE BELOW				<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT					
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 3 8 9 4 0		3 7 7 5 1 0 0				<input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								<input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input checked="" type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
								74 <input type="checkbox"/> RUINS	
								75 <input type="checkbox"/> UNEXPOSED	
								76 <input type="checkbox"/> ALTERED	
								77 <input type="checkbox"/> DESTROYED	
								78 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	


17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

One-story, balloon frame dwelling, 36' (three bays) X 28' (two bays). Hip roof covered with sheet metal; asphalt siding over clapboards, 6 X 6 sash windows; foundations of milled granite piers. Two rooms wide, two rooms deep divided by central hall. Interior brick chimney laid on milled granite foundations and two suspended brick chimneys. Interior is partially sheathed, and is greatly deteriorated due to vandalism and neglect.

18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE	
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown					

20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN		23 EDITOR	
								INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

24. PHOTOS AND SKETCH MAP OF LOCATION

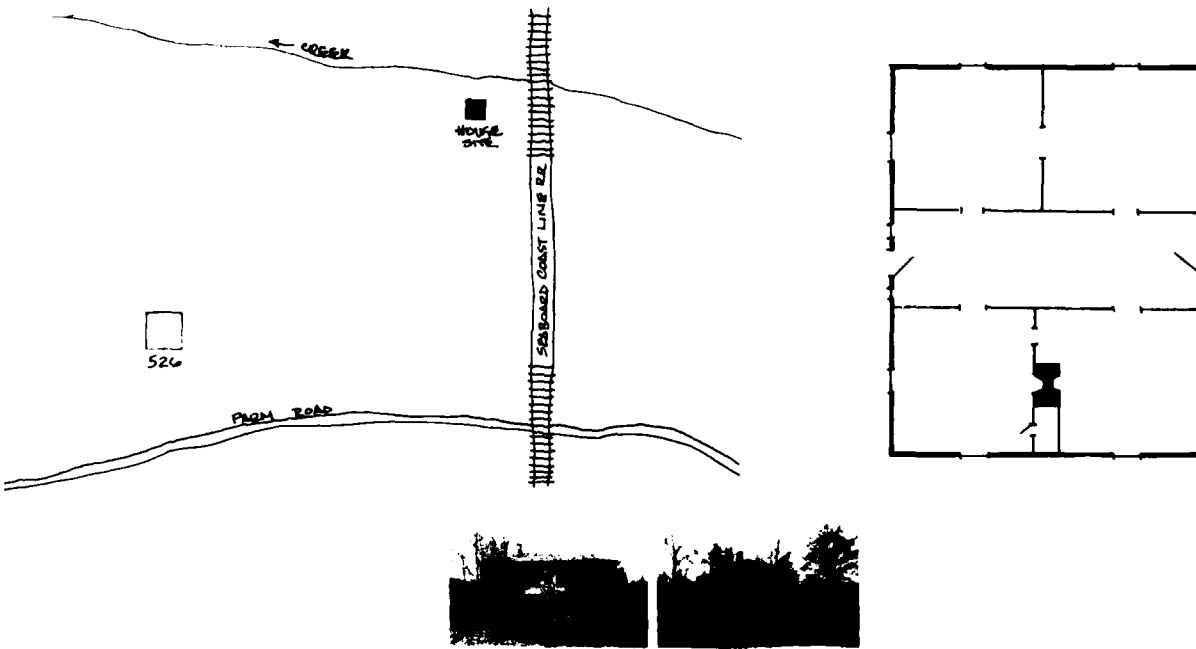

Significance

This structure is an interesting example of a small tenant dwelling, similar to other structures found throughout the southeastern United States. The unusual characteristic of the low hip roof makes this structure unique in the project area, though somewhat less unique in the surrounding regions. This structure has been badly damaged due to vandalism and neglect and is deteriorating rapidly, thereby compromising any preservation effort.

REFERENCES/CONTINUED:

ABSTRACT																			
MAINT NO	LC	TECH REPOB	HIST REPOB	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
11-11-78

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 7 3 1 - 1		3 PRIORITY		4 DANGER OF DEMOLITION? SPECIFY THREAT		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
2 Classification		Farm complex		5 DATE		6 GOVT SOURCE OF THREAT		7 OWNER ADMIN	
				CA. 1930 - 1940		Corps of Engineers (Demolition)		R. J. Anderson	
8 NAME(S) OF STRUCTURE		Farm complex		9 OWNER'S ADDRESS		Route 2		Elberton, GA 30635	
10 STATE		GA		COUNTY NAME		Elbert		VICINITY	
COUNTY		Elbert		CONG DIST		10		Ruckersville	
11 SITE ADDRESS (STREET & NO.)		Beginning at the intersection of Elbert		12 EXISTING SURVEYS		13 SPECIAL FEATURES DESCRIBE BELOW		14 UTM ZONE	
County Road S985 and Elbert Co. Road 266 in the town of Ruckersville, proceed northeast 1.6 miles to the intersection with unpaved Elbert Co. Road 239, then (Con't Reverse)				NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/>		INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT <input checked="" type="checkbox"/>		EASTING	
				CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER <input type="checkbox"/>				NORTHING	
								SIGN	
								SCALE	
								QUAD NAME	
								Rockbranch, GA	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input checked="" type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		82 <input type="checkbox"/> DESTROYED		85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS; EXTANT EQUIPMENT; AND IMPORTANT BUILDERS/ENGINEERS, ETC.									
A 1930's farm complex including: (a) One-story, balloon frame house, four bays x three bays. Gable roof covered with sheetmetal, open eaves; asphalt siding, 4x4 sash windows; front pedimented porch; foundations of brick, concrete and granite block piers. Interior and exterior brick chimneys, CA. 1932. (b) See separate form, Site EB731-1B. (c) Two-story, hewn and balloon frame barn with side shed additions and attached granite milking parlor. Gable roof covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. Hewn frame members incorporated from earlier structures, CA. 1934. (d) One-story, frame storage barn, with post-and-frame addition. Gable roof covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers, CA. 1935. (e) One-story, balloon frame shed. Gable roof covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers, CA. 1935. (f) Post-and-frame cattle feeding crib. Gable roof covered with sheetmetal; vertical board siding on end walls, side walls open, (CONT OVER)									
18 ORIGINAL USE		Farm complex		PRESENT USE		Farm complex		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER									
Unknown									
(CONT OVER)									
20 URBAN AREA 50 000 POP. OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCBS Region		22 PUBLIC ACCESSIBILITY		YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input checked="" type="checkbox"/> UNKNOWN <input type="checkbox"/>		23 EDITOR	
								INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO					



Significance

XXXXXXXXXXXXXXXXXXXX

[illegible]

INT 4575-71

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO EB731-1B		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Barn		5 DATE CA. 1820, 1935		6 GOVT SOURCE OF THREAT Corps of Engineers (Demolition)	
8 NAME OF STRUCTURE Barn		9 OWNER ADMIN R. J. Anderson			
10 STATE GA COUNTY Elbert CITY Ruckersville CONG DIST 10		11 OWNER'S ADDRESS Route 2 Elberton, GA 30635			
12 EXISTING SURVEYS <input type="checkbox"/> NHP <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLG		13 SPECIAL FEATURES DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT			
14 UTM ZONE EASTING NORTHING SIGN SCALE 17 3376953782905		QUAD NAME Rockbranch, GA			
15 CONDITION 70 <input checked="" type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED					
16 INVENTORIED BY John Linn Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS; EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC. One-story, log barn with frame additions, loft, and cattle pens, 49' x 48'. Gable roof covered with sheetmetal; logs hewn on four sides with one-half dovetail joinery partially covered with sheetmetal, clapboard siding on additions; foundations of milled and quarried granite piers. Original plan of log structure is of one room, with frame additions of four rooms and open breezeway. This structure is fairly well-preserved, and restoration could be easily accomplished. It is one of ten structures that comprise this 1930's farm complex. See site EB731-A.					
18 ORIGINAL USE Barn		PRESENT USE Barn		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Personal conversation with Reuben J. Anderson. 4/16/79					
20 URBAN AREA 50,000 POP OR MORE <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCBS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
23 EDITOR INDEXER					
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		DISTRICT ID NO			

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

ELBERT CO. RD 239

CREEK

600

650

A

B

C

D

E

F

G

H

I

J

K

L

M

N

O

P

Q

R

S

T

U

V

W

X

Y

Z

1

2

3

4

5

6

7

8

9

10

11

12

13

14

15

16

17

18

19

20

21

22

23

24

25

26

27

28

29

30

31

32

33

34

35

36

37

38

39

40

41

42

43

44

45

46

47

48

49

50

51

52

53

54

55

56

57

58

59

60

61

62

63

64

65

66

67

68

69

70

71

72

73

74

75

76

77

78

79

80

81

82

83

84

85

86

87

88

89

90

91

92

93

94

95

96

97

98

99

100

101

102

103

104

105

106

107

108

109

110

111

112

113

114

115

116

117

118

119

120

121

122

123

124

125

126

127

128

129

130

131

132

133

134

135

136

137

138

139

140

141

142

143

144

145

146

147

148

149

150

151

152

153

154

155

156

157

158

159

160

161

162

163

164

165

166

167

168

169

170

171

172

173

174

175

176

177

178

179

180

181

182

183

184

185

186

187

188

189

190

191

192

193

194

195

196

197

198

199

200

201

202

203

204

205

206

207

208

209

210

211

212

213

214

215

216

217

218

219

220

221

222

223

224

225

226

227

228

229

230

231

232

233

234

235

236

237

238

239

240

241

242

243

244

245

246

247

248

249

250

251

252

253

254

255

256

257

258

259

260

261

262

263

264

265

266

267

268

269

270

271

272

273

274

275

276

277

278

279

280

281

282

283

284

285

286

287

288

289

290

291

292

293

294

295

296

297

298

299

300

301

302

303

304

305

306

307

308

309

310

311

312

313

314

315

316

317

318

319

320

321

322

323

324

325

326

327

328

329

330

331

332

333

334

335

336

337

338

339

340

341

342

343

344

345

346

347

348

349

350

351

352

353

354

355

356

357

358

359

360

361

362

363

364

365

366

367

368

369

370

371

372

373

374

375

376

377

378

379

380

381

382

383

384

385

386

387

388

389

390

391

392

393

394

395

396

397

398

399

400

401

402

403

404

405

406

407

408

409

410

411

412

413

414

415

416

417

418

419

420

421

422

423

424

425

426

427

428

429

430

431

432

433

434

435

436

437

438

439

440

441

~~XXXXXXXXXX~~ CONTINUED: 11. Site Address (Street & No)

[illegible]

INT 4575-78

FHR-8-230 June 1978


OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1. SITE I.D. NO.		E B 7 3 1 - 2	
2. Classification		3. PRIORITY	4. DANGER OF DEMOLITION? (SPECIFY THREAT)
Farm Complex			<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers
		5. DATE	6. GOVT SOURCE OF THREAT
		CA. 1919	OWNER ADMIN
8. NAME(S) OF STRUCTURE		9. OWNER'S ADDRESS	
Anderson Farm Complex		Route 2 Elberton, Georgia 30635	
10. STATE	G A	COUNTY NAME	Elbert
COUNTY		VICINITY	Ruckersville
		CONG DIST	1 0
11. SITE ADDRESS (STREET & NO.)		12. EXISTING SURVEYS	
Beginning at the intersection of Elbert County Road S935 and Elbert County Road 266 in the hamlet of Ruckersville, proceed northeast on Co. S985 1.6 miles to the inter-		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER	
13. SPECIAL FEATURES: DESCRIBE BELOW:		<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14. UTM ZONE	EASTING	NORTHING	SCALE
1 7	3 3 7 2 6 5	3 7 8 3 2 2 0	<input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5
			<input type="checkbox"/> OTHER
15. CONDITION	70 <input type="checkbox"/> EXCELLENT	71 <input checked="" type="checkbox"/> GOOD	72 <input type="checkbox"/> FAIR
		73 <input type="checkbox"/> DETERIORATED	74 <input type="checkbox"/> RUINS
		75 <input type="checkbox"/> UNEXPOSED	76 <input type="checkbox"/> ALTERED
		82 <input type="checkbox"/> DESTROYED	85 <input type="checkbox"/> DEMOLISHED
16. INVENTORIED BY		AFFILIATION	
John L. Hopkins, Emily J. Harris		Historic American Buildings Survey	
17. DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.		DATE	
Circa 1920 farm complex as follows: (a) One-story, balloon frame house, 42' (three bays) X 31' (three bays), CA. 1919. Gable roof covered with sheetmetal, open eaves; asbestos siding, 4x4 windows; foundations of cement blocks. Plan is probably of four rooms, two rooms wide divided by central hall, two rooms deep, pedimented front porch with four columns. Interior inaccessible. (b) Post-and-frame well house, CA. 1919. Gable roof with asphalt shingles over wooden shingles, clapboard wall apron. (c) Balloon-frame storage shed, CA. 1920. Gable roof covered with sheetmetal; clapboard siding; fieldstone granite foundation piers. (d) Two-story balloon-frame cattle barn, CA. 1920. Gable roof covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. Included in this complex are two other outbuildings not recorded: Post-and-frame garage, CA. 1950, and a post-and-frame machinery shed, CA. 1950. These structures are all in good condition and could be easily preserved. This complex was not extensively		May 1, 1979	
18. ORIGINAL USE		ADAPTIVE USE	
Farm Complex		Farm Complex	
19. REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER			
Conversation with Reuben J. Anderson, April 25, 1979			

(CONT OVER)

20. URBAN AREA 50,000 POP OR MORE?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	21. BCAS Region	22. PUBLIC ACCESSIBILITY	<input type="checkbox"/> YES, LIMITED <input type="checkbox"/> YES, UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	23. EDITOR INDEXER
24. LOCATED IN AN HISTORIC DISTRICT?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	NAME	DISTRICT ID NO		

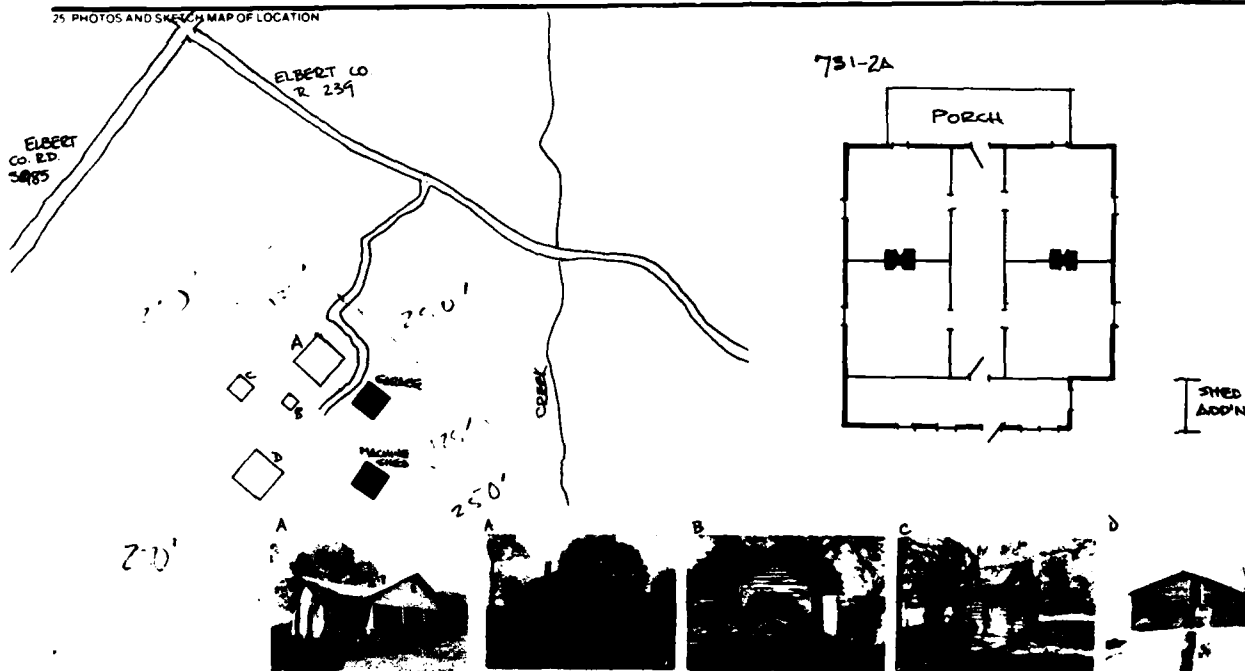

Significance

This early twentieth century farm complex is typical of such complexes throughout the project area and the Southeastern United States. However, such a well-preserved complex is rather unusual. The complex is associated with Site EB731-1 through single-family ownership.

11. (continued) section with Elbert County Road 239, then southeast on Co. 239 0.1 mile to an unpaved private road, then south on the unpaved private road 0.1 mile to the site.
17. (continued) documented due to lack of time remaining in the inventory.

ABSTRACT																			
MACTNO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
FORM 100-100-100

OAHF INVENTORY



Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 2 - A		2 Classification		3 DANGER OF DEMOLITION		4 PRIORITY		5 DATE		6 GOVT SOURCE OF THREAT		7 OWNER ADMIN					
Residence						Corps of Engineers (Demolition)		CA. 1870						J. R. Cleveland					
8 NAME(S) OF STRUCTURE		Residence												Route 4 Elberton, GA 30635					
10 STATE		GA		COUNTY NAME		Elbert		VICINITY		Ruckersville		CONG DIST		10					
11 SITE ADDRESS, STREET & NO.		Beginning at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert County Road 238, then east and south on Elbert Co 238 0.8 miles to the site.		12 EXISTING SURVEYS		13 SPECIAL FEATURES		14 UTM ZONE		15 EASTING		16 NORTHING		17 SIGN		18 SCALE			
								1 7		3 3 9 1 8 0 3 7 8 4 6 9 0						QUAD NAME Lowndesville, SC - GA			
15 CONDITION		70 EXCELLENT		71 GOOD		72 FAIR		73 DETERIORATED		74 RUINS		75 UNEXPOSED		76 ALTERED		77 DESTROYED		78 DEMOLISHED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE		May 1, 1979									
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.		One-story, balloon frame house, 32' (two bays) x 34' (two bays). Gable roofs covered with sheetmetal, boxed eaves; clapboard and weatherboard siding, 6 x 6 and 4 x 4 sash windows; foundations composed of wooden posts, and quarried, milled and fieldstone granite piers. Plan is basically L-shaped, three rooms, with porches at front, side and at the corner of the L. Interior brick chimney laid on fieldstone granite foundation. Interior of this structure was inaccessible. This structure is in a fair state of preservation, and probably contains much of its original fabric. Associated with this structure are three outbuildings: B) small shed, CA. 1880; C) barn, possibly CA. 1850-1860; and a small deteriorated and overgrown privy, not recorded. The recorded outbuildings are in poor, and fair condition, respectively.																	
18 ORIGINAL USE		Residence		PRESENT USE		Storage		ADAPTIVE USE											
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER		Unknown																	
20 URBAN AREA 50 000 POP OR MORE?		YES NO		21 NCBS Region		22 PUBLIC ACCESSIBILITY		YES LIMITED YES UNLIMITED NO UNKNOWN		23 EDITOR		INDEXER							
24 LOCATED IN AN HISTORIC DISTRICT?		YES NO		NAME		DISTRICT ID NO													

(CONT OVER)

(CONT OVER)

25. PHOTOS AND SKETCH MAP OF LOCATION

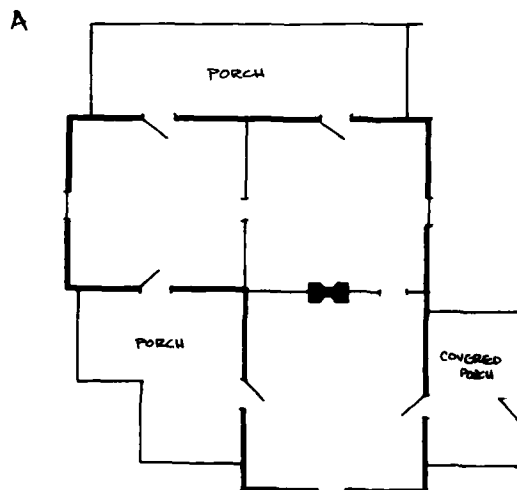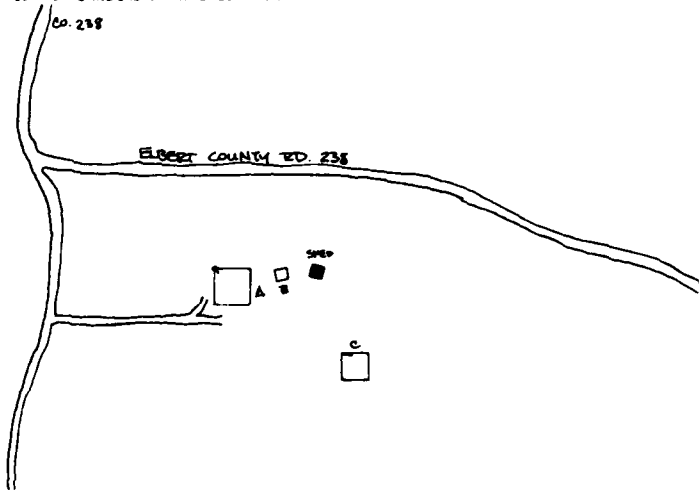


Significance This small dwelling is an example of a typical post-Civil War farmhouse, found throughout the project area and the southeastern United States. This structure is in a good state of repair, and appears to contain much of its original fabric.

REFERENCES (CONTINUED)

ABSTRACT																			
NA	NO	LC	TECH REPT	HIST REPT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM							

INT 4575-78
1100 000000 0000

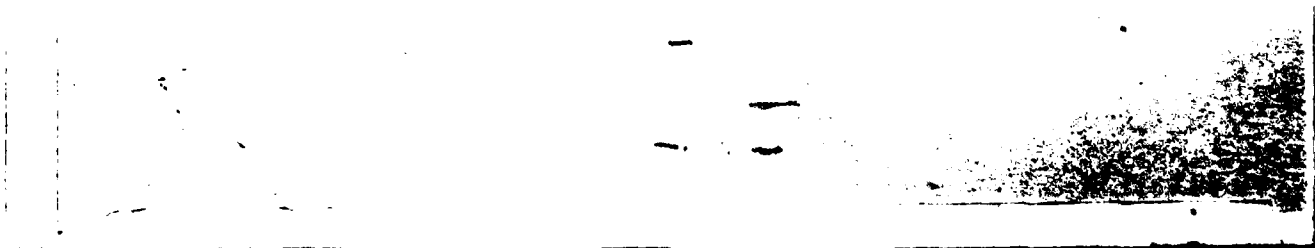

OAHF INVENTORY


Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 2 - B		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT: <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Shed		5 DATE CA. 1880		6 GOVT SOURCE OF THREAT Corps of Engineers (Demolition)		7 OWNER ADMIN J. R. Cleveland	
8 NAME OF STRUCTURE Shed		9 OWNER'S ADDRESS Route 4 Elberton, GA 30635		10 STATE G A COUNTY NAME Elbert Ruckersville CONG DIST 10		11 STATE G A COUNTY NAME Elbert Ruckersville CONG DIST 10	
12 SITE ADDRESS (STREET AND BEGINNING at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Co. S985 3.1 miles to the intersection with unpaid Elbert County Road 238, then east & south on Co. 238 0.8 miles to the site.		13 EXISTING SURVEYS <input type="checkbox"/> NH <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		14 SPECIAL FEATURES (DESCRIBE BELOW) <input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT		15 UTM ZONE EASTING NORTHING SIGN SCALE 17 33 92 05 37 84 61 5	
16 INVENTORIED BY John Linn Hopkins, Emily J. Harris		17 AFFILIATION Historic American Buildings Survey		18 DATE May 1, 1979		19 QUAD NAME Lowndesville, SC - GA	
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO		25	

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

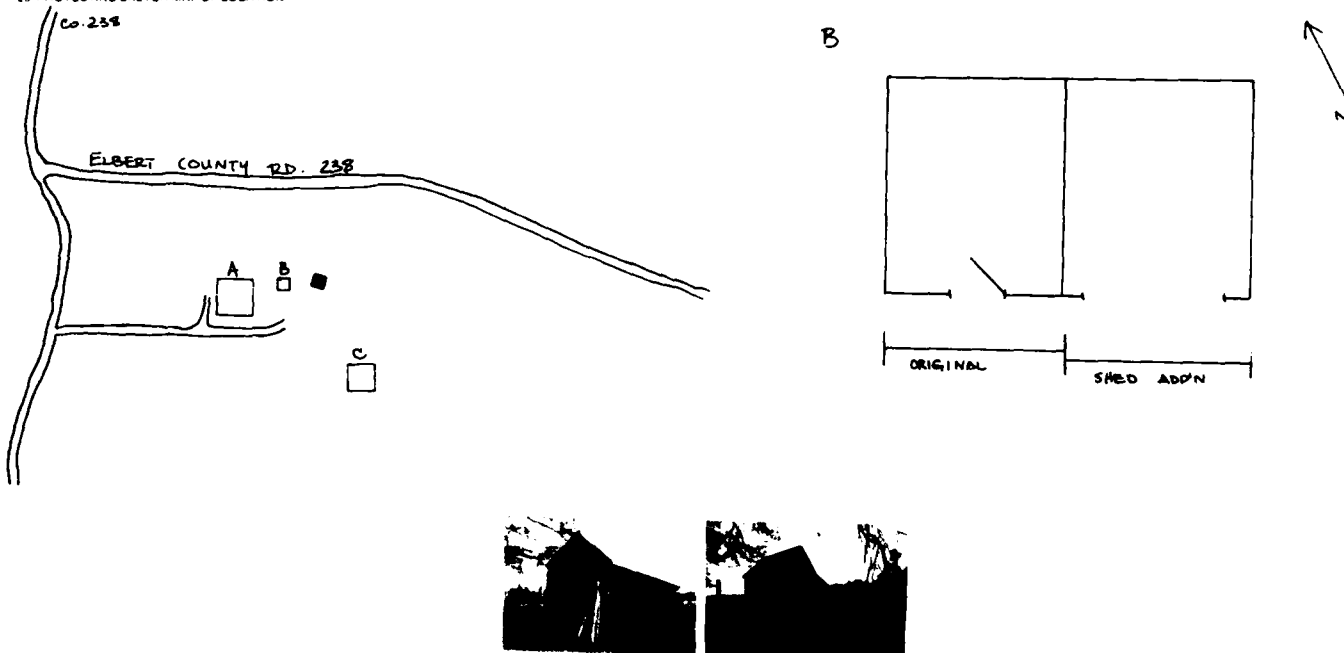

Significance Small storage sheds and barns of this type are found throughout the project area and the southeastern United States.

REFERENCES (CONTINUED)

ABSTRACT																			
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
1100 610000 0000

FHR-8-730 June 1978

1 SITE ID NO

E B 1 5 1 2 - C

OAHMP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Barn

3 PRIORITY

4 DANGER OF DEMOLITION
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

5 DATE
CA. 1850-
1860

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER ADMIN

J. R. Cleveland

8 NAME OF BUILDING

Barn

9 OWNER'S ADDRESS

Route 4
Elberton, GA 30635

10 STATE

GA

11 COUNTY NAME

Elbert

12 CITY

Ruckersville

13 CONG DIST

10

14 STATE

GA

15 COUNTY NAME

Elbert

16 CITY

Ruckersville

17 CONG DIST

10

18 EXISTING SURVEYS

☐ NH☐ NMC☐ HABS☐ HAER☐ HAER☐ NPS☐ CLH☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

19 SPECIAL FEATURES (DESCRIBE BELOW)

☒ INTERIOR INTACT☒ EXTERIOR INTACT☐ ENVIRONS INTACT

20 QUAD NAME

Lowndesville, SC - GA

21 QUAD NAME

22 QUAD NAME

23 QUAD NAME

24 QUAD NAME

25 QUAD NAME

26 QUAD NAME

27 QUAD NAME

28 QUAD NAME

29 QUAD NAME

30 QUAD NAME

31 QUAD NAME

32 QUAD NAME

33 QUAD NAME

34 QUAD NAME

35 QUAD NAME

36 QUAD NAME

37 QUAD NAME

38 QUAD NAME

39 QUAD NAME

40 QUAD NAME

41 QUAD NAME

42 QUAD NAME

43 QUAD NAME

44 QUAD NAME

45 QUAD NAME

46 QUAD NAME

47 QUAD NAME

48 QUAD NAME

49 QUAD NAME

50 QUAD NAME

51 QUAD NAME

52 QUAD NAME

53 QUAD NAME

54 QUAD NAME

55 QUAD NAME

56 QUAD NAME

57 QUAD NAME

58 QUAD NAME

59 QUAD NAME

60 QUAD NAME

61 QUAD NAME

62 QUAD NAME

63 QUAD NAME

64 QUAD NAME

65 QUAD NAME

66 QUAD NAME

67 QUAD NAME

68 QUAD NAME

69 QUAD NAME

70 QUAD NAME

15 CONDITION

20 EXCELLENT

71 GOOD

72 FAIR

73 DETERIORATED

74 RUINS

75 UNEXPOSED

76 ALTERED

82 DESTROYED

85 DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

17 AFFILIATION

Historic American Buildings Survey

18 DATE

May 1, 1979

19 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATES, HISTORICAL DATES, PHYSICAL DIMENSIONS, MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.

Two-story, hewn and balloon frame barn, with one-story rear shed addition, 21' x 31'. Gable roof with pole rafters on original covered with sheetmetal, shed roof covered with tarpaper; horizontal and vertical board sheathing; foundations of fieldstone granite piers. Plan of five rooms. This structure is in a fair state of preservation. It is associated with two other outbuildings and a house. (See EB1512-A for general comments).

18 ORIGINAL USE

Barn

19 PRESENT USE

Abandoned

20 ADAPTIVE USE

19 REFERENCES: HISTORICAL REFERENCES, PERSONAL CONTACTS AND OTHER

Unknown

21 URBAN AREA 50,000 POP OR MORE?

☐ YES ☒ NO

22 NCAS Region

23 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

24 EDITOR INDEXER

25 LOCATED IN AN HISTORIC DISTRICT?

☐ YES ☒ NO


NAME

DISTRICT ID NO


(CONT OVER)

(CONT OVER)

25. PHOTOS AND SKETCH MAP OF LOCATION

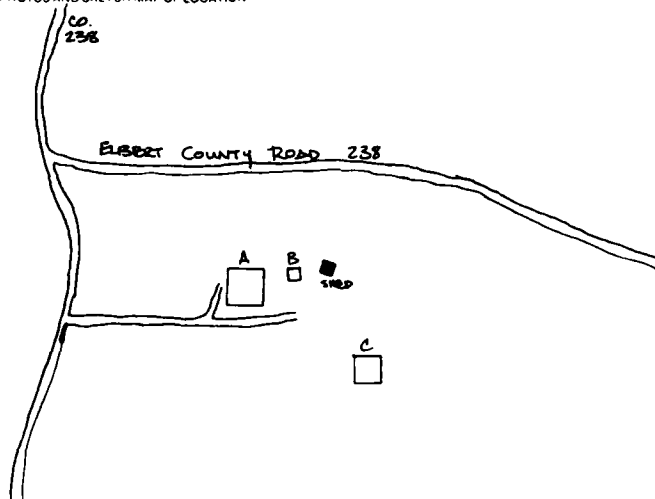

C

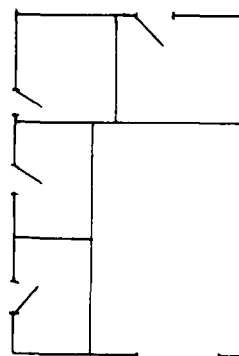

Significance This small barn is typical of the outbuildings found on small farmsteads in the project area and the southeastern United States. The structure appears to be of an earlier construction date than the other buildings on the site, which may indicate its survival from an earlier farm on this site, or its removal from another location.

REFERENCES CONTINUED

ABSTRACT																			
MAST NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRAWG	HIST DRAWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 3 - A		2 CLASSIFICATION		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		5 GOVT SOURCE OF THREAT		6 OWNER ADMIN		7 OWNER'S ADDRESS	
Residence						CA. 1880		Corps of Engineers (Demolition)				I. C. Cleveland		Route 4 Elberton, Georgia 30635	
8 NAME(S) OF STRUCTURE		Residence													
10 STATE		GA		COUNTY NAME		Elbert		VICINITY		Ruckersville		LONG DIST		1 0	
11 SITE ADDRESS STREET & NO		Beginning at the intersection of Elbert		COUNTY ROAD 266 and Elbert County Road S985 in the town of		Ruckersville, proceed northeast on Co. S986 3.1 miles to		the intersection with unpaved Elbert County Road 238, then							
12 EXISTING SURVEYS															
13 SPECIAL FEATURES															
14 UTM ZONE		1 7		EASTING		3 3 9 8 4 0		NORTHING		3 7 8 4 5 9 0		SIGN			
15 CONDITION		70 EXCELLENT		71 GOOD		72 FAIR		73 DETERIORATED		74 RUINS		75 EXPOSED		76 ALTERED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE		May 1, 1979					



17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

One-story balloon frame house adapted for use as barn with post-and-frame additions and cattle pens, 63' x 47'. House has gable roof covered with asphalt shingles, boxed eaves, additions have shed roofs covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. House has L-shaped plan of 3 rooms with interior brick chimney and suspended brick chimney. Shed additions are to side and rear of house. Interior used for animal pens; corn grinding equipment located in small post-and-frame addition on west side of structure. This structure is quite deteriorated, with much of the original fabric destroyed. Associated with the structure are two outbuildings: (b) barn, CA. 1880, (c) barn, CA. 1880, both altered by additions and in fair condition.

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
Residence		Barn			
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER					
Unknown					

20 URBAN AREA 50,000 POP OR MORE?		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
YES NO				YES LIMITED YES UNLIMITED NO UNKNOWN		NO EVER	
24 LOCATED IN AN HISTORIC DISTRICT?		YES NO		NAME		DISTRICT NO	

PHOTOS AND SKETCH MAP OF LOCATION

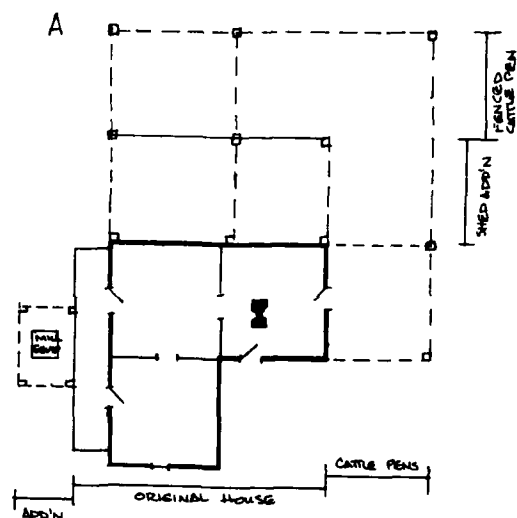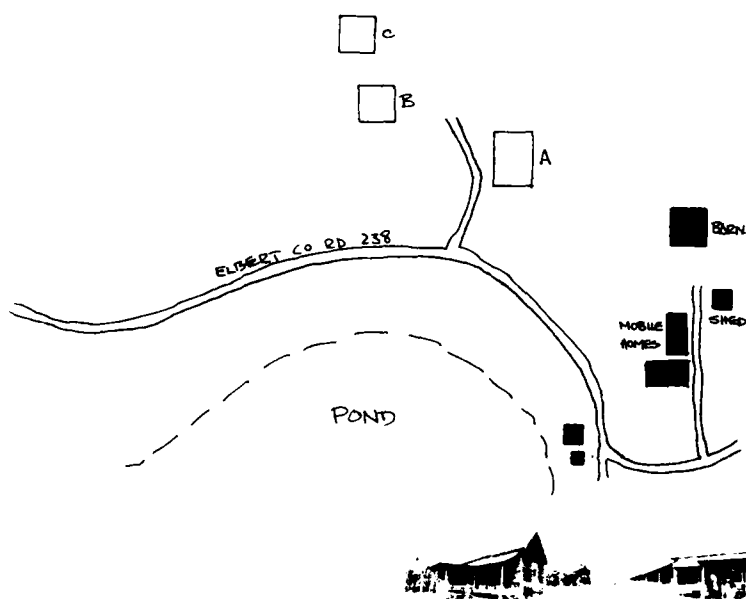

Significance

This dwelling is typical of small post-Civil War farm houses located throughout the project area and the Southeastern United States. The adaptation of the structure from house to barn exemplifies the way in which farm structures in this area are altered to meet changing needs. The associated barns, which have undergone similar alterations, are contemporary to this house, and formed a typical small farm complex for the region.

REFERENCES/CONTINUED

11. (continued) east and south on Co. 238 1.1 miles to the site.

ABSTRACT																			
MACT NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
110 000000 0000

FHR-8-230 June 1978

OAHB INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 3 - B		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
Classification		Barn		6 DATE		7 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1880				I. C. Cleveland	
8 NAME OF STRUCTURE		Barn		9 OWNER'S ADDRESS		Route 4		Elberton, Georgia 30635	
10 STATE		GA		11 COUNTY NAME		Elbert		12 VICINITY	
		Elbert		13 RUCKERSVILLE		14 CONG DIST		10	
15 BEGINNING AT THE INTERSECTION OF ELBERT COUNTY ROAD 266 AND ELBERT COUNTY ROAD S985 IN THE TOWN OF RUCKERSVILLE, PROCEED NORTHEAST ON ELBERT CO. S985 3.1 MILES TO THE INTER-		16 EXISTING SURVEYS		17 SPECIAL FEATURES (ENHANCE BELOW)		18 INTERIOR INTACT		19 EXTERIOR INTACT	
20 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
17		339810		3784600				24	
21 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								24	
22 FOUNDATION		23 EXCELLENT		24 GOOD		25 FAIR		26 DETERIORATED	
27 INVENTORIED BY		John L. Hopkins, Emily J. Harris		28 AFFILIATION		Historic American Buildings Survey		29 DATE	
								May 1, 1979	

Two-story, balloon frame barn with interior section of saddle-notched logs as a corn crib, 46' X 29'. Gable roof covered with sheetmetal, open eaves; clapboard siding and horizontal board sheathing; foundations of fieldstone granite piers. Plan is of three adjacent rooms - central bay is the log corn crib, with flanking machinery bays, cattle pens added to sides and rear. This structure is in a fair state of repair, but is rapidly deteriorating. Much of the original fabric remains in place, but is deteriorated through use and neglect, which will make the preservation of this structure difficult. Associated with this structure are two other structures (See EB1513-A).


(CONT OVER)

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
Barn		Barn			
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER					
Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE		21 NCBS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>				YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input checked="" type="checkbox"/> UNKNOWN <input type="checkbox"/>		INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT		25 NAME		DISTRICT ID NO			
YES <input type="checkbox"/> NO <input checked="" type="checkbox"/>							

25 PHOTOS AND SKETCH MAP OF LOCATION

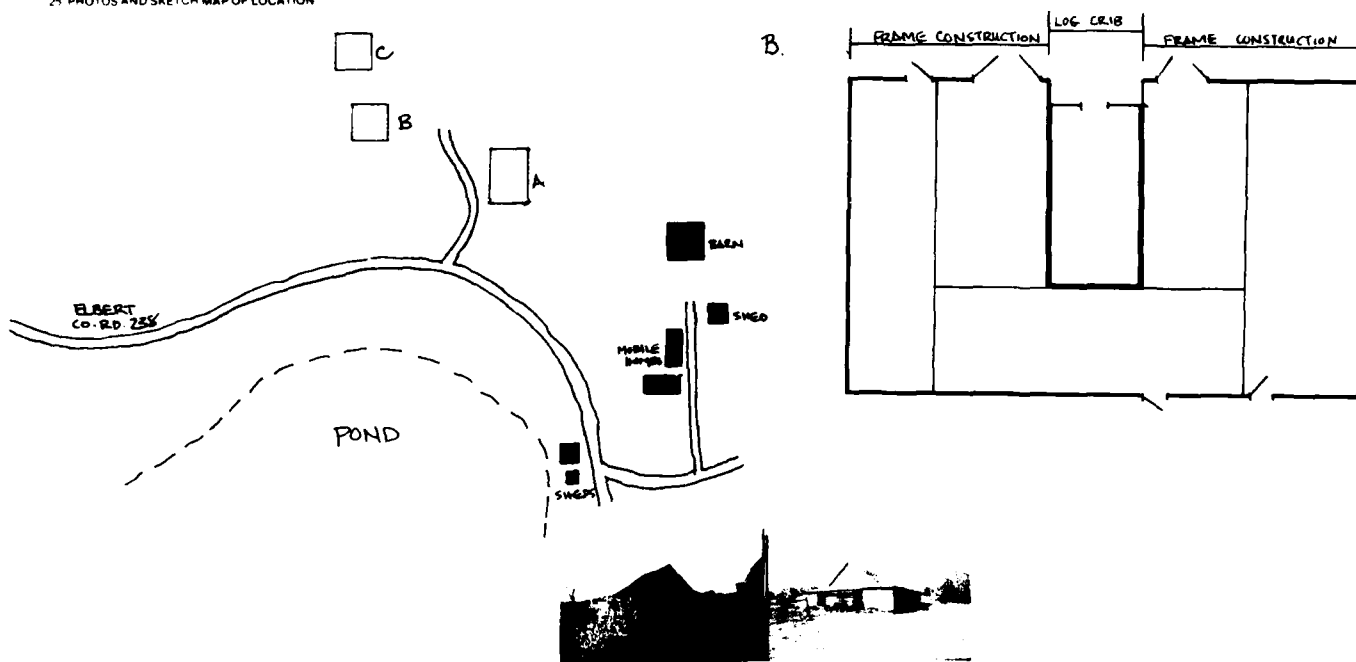

Significance

This barn is an unusual example of construction within the project area and in the surrounding regions. The use of saddle-notched logs to form a crib within the structure for the purpose of hay or corn storage appears to be quite singular. Despite additions to the original structure, most of the original fabric remains intact.

11. (continued) section with unpaved Elbert County Road 238, then east and south on Co. 238 1.1 miles to the site.

ABSTRACT																			
HIST NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
11-11-78

1 SITE ID NO	E	B	1	5	1	3	-	C	
--------------	---	---	---	---	---	---	---	---	--

OAHP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification Barn				3 PRIORITY <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				4 DANGER OF DEMOLITION - SPECIFY THREAT <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				<div style="text-align: center;"> <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition) </div>																																																																			
<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				5 DATE <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				6 GOVT SOURCE OF THREAT <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				OWNER <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				ADMIN <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																																															
<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				CA. 1880				7 OWNER ADMIN <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				I. C. Cleveland																																																																			
8 NAME OF STRUCTURE Barn								9 OWNER'S ADDRESS Route 4 Elberton, Georgia 30635																																																																							
10 STATE <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				11 COUNTY <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				12 COUNTY NAME <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>				13 VICINITY <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																																																			
G A				Elbert				Ruckersville				1 0																																																																			
14 SITE ADDRESS - STREET & NO. Beginning at the intersection of Elbert County Road 266 and Elbert County S985 in the town of Ruckersville, proceed northeast on Co. S985 3.1 miles to the intersection with unpaid Elbert County Road 238, then								15 EXISTING SURVEYS <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								16 SPECIAL FEATURES - DESCRIBE BELOW <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																																															
UTM ZONE <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								EASTING <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								NORTHING <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								SIGN <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								SCALE <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																															
1 7								3 3 9 8 0 0								3 7 8 4 6 2 5								QUAD NAME <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																																							
UTM ZONE <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								EASTING <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								NORTHING <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								SIGN <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								SCALE <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																															
<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								<div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>																																															
15 CONDITION <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								70 EXCELLENT <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								71 GOOD <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								72 FAIR <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								73 DETERIORATED <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								74 RUINS <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								75 UNEXPOSED <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								76 ALTERED <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								80 DESTROYED <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>								85 DEMOLISHED <div style="border: 1px solid black; width: 100px; height: 20px; margin: 2px;"></div>							
16 INVENTORIED BY John L. Hopkins, Emily J. Harris								AFFILIATION Historic American Buildings Survey								DATE May 1, 1979																																																															

17. DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One-story, balloon frame barn with post-and-frame additions and cattle pens, 45' X 21'. Gable and shed roofs covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. There have been many alterations to the original fabric of this structure, and it has deteriorated considerably. Associated with this structure are two other buildings (See EB1513-A).

18 ORIGINAL USE Barn		PRESENT USE Barn	ADAPTIVE USE
19 REFERENCES -- HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown			

The site map shows a road labeled "ELBERT CO. RD. 234" curving around a "POND". Three rectangular buildings are labeled A, B, and C. Building A is on the road, B is to its west, and C is further west. To the east of the road are several smaller structures, including a "BARN" and a "HOUSE". A north arrow points towards the top right.

The floor plan, labeled "C.", shows a rectangular building with a dashed outer boundary and a solid inner boundary. The inner boundary defines a smaller rectangle. A dimension line at the bottom of the inner rectangle is labeled "ORIGINAL STRUCTURE". A north arrow points towards the top right.

This barn is a typical example of an outbuilding for a small post-Civil War farmstead found throughout the project area and the Southeastern United States.

[illegible]

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		E B 1 5 1 4 - A		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification Residence				5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1810-1820		7 OWNER/ADMIN		Thomas J. Cleveland	
8 NAME(S) OF STRUCTURE		Cleveland House		9 OWNER'S ADDRESS		Route 3 Elberton, Georgia 30635			
10 STATE		GA		COUNTY NAME		Elbert		CONG DIST	
11 SITE ADDRESS (STREET & NO.)		Beginning at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert County Road		12 EXISTING SURVEYS		<input checked="" type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES: DESCRIBE BELOW	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 3 9 9 2 0		3 7 8 4 1 0 0				QUAD NAME	
								Lowndesville, S.C. - GA.	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
								74 <input type="checkbox"/> RUINS	
								75 <input type="checkbox"/> UNEXPOSED	
								76 <input type="checkbox"/> ALTERED	
								82 <input type="checkbox"/> DESTROYED	
								85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATES, HISTORICAL DATES, PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.		Two-story, hewn frame house with additions, 44' (probably three bays) X 36' (three bays). Gable and shed roofs covered with sheetmetal over wooden shingles, boxed cornice; asphalt siding over clapboards, 9x9 and 9x6 sash windows, with shutters, some original hardware in place, exterior brick chimneys laid in common bond on fieldstone granite foundations, many other details obscured due to asphalt siding; foundations of fieldstone granite and log piers. Plan probably consists of a room on either side of a central hall, three rooms deep with kitchen addition of one room to one corner of plan. Interior inaccessible. This house is in a fair state of repair and probably contains much of the original fabric, making its preservation and restoration a much easier task. Associated with this structure are three outbuildings: (b) smokehouse, CA. 1880; (c) wellhouse, CA. 1880; (d) barn, CA. 1910. All are in a fair state of preservation.							
18 ORIGINAL USE		Residence		PRESENT USE		Abandoned		ADAPTIVE USE	
19 REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER		Unknown. See National Register nomination form.							
20 URBAN AREA 50,000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCBS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN	
23 EDITOR				24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		DISTRICT ID NO	
INDEXER									

This large dwelling is the only extant example of the early plantation/farm houses in the project area. Constructed CA. 1810-1820, this house was properly recognized as significant by the National Register of Historic Places in 1976. The original fabric of this home seems to be in a good state of preservation and should be quite easily restored.

11. (continued) 238, then east and south 1.4 miles on Co. 238 to the site.

[illegible]

INT 4575-78

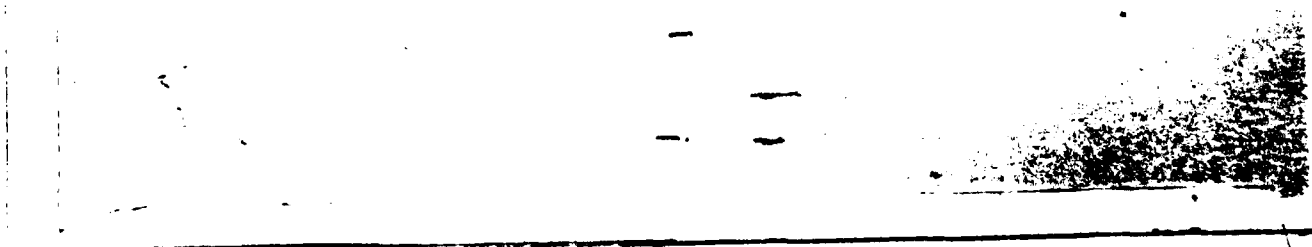

1 SITE ID NO


E	B	1	5	1	4	-	B
---	---	---	---	---	---	---	---

OAHP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification Smoke house		3 DANGER OF DEMOLITION SPECIFY THREAT		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
5 DATE CA. 1880		6 GOVT SOURCE OF THREAT <div style="border: 1px solid black; width: 100px; height: 15px;"></div>			
7 OWNER ADMIN Thomas J. Cleveland		8 OWNER'S ADDRESS Route 3 Elberton, GA 30635			
9 NAME OF STRUCTURE Cleveland Farm					
10 STATE GA COUNTY Elbert		11 VICINITY Ruckersville		12 CONG DIST 10	
13 SITE ADDRESS, STREET & NO. Beginning at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert County Road 238, then east and south on Co. 238 1.4 miles to the site.		14 UTM ZONE EASTING NORTHING SIGN SCALE <div style="display: flex; justify-content: space-between;"> <div> 1 7 3 3 9 9 0 0 3 7 8 4 1 2 0 </div> <div> QUAD NAME Lowndesville, SC - GA </div> </div>			
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input checked="" type="checkbox"/> DETEIORATED		16 INVENTORIED BY John Linn Hopkins, Emily J. Harris			
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979	
One-story, balloon frame smoke house, 10' (one bay) x 12' (one bay). Gable roof covered with wooden shingles; clapboard siding; foundations of fieldstone granite piers. Plan of one room. This building is in a fair state of preservation. The structure is associated with three other buildings (See EB1514-A).					
18 ORIGINAL USE Smoke house		PRESENT USE Abandoned		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown					
20 URBAN AREA 50000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
23 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		24 EDITOR NAME			

25 PHOTOS AND SKETCH MAP OF LOCATION

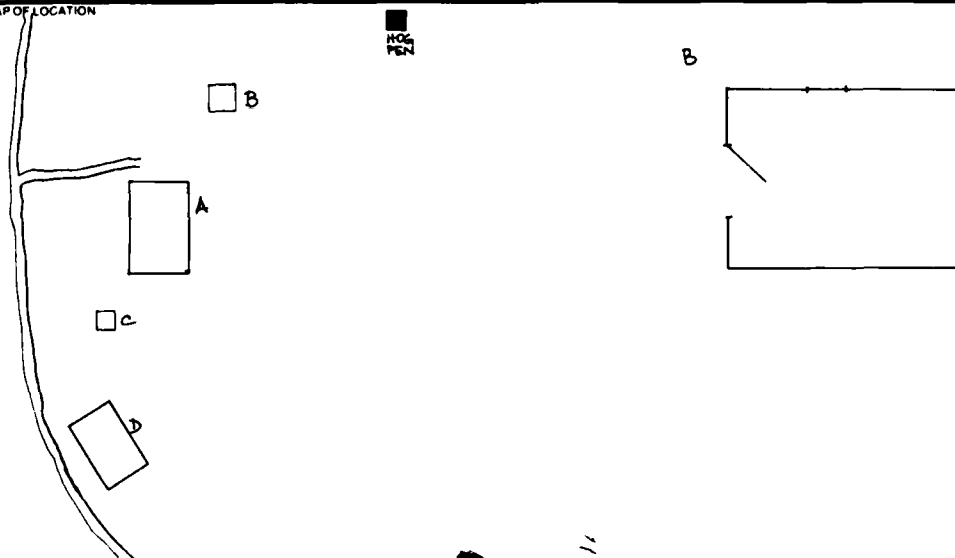

Significance This smoke house is a good example of a typical late nineteenth century farm outbuilding, seen throughout the project area and the southeastern United States (See EB1515-A).

REFERENCES CONTINUED

ABSTRACT																				
HA	PHO	LC	TECH	REPOR	HIST	REPORT	CONTEMP	PHOTO	HIST	PHOTO	CONTEMP	DRWG	HIST	DRWG	COLOR	PLATE	PHOTO	GRAM	SW	FILM

INT 4575-78
STUDY NUMBER 4575

REPRODUCED FROM


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 4 - C		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Well house		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1880				Thomas J. Cleveland	
8 NAME(S) OF STRUCTURE		Well house		9 OWNER'S ADDRESS		Route 3		Elberton, GA 30635	
10 STATE		G A		COUNTY NAME		Elbert		Ruckersville	
11 SITE ADDRESS STREET & NO		Beginning at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert County Road 238, then east and south on Co. 238 1.4 miles to the site.		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6		13 SPECIAL FEATURES: DESCRIBE BELOW	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 3 9 9 1 5		3 7 8 4 0 6 0				1:24 1:62.5	
15 CONDITION		70 <input type="checkbox"/> EXCEL. NT		71 <input type="checkbox"/> GOOD		72 <input checked="" type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATES, HISTORICAL DATES, PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.		One-story, open sided post and frame well house, 8' x 7'. Gable roof covered with sheetmetal over wooden shingles. Original crank and well cover still in place. This structure is in a fair state of preservation. It is associated with three other structures (See site EB1515-A).		74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED	
18 ORIGINAL USE		Well house		PRESENT USE		Well house		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER		Unknown		20 URBAN AREA 50,000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region	
22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO		23 EDITOR		INDEXER		24 LOCATED IN AN HISTORIC DISTRICT?	
25 DISTRICT ID NO				26 NAME				27 DATE	

25 PHOTOS AND SKETCH MAP OF LOCATION

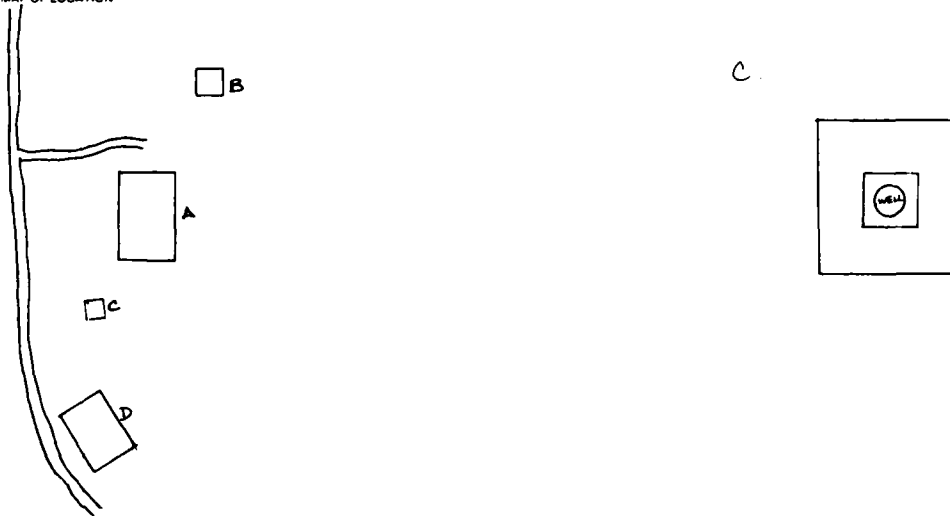

Significance This well house is typical of many such structures built in the nineteenth and early twentieth centuries throughout the project area and surrounding region.

REFERENCES (CONTINUED)

ABSTRACT																			
HAZARD	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM							

INT 4575-78
 11


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 4 - D		2 CLASSIFICATION		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
Barn						CA. 1910		6 GOVT SOURCE OF THREAT		Corps of Engineers (Demolition)	
8 NAME(S) OF STRUCTURE		Barn		9 OWNER'S ADDRESS		Route 3 Elberton, GA 30635		7 OWNER ADMIN		Thomas J. Cleveland	
10 STATE		GA		COUNTY NAME		Elbert		CITY		Ruckersville	
11 SITE ADDRESS STREET & NO.		Beginning at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert County Road 238, then east and south on Co. 238 1.4 miles to the site.		12 EXISTING SURVEYS		13 SPECIAL FEATURE: DESCRIBE BELOW		14 UTM ZONE		EASTING	
								15 CONDITION		70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input checked="" type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED	
								16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris	
								AFFILIATION		Historic American Buildings Survey	
								DATE		May 1, 1979	
								17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC		Two-story, hewn and sawn frame barn, 35' x 25', probably incorporating members from an earlier structure. Gable roof covered with sheetmetal over wooden shingles; clapboard siding; foundations of fieldstone granite piers. Plan has two stalls on either side of a central wagon bay. The barn is in a fair state of preservation. It is associated with three other structures. (See EB1514-A).	
								18 ORIGINAL USE		Barn	
								PRESENT USE		Abandoned	
								ADAPTIVE USE			
								19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER		Unknown	
								20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region	
								22 PUBLIC ACCESSIBILITY		23 EDITOR	
								24 LOCATED IN AN HISTORIC DISTRICT?		25 INDEXER	
								26 DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

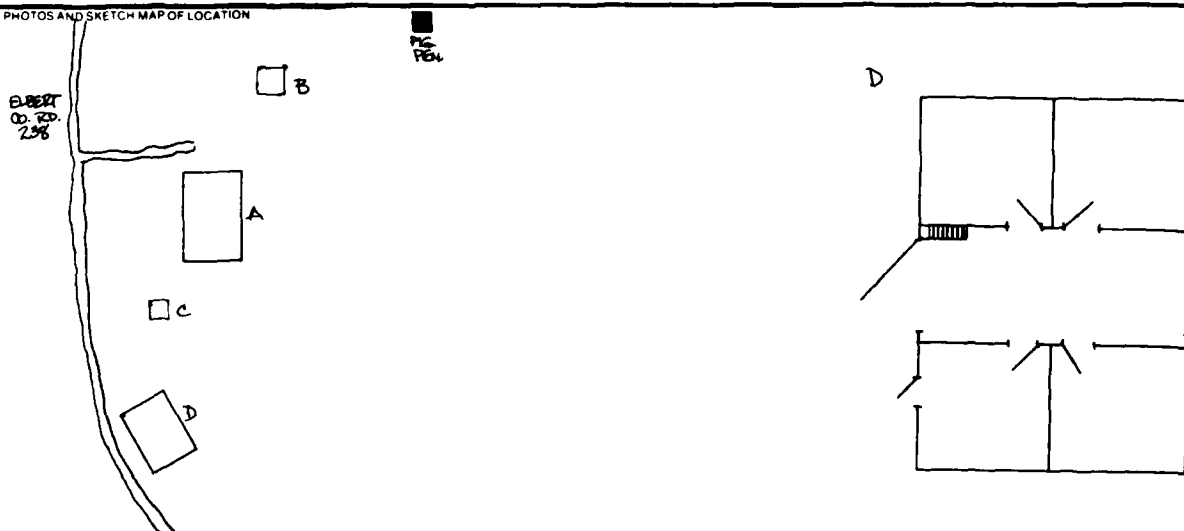

Significance According to informant evidence this barn was moved from an early local mill site to its present location, CA 1910. The site and construction of the barn indicates that the original barn, CA. 1840, was radically altered through the relocation process, in effect building a new barn from old parts.

REFERENCES CONTINUED

ABSTRACT																			
HAC NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIS PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11

FHR-8-230 June 1978

OAHF INVENTORY


Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 5 - A		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification		Residence		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN Eugene W. Harper	
8 NAME OF STRUCTURE		Residence		9 OWNER'S ADDRESS		Route 2		Hartwell, GA 30643	
10 STATE		GA		COUNTY NAME		Elbert		CITY VICINITY	
COUNTY		Elbert		CITY VICINITY		Ruckersville		CONG DIST	
11 SITE ADDRESS (STREET & NO)		Beginning at the intersection of Elbert		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		County Road 266 and Elbert Co. Road S985 in the town of Ruckersville, proceed Northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert Co. Road 238, then east and south on Co. 238 1.6 miles to the site.	
13 SPECIAL FEATURE: DESCRIBE BELOW		<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT		14 UTM ZONE		EASTING		NORTHING	
SIGN		SCALE		<input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:60 <input type="checkbox"/> OTHER		QUAD NAME		Lowndesville, SC - GA	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input checked="" type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 80 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED		16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.		One-story, balloon frame house, 32' (two bays) x 34' (two bays). Gable roofs covered with sheetmetal; clapboard siding, boxed eaves, 4 x 4 sash windows; foundations of fieldstone granite piers. L-shaped plan two rooms wide by two rooms deep, with a front porch with turned supports, interior brick chimney laid on fieldstone granite foundation. Interior finish of sheathing and gypsum board. This structure is in a poor state of repair, and is deteriorating rapidly due to its use as storage for animal feed. The preservation of this structure would be difficult. Associated with this structure are three other structures: B) Barn, CA. 1880; C) Barn, CA. 1880; D) Well house, CA. 1880. All of these structures are deteriorating rapidly.		DATE		May 1, 1979			
18 ORIGINAL USE		Residence		PRESENT USE		Storage		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER		Unknown							
20 URBAN AREA 50,000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
23 EDITOR				24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		DISTRICT ID NO	
INDEXER				NAME					


(CONT OVER)

(CONT OVER)

SITE 1514

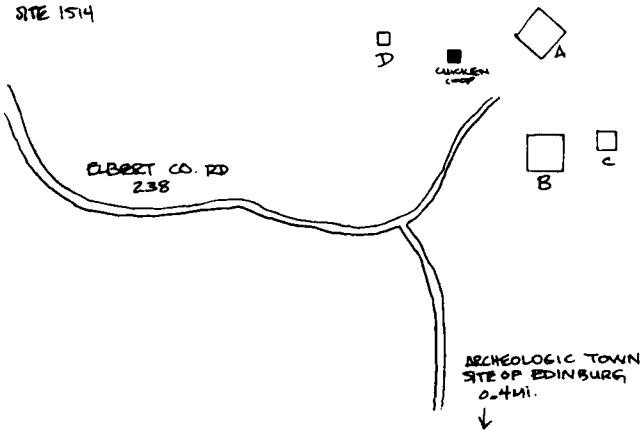

A.

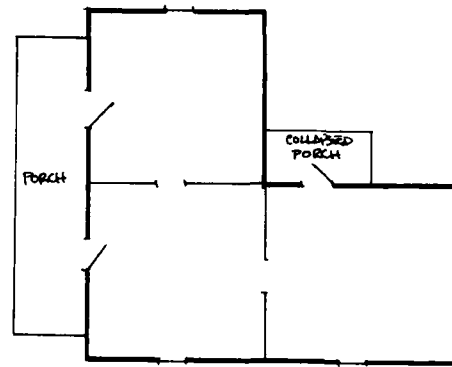

Significance This small house is an example of a typical dwelling for a late-nineteenth century farm, seen throughout the project area and the southeastern United States. The current use of this structure as a storage building for farm products is resulting in the increasing deterioration of its original fabric. It is associated with three outbuildings, comprising a typical late-nineteenth century small farm complex.

REFERENCES CONTINUED:

ABSTRACT														
MAKING	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM			

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11


FHR-8-230 June 1978

OAHIP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 5 - B		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Barn		5 DATE		6 GOVT SOURCE OF THREAT		Corps of Engineers (Demolition)	
7 NAME OF STRUCTURE		Barn		8 OWNER'S ADDRESS		9 OWNER ADMIN		Eugene W. Harper	
10 STATE		G A		11 COUNTY NAME		12 CITY		Hartwell	
13 SITE ADDRESS (STREET & NO)		Beginning at the intersection of Elbert County Road 266 and Elbert Co. Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. Road S985 3.1 miles to the intersection with unpaved Elbert Co. Road 238, then east and south on Co. 238 1.6 miles to the site.		14 UTM ZONE		15 EASTING		16 NORTHING	
17 UTM ZONE		18 EASTING		19 NORTHING		20 SIGN		21 SCALE	
17 UTM ZONE		18 EASTING		19 NORTHING		20 SIGN		21 SCALE	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATES; HISTORICAL DATES; PHYSICAL DIMENSIONS MATERIALS; EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC.		Two-story balloon frame barn with post and frame shed additions, 56' x 27'. Gable and shed roofs covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. This structure is in a fair state of preservation. It is associated with three other buildings (See site EB1515-A for general comments).		18 URBAN AREA 50 000 POP OR MORE?		21 NCRS Region		22 PUBLIC ACCESSIBILITY	
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND OTHER		Unknown		23 EDITOR		24 DEVER		25 LOCATED IN AN HISTORIC DISTRICT?	
20 URBAN AREA 50 000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
24 URBAN AREA 50 000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
25 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO		26 DISTRICT ID NO	

PHOTOS AND SKETCH MAP OF LOCATION

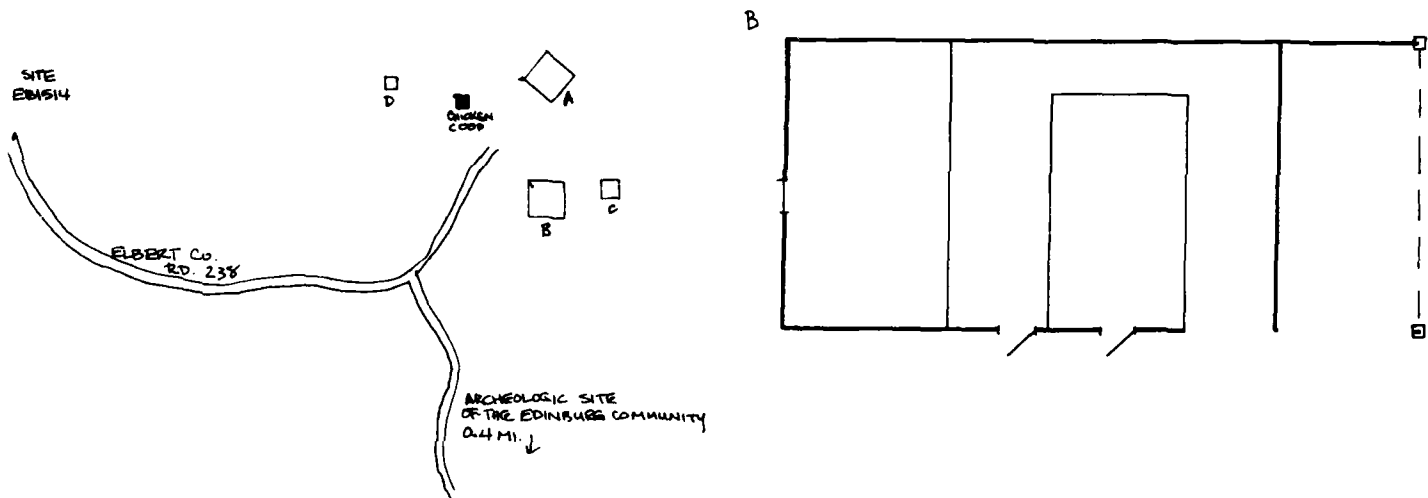

Significance This small barn is typical of late nineteenth century farm outbuildings found throughout the project area and the southeastern United States. (See EB1575-A)

REFERENCES (CONTINUED)

ARCHITECT																			
HA	YND	CC	TECH REPORT	HAZ REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM							

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 5 - C		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Barn		5 DATE		6 GOVT SOURCE OF THREAT		Corps of Engineers (Demolition)	
8 NAME(S) OF STRUCTURE		Barn		7 OWNER ADMIN		9 OWNER'S ADDRESS		Eugene W. Harper Route 2 Hartwell, GA 30643	
10 STATE	GA	COUNTY NAME	Elbert	CITY VICINITY	Ruckersville	CONG DIST	10	STATE	GA
COUNTY								COUNTY NAME	Hart
11 SITE ADDRESS, STREET & NO.		Beginning at the intersection of Elbert County Road 266 and Elbert Co. Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert Co. Road 238, then east and south on Co. 238 1.6 miles to the site.		12 EXISTING SURVEYS		13 SPECIAL FEATURES: DESCRIBE BELOW		14 UTM ZONE	
				<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6				15 CONDITION	
				<input type="checkbox"/> CONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER				70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input checked="" type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED	
				<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT				16 INVENTORIED BY	
								John Linn Hopkins, Emily J. Harris	
								AFFILIATION	
								Historic American Buildings Survey	
								DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC									
Two-story, balloon frame storage barn, 12 x 16. Gable roof covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. This structure is in a poor state of preservation. It is associated with three other buildings (See site EB1515-A for general comments).									
(CONT OVER)									
18 ORIGINAL USE			PRESENT USE			ADAPTIVE USE			
Storage barn			Storage barn						
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER									
Unknown									
(CONT OVER)									
20 URBAN AREA 50 000 POP OR MORE?		21 NCAS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR		INDEXER	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		1		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN					
24 LOCATED IN AN HISTORIC DISTRICT?		NAME		DISTRICT ID NO					
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO									

25 PHOTOS AND SKETCH MAP OF LOCATION

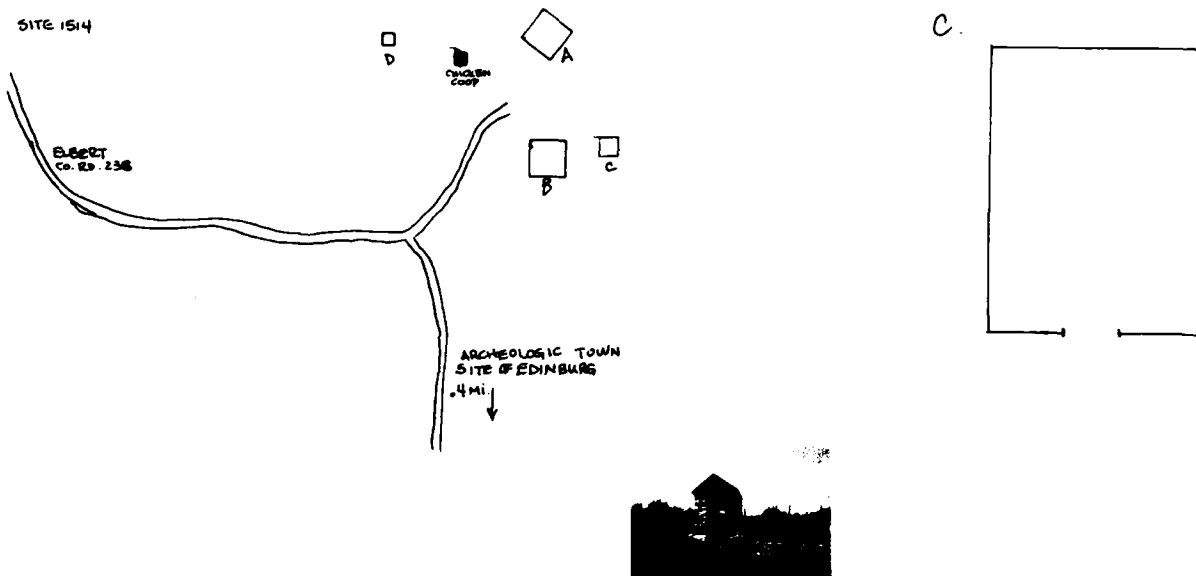

Significance This storage barn is typical of small outbuildings on late nineteenth century farms found throughout the project area and the southeastern United States. (See EB1515-A)

REFERENCES (CONTINUED)

ABSTRACT																			
MAST NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
1100 610000 0000

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO E B 1 5 1 5 - D		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT) Corps of Engineers (Demolition)	
2 Classification Well house		5 DATE CA. 1880		6 GOVT SOURCE OF THREAT OWNER <input type="checkbox"/> ADMIN <input type="checkbox"/>	
8 NAME(S) OF STRUCTURE Well house		9 OWNER'S ADDRESS Route 2 Hartwell, GA 30643			
10 STATE GA COUNTY Elbert CITY VICINITY Ruckersville CONG DIST 10		STATE GA COUNTY Hart CITY VICINITY Hartwell CONG DIST 09			
11 SITE ADDRESS/STREET & NO. Beginning at the intersection of Elbert County Road 266 and Elbert Co. Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert Co. Road 238, then east and south on Co. 238 1.6 miles to the site.					
12 EXISTING SURVEYS <input type="checkbox"/> NH <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLB <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES: DESCRIBE BELOW <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT			
14 UTM ZONE 17 EASTING 3401303784020 NORTHING 710 SIGN 710 SCALE 1:24 QUAD NAME Lowndesville, SC - GA		15 CONDITION <input type="checkbox"/> EXCELLENT <input type="checkbox"/> GOOD <input type="checkbox"/> FAIR <input type="checkbox"/> DETERIORATED <input type="checkbox"/> RUINS <input type="checkbox"/> UNEXPOSED <input type="checkbox"/> ALTERED <input type="checkbox"/> DESTROYED <input type="checkbox"/> DEMOLISHED			
16 INVENTORIED BY John Linn Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.					

One-story, open-sided, post and frame well house, 7' x 6'. Gable roof covered in sheetmetal. This structure is associated with three other structures, see EB1515-A for general comments.


(CONT OVER)

18 ORIGINAL USE Well house	PRESENT USE Well house	ADAPTIVE USE
19 REFERENCES - HISTORIC REFERENCES, PERSONAL CONTACTS, AND/OR OTHER Unknown		

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	21 NEHS Region 10	22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	23 EDITOR INDEXER
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO NAME		DISTRICT ID NO	

25 PHOTOS AND SKETCH MAP OF LOCATION

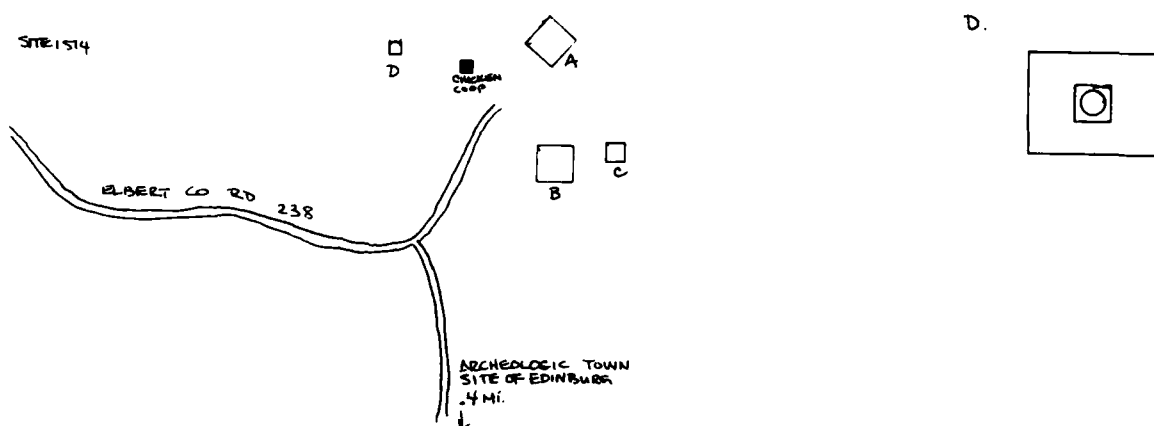

Significance This well house is a typical example of many such structures throughout the project area and surrounding regions. Much of the fabric is in place, but is greatly deteriorated through neglect. See EB1515-A for general comments.

REFERENCES (CONTINUED)

ABSTRACT																			
HA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM							

INT 4575-78

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 6 - A		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
2 Classification		Well house		5 DATE		CA. 1850		6 GOVT SOURCE OF THREAT OWNER ADMIN	
8 NAME(S) OF STRUCTURE		Well house		7 OWNER ADMIN		Frank S. Fortson, III		9 OWNER'S ADDRESS	
						Box 307		East Palatka, FL 32031	
10 STATE		GA		COUNTY NAME		Elbert		CITY VICINITY	
COUNTY				Ruckersville		CONG DIST		10	
11 SITE ADDRESS (STREET & NO.)		Beginning at the intersection of Elbert		12 EXISTING SURVEYS		NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/>			
County Road 266 and Elbert County Road S985 in the town of		Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles		13 SPECIAL FEATURES (DESCRIBE BELOW)		INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT <input checked="" type="checkbox"/>			
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 3 9 3 8 0		3 7 8 5 1 9 0				1:24 <input checked="" type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER <input type="checkbox"/>	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								1:24 <input checked="" type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER <input type="checkbox"/>	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input checked="" type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
		74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		82 <input type="checkbox"/> DESTROYED	
								85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS

MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

One-story, partially enclosed well house of hewn frame and post and frame construction, 20' x 8'. Gable roof covered with tarpaper over asphalt shingles; enclosed portion covered with clapboards, board sheathing half-way down on two sides around well; foundations of fieldstone granite piers. Cement floor around well, cement and wooden well cover and well crank in place. This structure is fairly well preserved. This well house and a large cattle barn (Site EB1516-B) are the only two structures remaining from an early plantation/farm complex, CA. 1850. The well house is in close proximity to the ruins of what appears to be an early farm house.

(CONT OVER)

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
Well house		Well house			
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER					
Unknown					

(CONT OVER)

20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		22 PUBLIC ACCESSIBILITY		YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input checked="" type="checkbox"/> UNKNOWN <input type="checkbox"/>		23 EDITOR	
								INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO					

~~XXXXXXXXXX~~ CONTINUED: 11. Site Address (Street & No)

Road 238, then east and south on Co. 238 .5 miles to an unpaved private road, then northeast on the private road 0.2 miles to the site.

[illegible]

INT 4575-7

FHR-8-230 June 1978

1 SITE ID NO

E B 1 5 1 6 - B

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Barn

3 PRIORITY

CA. 1850

4 DANGER OF DEMOLITION
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER ADMIN

Frank S. Fortson, III

8 OWNER'S ADDRESS

Box 307
East Palatka, FL 32031

10 STATE

GA

COUNTY NAME

Elbert

CITY/VICINITY

Ruckersville

CONG DIST

10

STATE

FL

COUNTY NAME

Putnam

CITY/VICINITY

East Palatka

CONG DIST

11 SITE ADDRESS (STREET & NO.)

Beginning at the intersection of Elbert
County Road 266 and Elbert County Road 5985 in the town of
Ruckersville, proceed northeast on Elbert Co. 5985 3.1 miles
to the intersection with unpaved Elbert County Road 238, then
east and south on Co. 238 0.5 miles to an (don't Reverse)

12 EXISTING SURVEYS

☐ NPL☐ NPL☐ HABS☐ HAER☐ HAER☐ NPS☐ CLN

13 SPECIAL FEATURE

ENTIRE BELOW

☒ INTERIOR INTACT☒ EXTERIOR INTACT☒ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:625

QUAD NAME

Lowndesville, SC - GA

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:625

QUAD NAME

15 CONDITION

70 EXCELLENT

71 GOOD

72 FAIR

73 DETERIORATED

74 RUINS

75 UNEXPOSED

76 ALTERED

77 DESTROYED

78 DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS

MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

Two-story, hewn frame cattle barn with balloon frame addition, 38' x 24'. Gable roof covered with sheetmetal; clapboard siding and board sheathing; foundations of wooden posts and fieldstone granite piers. Three rooms wide, one room deep, mangers in two end rooms. This structure has deteriorated, but remains in a fair state of preservation. It is one of two structures remaining from an early plantation/farm complex. CA. 1850 (See EB1516-A).

(CONT OVER)

18 ORIGINAL USE

Barn

PRESENT USE

Barn

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50 000
POP OR MORE?☐ YES ☒ NO

21 NCAS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

25 PHOTOS AND SKETCH MAP OF LOCATION

The sketch map shows a curved road labeled "PRIVATE ROAD TO THE SAVANNAH RIVER" with an arrow indicating direction. Along the road, there are three marked locations: a small square labeled "A", a larger rectangle labeled "B", and a solid black rectangle labeled "HOUSE SITE". To the right of the map is a floor plan of a rectangular building. The plan is divided into three horizontal sections. The top section is labeled "B." and contains a smaller rectangle labeled "MANGER". The middle section is labeled "MANGER". The bottom section is labeled "MANGER". To the right of the floor plan, a vertical line with arrows at both ends is labeled "ORIGINAL" for the top two sections and "ADDITION" for the bottom section. A north arrow labeled "N" points towards the top right.

11. Site Address (Street & No)
unpaved private road, then northeast on the private road 0.3 miles to the site.

ABSTRACT											
HAT NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM
									INT 4575-71		


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		E B 1 5 1 8		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification Residence				5 DATE CA. 1820, w/additions CA. 1908		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME/S OF STRUCTURE Gully House						7 OWNER ADMIN Robert A. Alexander, et al		9 OWNER'S ADDRESS 6651 Starling Drive Mableton, Georgia 30059	
10 STATE GA		COUNTY NAME Elbert		CITY VICINITY Ruckersville		CONG DIST 10		STATE GA	
COUNTY						Cobb		CITY VICINITY Mableton	
11 SITE ADDRESS STREET & NO Beginning at the intersection of Elbert County Road 266 and Elbert County Road S985 in the town of Ruckersville, proceed northeast on Elbert Co. S985 3.1 miles to the intersection with unpaved Elbert County Road						12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER			
13 SPECIAL FEATURES DESCRIBE BELOW: <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT									
14 UTM ZONE 17		EASTING 339140		NORTHING 3785650		SIGN		SCALE <input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER	
UTM ZONE								QUAD NAME Lowndesville, S.C. - GA.	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input checked="" type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 80 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY John L. Hopkins, Emily J. Harris				AFFILIATION Historic American Buildings Survey		DATE May 1, 1979			
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC. One-story, hewn and balloon frame house, 63' (six bays) X 50' (two bays) deep. Gable roofs covered with sheetmetal, boxed eaves; clapboard siding, 9x6, 6x6, and 2x2 sash windows, exterior chimneys of fieldstone granite to height of first floor ceilings, brick above. Plan is irregular; original plan of two rooms, with exterior chimneys, additions made on both sides to create five room plan. Interior sheathed throughout, parts of original sheathing fabric and dado remain along with original mantels. This structure is in a good state of repair, and could be easily preserved and restored. Associated with this structure are three outbuildings, none of which were recorded due to extreme deterioration and overgrowth.									
(CONT OVER)									
18 ORIGINAL USE Residence		PRESENT USE Residence		ADAPTIVE USE					
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER Unknown									
(CONT OVER)									
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER			
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO					

25 PHOTOS AND SKETCH MAP OF LOCATION

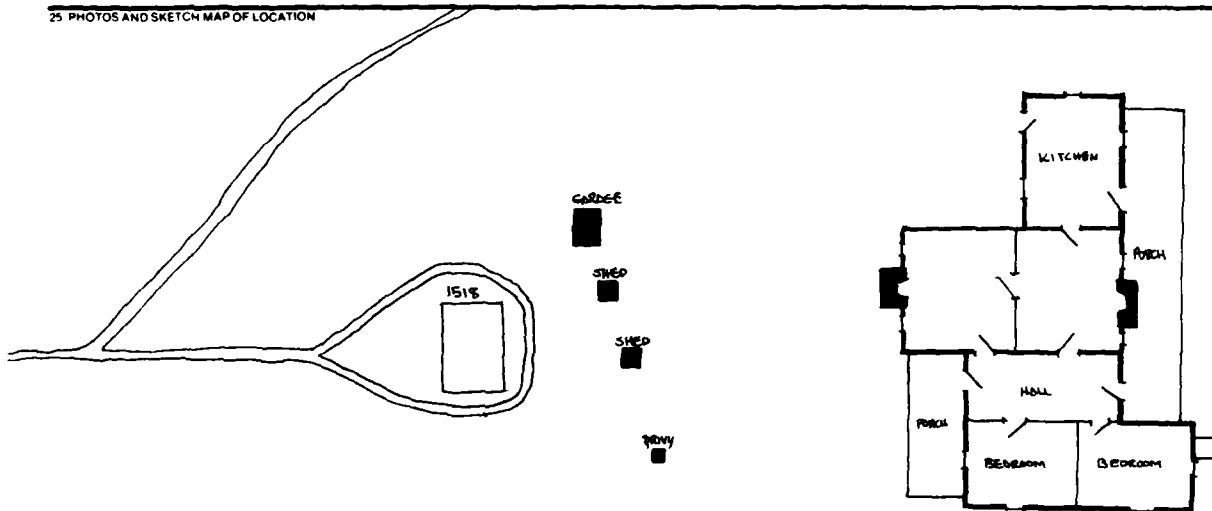

Significance This small farm house has been in the Gully Family for approximately seventy-one years, and displays two radically different but well preserved periods of architectural construction. The core of this home was built CA. 1820, and contains a good deal of original fabric despite being greatly altered from its intended appearance. Additions to the house were undertaken CA. 1908, according to informant evidence, which included the partial removal of the second story of the original home. The fabric of the early twentieth century additions remains intact and in excellent repair.

11. (continued) 238, then east on Co. 238 0.2 miles to the intersection with unpaved Elbert County Road 305, then northeast on Elbert Co. 305 0.4 mile to the site.

ABSTRACT																			
MAST NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRAWG	HIST DRAWG	COLOR PLATE	PHOTOGRAPH	SW	FILE								

INT 4575-78
1100 00 000000 0000

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										2 Classification BT & A (Truss)										3 PRIORITY										4 DANGER OF DEMOLITION? SPECIFY THREAT: inundation									
6 0 3 0										5 DATE ca. 1900										6 GOVT SOURCE OF THREAT OWNER ADMIN																			
8 NAME OF STRUCTURE Blackwell Bridge										9 OWNER'S ADDRESS GA. DOT Atlanta, GA.																													
10 STATE COUNTY GA Elbert										CITY VICINITY Elberton										CONG DIST																			
11 SITE ADDRESS (STREET & NO): Beginning at the intersection of Georgia State Highway 72 and Elbert County Road 244, proceed north on Co. 244 1.7 miles to the bridge on Beaverdam Creek.										12 EXISTING SURVEYS										13 SPECIAL FEATURES DESCRIBE BELOW																			
14 UTM ZONE EASTING NORTHING SIGN SCALE										15 UTM ZONE EASTING NORTHING SIGN SCALE										16 CONDITION																			
17 INVENTORIED BY JHH, EJH, DCJ										AFFILIATION HARS/HAER										DATE																			

18 ORIGINAL USE
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

This structure is a single span, pin connected Pratt through truss, 158'11" long and 18'4" wide. The road deck is wooden and is supported on steel floor beams. The bridge is supported on quarried granite bridge abutments. The truss is composed of eyelar diagonals, tension members and laced channel compression members. The top chord lateral bracing is of a form which would almost certainly predate 1910. It retains its historic integrity and exhibits important features of the "American System" of pin connections.

18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE										CONT OVER									
Bridge										Bridge																													
20 URBAN AREA 50,000 POP OR MORE										21 NCAS Region										22 PUBLIC ACCESSIBILITY										23 EDITOR NUMBER									
YES NO										YES LIMITED NO YES UNLIMITED UNKNOWN																													
24 LOCATED IN AN HISTORIC DISTRICT										NAME										DISTRICT ID NO																			


AD-A138 418


ALL THAT REMAINS THE TRADITIONAL ARCHITECTURE AND
HISTORIC ENGINEERING ST. (U) NATIONAL PARK SERVICE
ATLANTA GA ARCHEOLOGICAL SERVICES BRANC. L H WORTHY
1983

2/3


F/G 5/6

NI

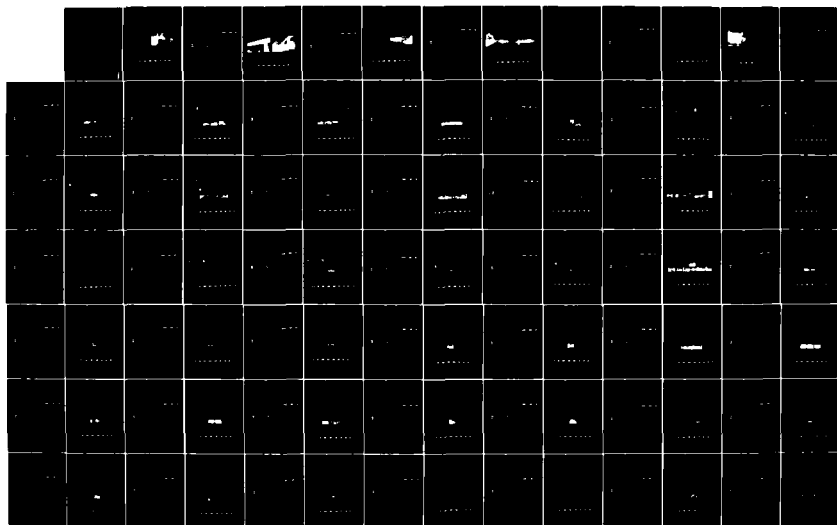

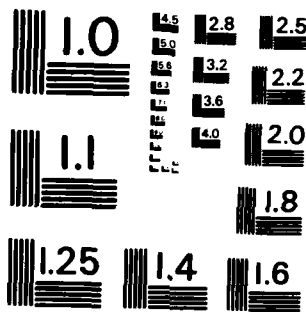

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

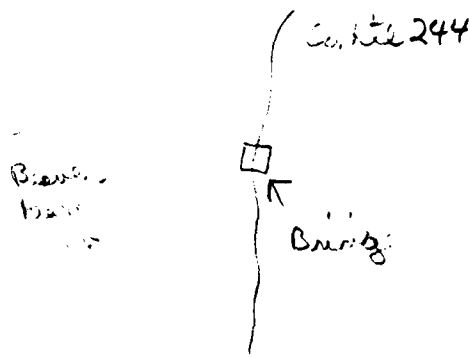


Significance

A turn-of-the-century Pratt through truss that is of local significance in the context of transportation and commerce. It is also a regionally significant example of a bridge technology which was once quite common but is rapidly disappearing.

REFERENCES (CONTINUED)

ABSTRACT		HIST PHOTO		CONTEMP PHOTO		HIST DRWG		CONTEMP DRWG		COLOR PLATE		PHOTOGRAM		SW		FILM	

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11

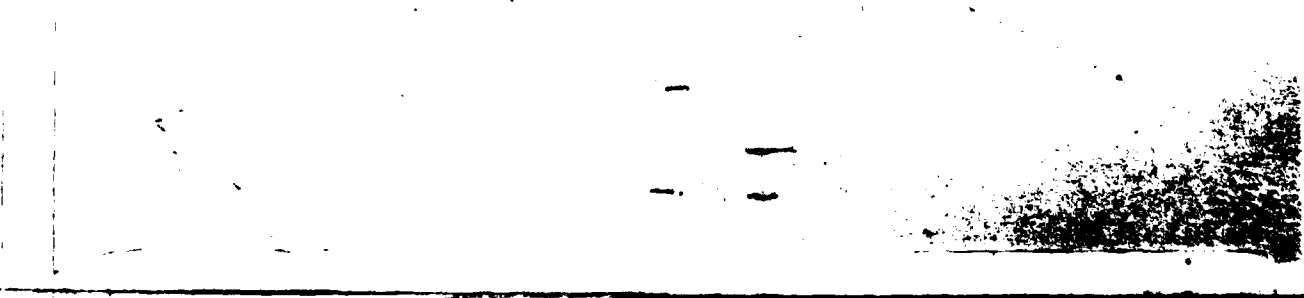

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO						3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Inundation	
2 Classification		BT & A (Beam)				5 DATE		6 GOVT SOURCE OF THREAT		OWNER	
		5 8 4 0				ca. 1908				ADMIN	
8 NAME(S) OF STRUCTURE		Savannah River Railroad Bridge				9 OWNER'S ADDRESS		Seaboard Coastline Railroad		Atlanta, Georgia	
10 STATE		COUNTY		CITY/VICINITY		CONG DIST		STATE		COUNTY	
G A		Elbert		Elberton		1 0		S C		Abbeville	
11 SITE ADDRESS (STREET & NO.)		Bridge is 1.2 miles up river (north) of Highway 72 Bridge, approx. 2.5 miles west of the intersection of the Seaboard Coastline Railroad and S.C. State Hwy. 81 in Calhoun Falls.				12 EXISTING SURVEYS		13 SPECIAL FEATURES (DESCRIBE BELOW)		<input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE		QUAD NAME	
1 7		3 4 8 6 2 0		3 7 7 1 6 6 0				1:24 1:62.5			
15 CONDITION		70 EXCELLENT		71 GOOD		72 FAIR		73 DETERIORATED		74 RUINS	
										75 UNEXPOSED	
										76 ALTERED	
										82 DESTROYED	
										85 DEMOLISHED	
16 INVENTORIED BY		JLH, EJH, DCJ				AFFILIATION		HABS/HAER		DATE	
										May 24, 1979	

17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC. This structure is a 21 span plate girder railroad bridge carrying the Seaboard Coastline RR over the Savannah River. The spans are approximately 125 feet long and rest primarily on concrete piers. However, portions of five piers are made of granite, which indicates the present bridge may not be the original on the site. According to the Elberton Star, April 17, 1928: The bridge was built in 1908. The north end of the bridge was torn away by flood in 1928, and a \$25,000 contract was granted for construction of some new concrete piers for the bridge.

(CONT OVER)

18 ORIGINAL USE	Bridge	PRESENT USE	Bridge	ADAPTIVE USE
-----------------	--------	-------------	--------	--------------

19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER


Elberton Star, April 17, 1928.

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	21 NCRS Region	22 PUBLIC ACCESSIBILITY	<input type="checkbox"/> YES, LIMITED <input type="checkbox"/> YES, UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	23 EDITOR	
24 LOCATED IN AN HISTORIC DISTRICT?	<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	NAME	DISTRICT ID NO		INDEXER	

25 PHOTOS AND SKETCH MAP OF LOCATION

GP. Savannah, Ga.
S.C.
Savannah RR.
GA. R.R. 22

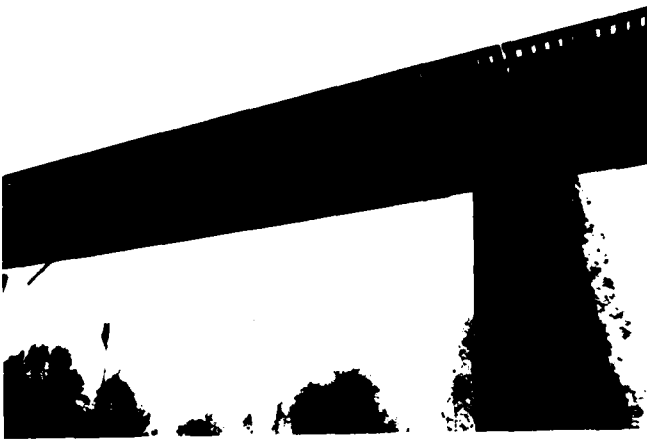


Significance A regionally significant example of plate girder construction that was important in the development of the area.

REFERENCES (CONTINUED)

ABSTRACT

HAZ. NO.	LC	TECH. REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRAWG.	HIST. DRAWG.	COLOR PLATE	PHOTOGRAPH	SW	FILM

INT 4575-78
110 00 000000 0000

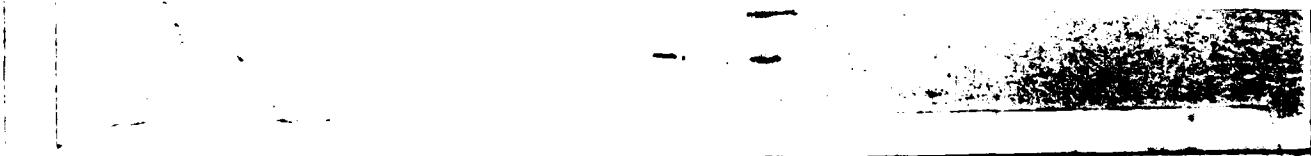

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240



1 SITE ID NO										2 Classification										3 PRIORITY										4 DANGER OF DEMOLITION? (SPECIFY THREAT)									
BT & A (Truss)										6 0 3 0										1927										Inundation by Reservoir									
8 NAME(S) OF STRUCTURE										9 OWNER'S ADDRESS										7 OWNER ADMIN										6 GOVT SOURCE OF THREAT									
GA Route 368 Bridge Sander's Ferry Bridge										GA DOT Atlanta, GA										S.C. DOT Columbia, S.C.										Georgia/ South Carolina DOT									
10 STATE										COUNTY NAME										CITY/VICINITY										CONG DIST									
GA										Elbert										Elberton																			
11 SITE ADDRESS (STREET & NO)										12 EXISTING SURVEYS										13 SPECIAL FEATURES DESCRIBE BELOW										14 UTM ZONE									
Beginning at the intersection of South Carolina State Highway 184 and South Carolina State Highway 81 in the town of Iva, proceed southwest on State Highway 184, 6.5 miles to the bridge.										<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLG <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER										<input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT										EASTING: 1 7 3 3 9 2 4 5 NORTHING: 3 7 9 1 6 8 5									
15 CONDITION										16 INVENTORIED BY										AFFILIATION										DATE									
70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED										JLH, EJH, DCJ																													

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC. The structure is a three span, pin connected Camelback Through Truss. Each truss span is 161 feet long, 19 wide and supported on reinforced concrete piers founded on bedrock. The approach spans are 75 feet long. The "Sander's Ferry Bridge" was built jointly by Elbert County, Ga. & Anderson County, S.C. at a cost of \$82,000. It was the only non-toll bridge connecting Anderson County with Georgia. Built by the Austin Bridge Company of Atlanta, the bridge was formally opened March 17, 1927. The structure is a near classic example of a bridge using the "American System" of pin connections.

(CONT OVER)

18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE																			
Bridge										Bridge										Bridge																			
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER																																							
Elberton Star February 4, 12, 25, 1927.																																							
"A Guide to Dating and Identifying Trusses" AASLH Technical Leaflet No. 95, T. Allan Comp and Donald C. Jackson.																																							
20 URBAN AREA 50,000 POP OR MORE?										21 NCRS Region										22 PUBLIC ACCESSIBILITY										23 EDITOR									
<input type="checkbox"/> YES <input type="checkbox"/> NO										<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										<input type="checkbox"/> YES <input type="checkbox"/> NO										INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT?										NAME										DISTRICT ID NO																			
<input type="checkbox"/> YES <input type="checkbox"/> NO																																							

25 PHOTOS AND SKETCH MAP OF LOCATION

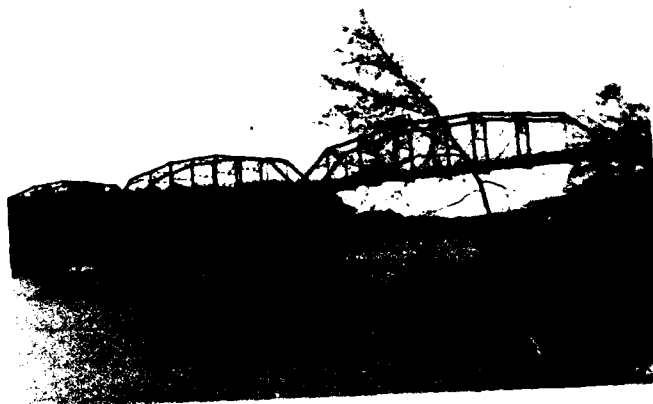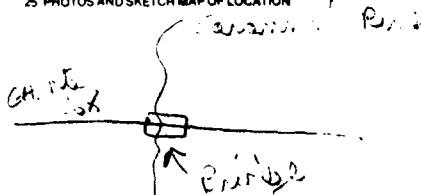

Significance A regionally significant bridge built in response to the automobile surge of the 1920's. It is an excellent example of the "American System" of pin connections as applied to bridges.

REFERENCES (CONTINUED)

ABSTRACT																			
HAZ. NO.	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
1100 1100 1100

FHR-8-230 June 1978

1 SITE ID NO

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 202402 Classification
BT & A (Truss)

6 0 3 0

3 PRIORITY

4 DANGER OF DEMOLITION?
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN
inundation by reservoir

5 DATE

ca. 1917

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER/ADMIN

GA DOT/SC DOT

8 NAME(S) OF STRUCTURE

Smith-McGee Bridge
(GA Route 181)

9 OWNER'S ADDRESS

GA DOT
Atlanta, GASC DOT
Columbia SC10 STATE
COUNTY

GA

COUNTY NAME

Elbert

CITY/VICINITY

Elberton

CONG

DIST

STATE

SC

COUNTY NAME

Anderson

CITY/VICINITY

Abbeville

CONG

DIST

11 SITE ADDRESS (STREET & NO.)

Beginning at the intersection of Ga. State Hwy. 181 and Ga.
State Hwy. 77 (Spur), proceed east on State Hwy. 181 0.8
miles to the Bridge. Structure is located over Savannah Rr.

12 EXISTING SURVEYS

☐ NR☐ NHL☐ HABS☐ HAER-I☐ HAER☐ NPS☐ CL6☐ CONF☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES (DESCRIBE BELOW)

☐ INTERIOR INTACT☐ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:62.5

QUAD

NAME

☐ OTHER

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:62.5

QUAD

NAME

☐ OTHER

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☐ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

JLH, EJH, DCJ

AFFILIATION

DATE

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS

MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC Structure is a three span, pin-connected Camelback through truss bridge with approach ramps. Fabricated out of steel, the trusses are 178 feet long and composed of eyebar tension members and laced channel compression members. They are supported on reinforced concrete piers founded on bedrock. The approach ramps have 73 foot spans. The bridge is a well preserved example of a Camelback Truss that remains relatively unaltered. It exhibits, in almost classic form, the "American System" of pin connections made popular in the late 19th and early 20th centuries.

18 ORIGINAL USE

Bridge

PRESENT USE

Bridge

ADAPTIVE USE

Bridge

(CONT OVER)

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Elberton Star, February 25, 1927.

"A Guide to Identifying and Dating Trusses" T. Allan Comp and Donald C. Jackson, AASLH Technical Leaflet No. 95, May, 1977

(CONT OVER)

20 URBAN AREA 50 000

POP OR MORE?

☐ YES ☒ NO

21 NCAS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☒ YES UNLIMITED☐ NO☐ UNKNOWN

23 EDITOR


INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

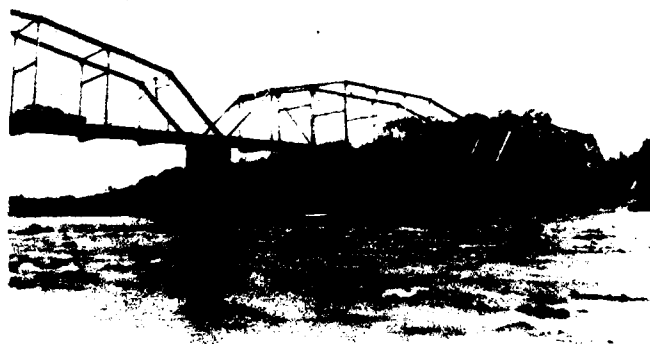

REFERENCES (CONTINUED)

[illegible]

INT 4575-7E

SOUTH CAROLINA

OAHF INVENTORY



Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 2 0 1		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Residence		5 DATE		6 GOVT SOURCE OF THREAT		Corps of Engineers (Demolition)	
8 NAME(S) OF STRUCTURE		Residence		7 OWNER/ADMIN		United States of America		9 OWNER'S ADDRESS	
10 STATE		S C		COUNTY NAME		Abbeville		CITY VICINITY	
COUNTY		Abbeville		vic.		Calhoun Falls		CONG DIST	
11 SITE ADDRESS, STREET & NO.		Beginning at the intersection of South Carolina State Highways 72 and 81, proceed south on S.C. 81 2.1 miles to an unpaved road, then west 200 feet to an unpaved road, then southwest 15 miles to the (con't reverse)		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6		13 SPECIAL FEATURES (DESCRIBE BELOW)	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
3 7		3 5 2 8 5 0 3 7		6 9 6 5 0				1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/>	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		82 <input type="checkbox"/> DESTROYED		85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.								May 1, 1979	

One-story, balloon-frame dwelling with porch addition, 32' (three bays) x 24' (one bay). Gable roof covered with asphalt shingles, open eaves; board and batten siding, windows of no lights with board shutters; foundations of fieldstone granite piers. Plan is two rooms wide divided by central chimney, one room deep. Chimney of brick laid on fieldstone granite foundation; interior never finished. No other structures associated with this site remain. The advanced vandalism and deterioration of this structure has eliminated much of the original fabric and integrity, which would hamper any preservation of the structure.

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE		(CONT OVER)	
Residence		Abandoned					
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER							
Unknown							
20 URBAN AREA 50,000 POP OR MORE?		21 NCAS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR INDEXER	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO				<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN			
24 LOCATED IN AN HISTORIC DISTRICT?		NAME		DISTRICT ID NO			
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO							

25 PHOTOS AND SKETCH MAP OF LOCATION

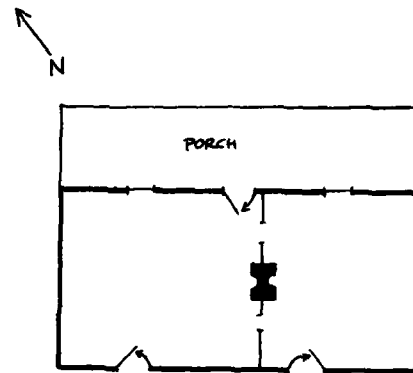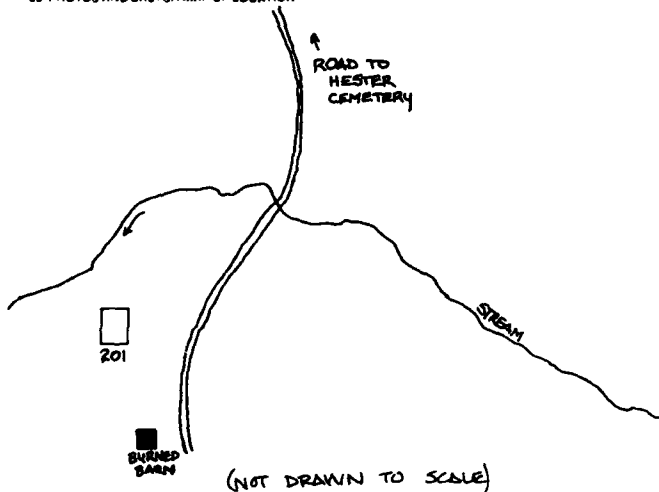

Significance

This structure is a typical example of a tenant farmer or homestead dwelling of the late nineteenth and early twentieth century, and may be seen throughout the project area and the Southeastern United States. The significance of this structure as an example has been greatly lessened because of the extreme deterioration of the original fabric.

REFERENCES (CONTINUED)

11. Site address (street & no) (Continued)

Hester Cemetery, then continue southwest on an unpaved road .5 miles to the site.

[illegible]

INT 4575-78

25 PHOTOS AND SKETCH MAP OF LOCATION ABZ01




Significance

REFERENCES (CONTINUED)

[illegible]

INT 4575-78

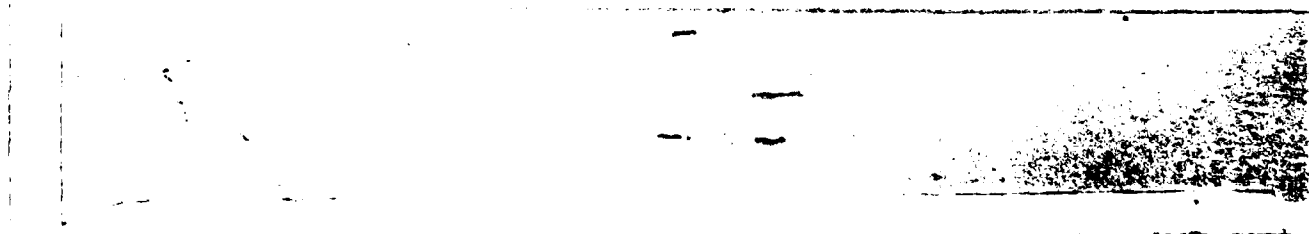

FHR-8-230 June 1978

1 SITE ID NO

A B 2 0 1

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Residence - Continuation

3 PRIORITY

4 DANGER OF DEMOLITION?
(SPECIFY THREAT)☐ YES ☐ NO ☐ UNKNOWN

5 DATE

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER ADMIN

8 NAME S OF STRUCTURE

9 OWNER S ADDRESS

10 STATE
COUNTY

COUNTY NAME

CITY VICINITY

CONG
DISTSTATE
COUNTY

COUNTY NAME

CITY VICINITY

CONG
DIST

11 SITE ADDRESS, STREET & NO.

12 EXISTING
SURVEYS☐ NR☐ NHL☐ HABS☐ HAER-1☐ HAER☐ NPS☐ CL6☐ CONF☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES (DESCRIBE BELOW)

☐ INTERIOR INTACT☐ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:62.5

QUAD

NAME

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:62.5

QUAD

NAME

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☐ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

AFFILIATION

DATE

17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS,
MATERIALS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.

(CONT OVER)

18 ORIGINAL USE

PRESENT USE

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE?☐ YES ☐ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☐ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☐ NO

NAME

DISTRICT I.D. NO.

230 June 1978

SITE ID NO

A B 2 0 4 E

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

Classification

Residence

3 PRIORITY

4 DANGER OF DEMOLITION?
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

5 DATE

CA. 1880

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER/ADMIN

United States of America

9 OWNER'S ADDRESS

% Richard B. Russell Project

P. O. Box 1050

Elberton, GA 30635

1 NAME OF STRUCTURE

Residence

STATE

S C

COUNTY NAME

Abbeville

CITY VICINITY

Calhoun Falls

CONG

DIST

0 9

STATE

G A

COUNTY NAME

Elbert

CITY VICINITY

Elberton

CONG

DIST

1 0

15 SITE ADDRESS (STREET & NO.)

Beginning at the intersection of South
Carolina State Highway 72 and State Highway 81 in the city
of Calhoun Falls, South Carolina, proceed southeast on South
Carolina 81 2.7 miles to an unpaved drive. (Con't Reverse)

12 EXISTING

SURVEYS

☐ NR☐ NHL☐ HABS☐ HAER-1☐ HAER☐ NPS☐ CL☐ CONG☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES DESCRIBE BELOW

☒ INTERIOR INTACT☐ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☒ 1:24☐ 1:62.5☐ OTHER

QUAD

NAME

Calhoun Falls, SC - GA

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:62.5☐ OTHER

QUAD

NAME

16 CONDITION

☐ EXCELLENT☐ GOOD☒ FAIR☐ DETERIORATED

17 RUINS

☐ UNEXPOSED☒ ALTERED☐ DESTROYED☐ DEMOLISHED

18 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

19 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS,
MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One story, balloon frame dwelling, 30' (two bays) x 31' (two bays). Gable roof covered with sheet metal, open eaves; clapboard and asphalt siding, 6 x 6 sash windows with board shutters. Originally two room central chimney plan, with rear addition two rooms wide, one room deep and front addition of one room. Associated with this structure are two small sheds and an open well, not recorded due to extreme deterioration. These associated structures are not contemporary with this house, and date CA. 1930.

(CONT OVER)

18 ORIGINAL USE

Residence

PRESENT USE

Residence

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE?☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

This site is a poorly preserved example of a small rural homestead dating from the period 1880-1890. The structure's significance has been undermined by the deterioration of its original fabric due to neglect, and is further diminished by the numerous examples of similar buildings throughout the project area and the Southeastern United States.

then southwest .1 mile to the site.

[illegible]

INT 4575-78

HR-8-730 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		A B 1 0 0 2		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Barn		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1870					
7 NAME(S) OF STRUCTURE		Barn		9 OWNER'S ADDRESS		P. O. Box 246		Williamston, South Carolina 29697	
10 STATE		SC		COUNTY NAME		Abbeville		VICINITY	
COUNTY						Calhoun Falls		CONG DIST	
						0 9			
11 SITE ADDRESS STREET & NO.		Beginning at the intersection of South		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6			
		Carolina State Highways 72 and 81 in the City of Calhoun				<input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER			
		Falls, S.C., proceed north on SC 81 2.9 miles to Abbeville							
		County Road 901, then generally west and south through							
13 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 5 2 6 6 5		3 7 7 7 2 8 5				1:24 1:62.5	
								OTHER	
								QUAD NAME	
								Latimer, S.C.	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input checked="" type="checkbox"/> DETERIORATED	
								74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS; EXTANT EQUIPMENT AND IMPORTANT BUILDERS/ENGINEERS, ETC.									

One-story, log barn with frame additions on both ends, 35'8" X 16'6". Gable roof previously covered with sheet metal (rough sawn boards rafters remain); V-notched logs hewn on two sides, additions covered with board and batten siding; foundations of fieldstone granite piers. Original log section has collapsed loft and board floor, dirt floors in additions. The absence of a roof is causing increasing decay of the logs, diminishing the potential for preservation of this site. This structure was associated with a small house and another log barn, now demolished.

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE		(CONT OVER)	
Barn		Abandoned					
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER							
Unknown							

20 URBAN AREA 50,000 POP OR MORE?		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO				<input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO	

25 PHOTOS AND SKETCH MAP OF LOCATION

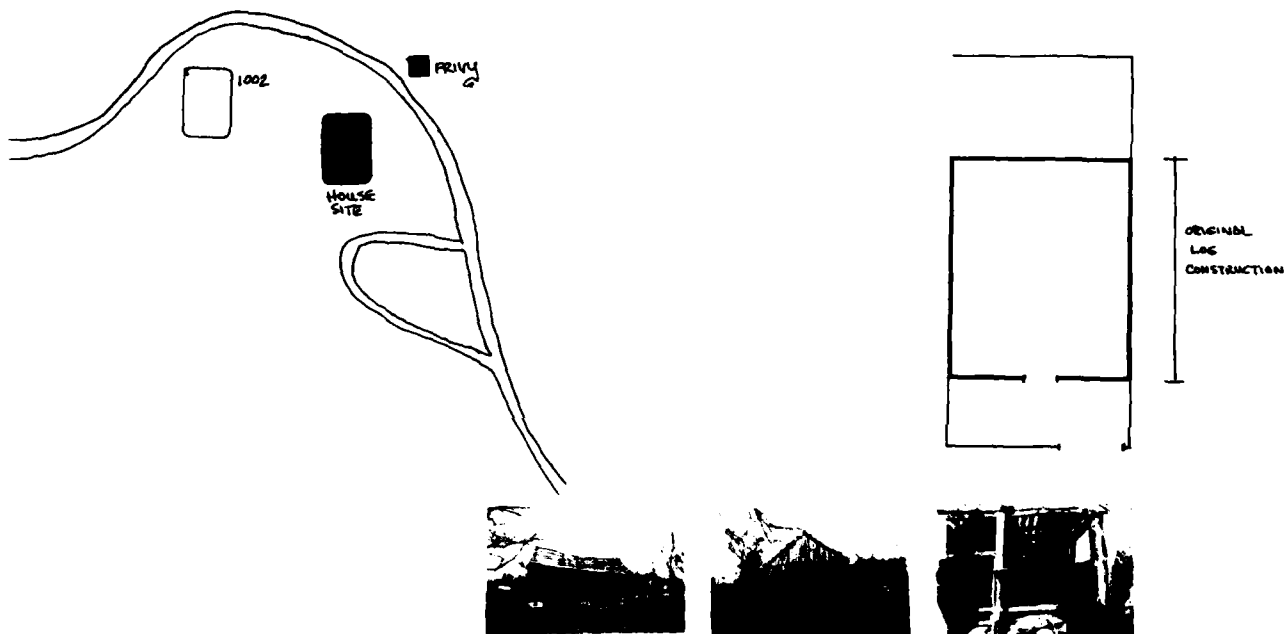

Significance

This barn is one of the comparatively few examples of traditional log construction surviving in Abbeville County. The use of V-notch joinery indicates a later date than the earliest period of log construction in this area (CA. 1800-1830). The structure exemplifies the survival of log construction during the nineteenth century and the use of frame additions to adapt small log buildings to changing needs. The structure continues to deteriorate, but the significant features of log construction remain intact.

References

11. (continued)
the Salem Cemetery on Co. 901 .4 mile to the site.

ABSTRACT																			
MACTNO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								


INT 4575-78
110 00 000000 0000

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 0 0 6 - A		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		XX YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Residence		5 DATE		6 GOVT SOURCE OF THREAT		Corps of Engineers (Demolition)	
8 NAME(S) OF STRUCTURE		Residence		9 OWNER'S ADDRESS		Box 3089 Greenville, SC 29602		7 OWNER ADMIN	
10 STATE		SC		COUNTY NAME		Abbeville		CITY VICINITY	
10 COUNTY		Abbeville		CITY VICINITY		Calhoun Falls		CONG DIST	
11 SITE ADDRESS (STREET & NO.)		Beginning at the intersection of South		12 EXISTING SURVEYS		NR <input type="checkbox"/> NML <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS <input type="checkbox"/>		13 SPECIAL FEATURE: DESCRIBE BELOW	
Carolina State Highways 72 and 81 in the City of Calhoun		Falls, S.C., proceed north on SC 81 2.9 miles to Abbeville		COUNTY		Greenville		CITY VICINITY	
County Road 901, then turn west and (Con't Reverse)				Greenville		Greenville		CONG DIST	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
17		3 5 2 4 3 5 3 7 7 7 9 5 0						1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/>	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/>	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS				18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC				Residence		Abandoned			
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER				20 URBAN AREA 50,000 POP OR MORE?		21 NCRS Region		22 PUBLIC ACCESSIBILITY	
Unknown				YES <input type="checkbox"/> NO <input type="checkbox"/>				YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
24 LOCATED IN AN HISTORIC DISTRICT?		YES <input type="checkbox"/> NO <input type="checkbox"/>		NAME		DISTRICT ID NO		23 EDITOR INDEXER	

(CONT OVER)

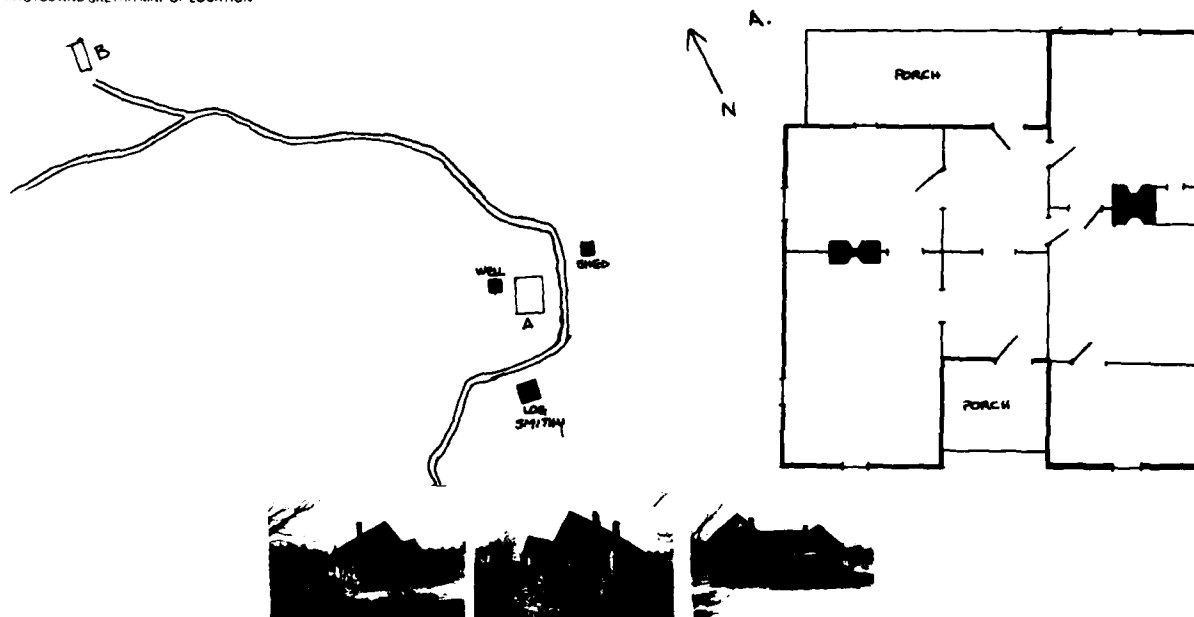

17. Continued. removal of structural material). The standing outbuildings are not original, but date CA. 1940.

Significance

Significance
This structure is an interesting example of a house for a small farm in the project area. Although the plan of this house is unique in the project area, similar structures may be seen throughout the southeastern United States.

~~XXXXXXXXXXXX~~ 11. Site Address (Street & No) (Continued)

north on Co. 901 .6 miles to the site.

[illegible]

INT 4575-78

FHR-8-230 June 1978

1 SITE ID NO

A B I 0 0 6 - B

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Residence

3 PRIORITY

5 DATE
CA. 19004 DANGER OF DEMOLITION
SPECIFY THREAT☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

8 NAME OF STRUCTURE

Residence

7 OWNER-ADMIN

Bigelow - Sanford Carpet Co., Inc.

9 OWNER'S ADDRESS

Box 3089
Greenville, SC 2960210 STATE
COUNTY

S C

COUNTY NAME

Abbeville

CITY VICINITY

Calhoun Falls

CONG
DIST

0 9

STATE
COUNTY

S C

COUNTY NAME

Greenville

CITY VICINITY

Greenville

CONG
DIST

11 SITE ADDRESS, STREET & NO.

Beginning at the intersection of South
Carolina State Highways 72 and 81 in the City of Calhoun
Falls, S.C., proceed north on SC81 2.9 miles to the inter-
section with Abbeville County Road 901. (Con't Reverse)12 EXISTING
SURVEYS☐ NPL☐ NML☐ HABS☐ HAER - 1☐ HAER☐ NPS☐ CL6☐ CONF☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES, DESCRIBE BELOW

☒ INTERIOR INTACT☒ EXTERIOR INTACT☒ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

☐ OTHERQUAD
NAME

Latimer, SC

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

☐ OTHERQUAD
NAME

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☒ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS)

MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One story balloon frame dwelling, 25' (two bays) x 20' (two bays). Gable roof covered with asphalt shingles, open eaves; clapboard siding, 6 x 6 sash windows; foundations of brick piers. Plan is two rooms wide with two front doors, one room deep, with a three room addition across the length of the back. One suspended brick chimney. This structure has been badly vandalized, allowing natural deterioration to rapidly advance. The preservation of this structure as a result will be extremely difficult.

(CONT OVER)

18 ORIGINAL USE

Residence

PRESENT USE

Residence

ADAPTIVE USE

May 1, 1979

19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE? ☐ YES ☒ NO

21 NCAS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

XXXXXXXXXXXXXXXXXXXX 11. Site Address (Street & No) (Continued)

then west and north on Co. 901 .7 miles to the site.

[illegible]

INT 4575-71

FHR-8-730 June 1978

1 SITE ID NO

A B 1 1 0 1 - 1 A

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Barn

3 PRIORITY

4 DANGER OF DEMOLITION
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

5 DATE
CA. 1880

6 GOVT SOURCE OF THREAT

OWNER ADMIN

8 NAME OF STRUCTURE

Barn

7 OWNER ADMIN
B. B. Hutchison

9 OWNER'S ADDRESS

Route 1
Iva, SC 2965510 STATE
COUNTY

S C

COUNTY NAME

Abbeville

CITY VICINITY

Lowndesville

CONG

DIST

0 9

STATE
COUNTY

S C

COUNTY NAME

Abbeville

CITY VICINITY

Abbeville

CONG

DIST

0 9

11 SITE ADDRESS (STREET & NO.)
Beginning at the intersection of South
Carolina State Highway 81 and Abbeville County Road 64,
proceed on Co. 64 2.1 miles to an unpaved private road,
then southwest on the private road .9 miles to the site.12 EXISTING
SURVEYS☐ NHR☐ NHL☐ HABS☐ HAER - I☐ HAER☐ NPS☐ CLG☐ CONE☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES: DESCRIBE BELOW:

☒ INTERIOR INTACT☐ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

3 4 9 3 2 5

NORTHING

3 7 8 3 4 0 0

SIGN

SCALE

☒ 1:24☐ 1:62.5☐ OTHER

QUAD NAME

Lowndesville, SC - GA

UTM ZONE

EASTING

3 4 9 3 2 5

NORTHING

3 7 8 3 4 0 0

SIGN

SCALE

☐ 1:24☐ 1:62.5☐ OTHER

QUAD NAME

Lowndesville, SC - GA

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☐ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED77 ☐ DESTROYED78 ☐ DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS,
MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.

Two story log barn with post and frame addition to one side, 20' x 22' 6". Gable roof covered with sheet-metal with overhang on one side; clapboards on gable ends, V - notch log joinery, door openings framed with boards pegged into log ends; foundations of fieldstone granite piers. This structure is associated with a collapsed dwelling, and with the B. B. Hutchinson farm complex (not recorded). The significant deterioration of logs may soon result in the collapse of the structure and prevent its preservation.

(CONT OVER)

18 ORIGINAL USE

Barn

PRESENT USE

Barn

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE? ☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?


☐ YES☒ NO

NAME

DISTRICT ID NO

May 1, 1979

25 PHOTOS AND SKETCH MAP OF LOCATION

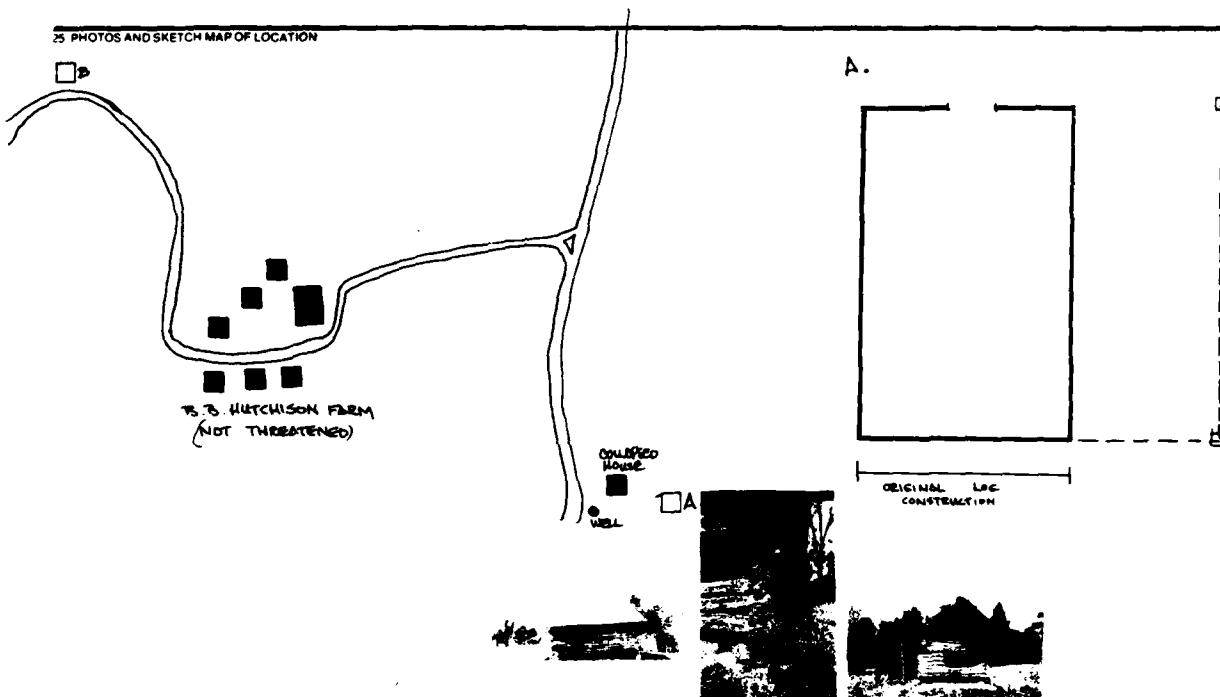

Significance This structure was recorded due to its unknown status within the project area. Except for this site and site AB1101-1B, the B. B. Hutchison farm complex is not threatened by the Richard B. Russell Project, and was therefore not recorded. This structure is an excellent example of the survival of log construction in this area during the nineteenth century. The use of V - notch joinery indicates a late nineteenth century date. The small size, two story height of the structure and its overhanging roof are unusual architectural features in the project area. The barn is well preserved, but is deteriorating rapidly and threatened with collapse.

REFERENCES (CONTINUED)

ABSTRACT																			
HIST. NO.	LC	TECH. REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRAWG.	HIST. DRAWG.	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
1111 111111 1111

1 SITE ID NO

A B 1 1 0 1 - 1 B

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 202402 Classification
Residence

3 PRIORITY

4 DANGER OF DEMOLITION
SPECIFY THREAT.☐ YES ☒ NO ☐ UNKNOWN

5 DATE

CA. 1880

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER ADMIN

B. B. Hutchison

8 NAME OF STRUCTURE

Residence

9 OWNER'S ADDRESS

Route 1
Iva, South Carolina 29655

10 STATE

S C

COUNTY NAME

Abbeville

VICINITY

Lowndesville

CONG

DIST

0 9

STATE

S C

COUNTY NAME

Abbeville

VICINITY

Lowndesville

CONG

DIST

0 9

11 SITE ADDRESS STREET & NO.

Beginning at the intersection of South Carolina State
Highway 81 and Abbeville County Road 64, proceed on Co.
64 2.1 miles to an unpaved private road, then southwest

12 EXISTING

SURVEYS

☐ NR☐ NHL☐ HABS☐ HAER☐ HAER☐ NPS☐ CLF☐ FONS☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES DESCRIBE BELOW.

☒ INTERIOR INTACT☒ EXTERIOR INTACT☒ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

☐ OTHER

QUAD

NAME Lowndesville, SC. - GA.

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

☐ OTHER

QUAD

NAME

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☐ FAIR73 ☒ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

John L. Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S) HISTORICAL DATE(S) PHYSICAL DIMENSIONS
MATERIALS EXANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

One story, balloon frame dwelling, 24' (one bay) X 15' (one bay). Gable roof covered with wooden shingles; vertical board and batten siding, windows of no lights with board shutters; foundations of fieldstone granite piers. Plan is two rooms wide and one room deep, one exterior chimney laid in fieldstone granite to ceiling level, narrowing to brick chimney head, one suspended brick chimney. The site is associated with the B. B. Hutchison farm complex as a tenant or hired man's house. The integrity of the structure is diminished by extreme deterioration, which would hamper preservation of the site.

(CONT OVER)

18 ORIGINAL USE
Residence

PRESENT USE

Abandoned

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE? ☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☒ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO



**COLLAPSED
TUMOR LINK**

☐ 人

This structure was recorded due to its unknown status within the project area. Except for this site and site AB-1101-1-A, the B. B. Hutchison farm complex is not threatened by the Richard B. Russell Project, and was, therefore, not recorded. The building is a typical example of a tenant farmer or hired man's dwelling within the project area and the Southeastern United States, unusual in the project area for its definite association with a farm complex. The method of chimney construction, with the main stack laid of fieldstone granite narrowing to a brick chimney head, is unique within the project area among standing structures.

on the private road 0.6 mile to a private drive, then south 0.2 mile on the private drive to the site.

[illegible]

INT 4575-78


OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 1 1 0 - A		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
7 Classification Residence				5 DATE CA. 1890		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Residence						7 OWNER ADMIN Felkel Farms, Inc.			
9 OWNER'S ADDRESS 816 Burwell Lane Columbia, South Carolina									
10 STATE S C		COUNTY NAME Abbeville		CITY VICINITY Lowndesville		CONG DIST 0 9		STATE S C	
COUNTY								COUNTY NAME Richland	
CITY VICINITY Columbia								CONG DIST	
11 SITE ADDRESS STREET & NO. Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed south on Abbeville County Road									
12 EXISTING SURVEYS									
13 SPECIAL FEATURES DESCRIBE BELOW									
14 UTM ZONE EASTING NORTHING SIGN SCALE									
15 QUAD NAME									
16 INVENTORIED BY John L. Hopkins, Emily J. Harris									
AFFILIATION Historic American Buildings Survey									
DATE May 1, 1979									
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC One story balloon frame dwelling with front and rear porches, 24' (four bays) X 26' (two bays). Gable roof covered with asphalt shingles; clapboard siding, central pedimented porch; foundations of fieldstone and quarried granite, bricks and concrete piers. Plan is impossible to reconstruct due to vandalism of interior. Interior walls were partially sheathed, partially covered with gypsum board, poured concrete floors. The structure is extremely deteriorated, making preservation nearly impossible. Associated with this structure are a small barn contemporary to the house and five additional deteriorated outbuildings CA. 1930-1940 (not recorded).									
18 ORIGINAL USE Dwelling									
PRESENT USE Abandoned									
ADAPTIVE USE									
19 REFERENCES - HISTORICAL, REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown									
20 URBAN AREA 50000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO									
21 NCRS Region									
22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN									
23 EDITOR NDE YER									
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO NAME DISTRICT ID NO									

CONT OVER

CONT OVER

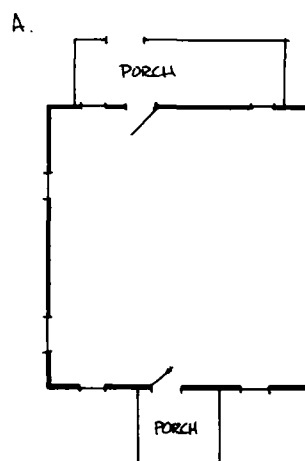

(INTERIOR DEMOLISHED)



This structure is a typical example of a small farm dwelling of the late nineteenth and early twentieth centuries in the project area and throughout the Southeastern United States.

11. (continued) 65 1.7 miles to the intersection with Abbeville County Road 64, then east on Co. 64 1.6 miles to the site.

ABSTRACT																																			
HARD COPY			LC			TECH REPORT			HIST REPORT			CONTEMP PHOTO			HIST PHOTO			CONTEMP DRAWG			HIST DRAWG			COLOR PLATE			PHOTOGRAM			SW			FIL		

INT 4575-7
 100-4575-7

June 1978

EID NO

A B 1 1 1 0 - B

OAHIP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

Classification		1 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT	
111110-B				Corps of Engineers (Demolition)	
5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
CA. 1890				OWNER ADMIN	
				Felkel Farms, Inc.	
7 OWNER ADDRESS		8 OWNER ADDRESS		CITY VICINITY	
		816 Burwell Lane		Columbia, South Carolina	
9 STATE		10 COUNTY		11 CONG DIST	
S C		Richland		Columbia	
12 EXISTING SURVEYS		13 SPECIAL FEATURES DESCRIBE BELOW		14 EXTERIOR INTACT	
NR NH HABS HAER-1 HAER NPS CL6		OTHER STATE COUNTY LOCAL OTHER		EXTERIOR INTACT ENVIRONS INTACT	
15 BEGINNING AT THE INTERSECTION OF SOUTH CAROLINA STATE HIGHWAY 81 AND ABBEVILLE COUNTY ROAD 65 IN THE TOWN OF LOWNDESVILLE, PROCEED SOUTH ON ABBEVILLE COUNTY ROAD 65		16 QUAD NAME		17 QUAD NAME	
1 7 3 4 9 3 1 0 3 7 8 4 8 6 0		Lowndesville, S.C. - GA			
18 CONDITION		19 AFFILIATION		20 DATE	
EXCELLENT GOOD FAIR DETERIORATED RUINS UNEXPOSED ALTERED DESTROYED DEMOLISHED		Historic American Buildings Survey		May 1, 1979	


DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATES, HISTORICAL DATES, PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.

Balloon frame embankment barn with loft and post and frame shed addition, 36' X 20'. Gable roof and shed roof on addition, covered with sheet metal; clapboard siding; foundations of fieldstone granite piers. This structure is contemporary with an associated house and five additional small outbuildings, CA. 1930-1940 (not recorded). This structure is in a poor state of repair, indicating that its preservation would be a difficult undertaking.

ORIGINAL USE	PRESENT USE	ADAPTIVE USE
Barn	Abandoned	
REFERENCES: HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER		
Unknown		

21 URBAN AREA 50,000 POP. OR MORE	22 PUBLIC ACCESSIBILITY	23 EDITOR
YES NO	YES LIMITED YES UNLIMITED NO UNKNOWN	INDEXER
24 LISTED IN AN HISTORIC DISTRICT	NAME	DISTRICT ID NO
YES NO		

25 PHOTOS AND SKETCH MAP OF LOCATION

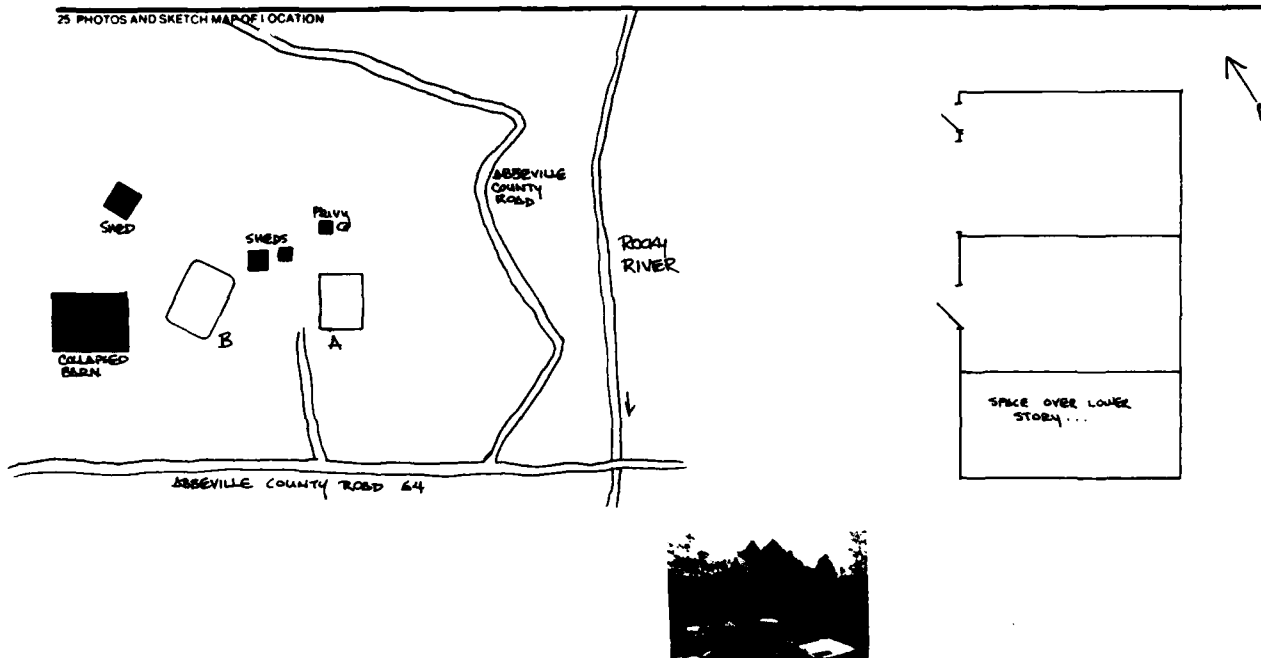

Significance

This is one of three known embankment structures in the project area. It is not known how prevalent such structures are in the surrounding region.

11. (continued) 1.7 miles to the intersection with Abbeville County Road 64, then east on Co. 64 1.6 miles to the site.

ABSTRACT																	
MA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SM	FILM					

INT 4575-78
GPO : 1975 O-300-000



FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 1 1 5 - 2		2 CLASSIFICATION Residence		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT: <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
				5 DATE Ca. 1880		6 GOVT SOURCE OF THREAT OWNER ADMIN		7 OWNER ADMIN U. S. Army Corps of Engineers	
8 NAME(S) OF STRUCTURE Residence		9 OWNER'S ADDRESS c/o Richard B. Russell Real Estate Project Office P. O. Box 1050 Elberton, Georgia 30635		10 STATE COUNTY		10 COUNTY NAME Abbeville		10 VICINITY Lowndesville	
10 STATE COUNTY		10 COUNTY NAME Abbeville		10 VICINITY Lowndesville		10 STATE COUNTY		10 COUNTY NAME Elbert	
11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South Carolina State Highway 81 and South Carolina State Highway 71, proceed south on an unpaved private drive 0.1 mile to the site.		12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLF <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT		14 UTM ZONE EASTING 1 7 3 5 0 1 3 5 3 7 8 6 7 4 0		14 UTM ZONE EASTING 1 7 3 5 0 1 3 5 3 7 8 6 7 4 0	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input checked="" type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED		16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979		17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC One-story, balloon frame house with rear addition, 43' (three bays) X 52' (three bays). Hip roof with two front gables, gable roof on addition, covered with asphalt shingles over wooden shingles, boxed cornice; gable ends covered with shingles with diamond shaped lattice vents, clapboard and weatherboard siding, 9x9 sash windows; cement front porch, collapsed rear porch; foundations of brick and cinderblock piers. Central hall plan, two rooms wide one room deep, with one room addition. Interior brick chimney; interior sheathed throughout. Much siding has been removed from the structure, resulting in increasing deterioration, including the collapse of the floors. Preservation could not be easily accomplished. The structure is associated with a post and frame garage, CA. 1950, and a balloon frame shed, CA. 1940, both quite overgrown. The association of the structure with a house trailer, modern house, and large barn nearby is unknown.	
18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE		19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown		(CONT OVER)	
20 URBAN AREA 5000 POP OR MORE <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER		(CONT OVER)	
24 LOCATED IN AN HISTORIC DISTRICT <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO					

25 PHOTOS AND SKETCH MAP OF LOCATION

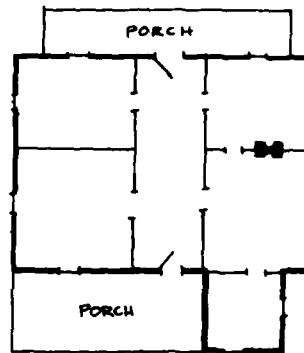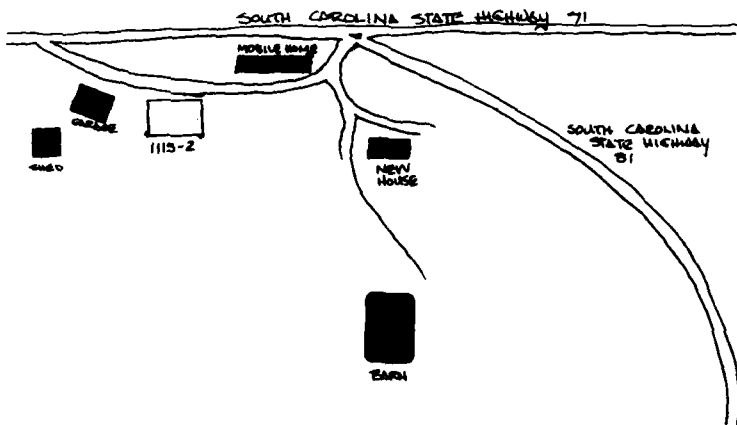

Significance

This structure is typical of late nineteenth and early twentieth century houses in this region, although there are relatively few like it in the project area. Due to the salvage of much original fabric, there appears to be little potential for preservation.

REFERENCES (CONTINUED)

ABSTRACT																			
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 1 2 3 - 1													
2 Classification Residence		3 PRIORITY		4 DANGER OF DEMOLITION* (SPECIFY THREAT)		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/> Corps of Engineers (Demolition)									
		5 DATE CA. 1900		6 GOVT SOURCE OF THREAT		OWNER ADMIN									
				7 OWNER ADMIN Am Trask Ltd.											
8 NAME(S) OF STRUCTURE Residence				9 OWNER'S ADDRESS c/o Mr. Neil Trask Lowndesville, South Carolina											
10 STATE S C		COUNTY NAME Abbeville		CITY VICINITY Calhoun Falls		CONG DIST 09		STATE S C		COUNTY NAME Abbeville		CITY VICINITY Lowndesville		CONG DIST 09	
11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South Carolina Highways 72 and 81 in the City of Calhoun Falls, S.C., proceed north on SC 81 6.2 miles to an unpaved road, Abbeville		12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES (DESCRIBE BELOW) <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT											
14 UTM ZONE 17		EASTING 351780		NORTHING 3782540		SIGN		SCALE 1:24		QUAD NAME Latimer, S.C.					
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input checked="" type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED															
16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979											
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS EX-TANT, EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC. One story, balloon-frame dwelling, 22'3" (one bay) X 16'4" (one bay). Gable roof covered with sheet metal; clapboard siding, windows of no lights previously covered with board shutters; foundations of fieldstone granite piers. Plan is one room, no chimney, hole in end wall for stove flue. The structure has been subject to salvage (not evident in photographs) and the main structural members are deteriorating rapidly.															
(CONT OVER)															
18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE											
19 REFERENCES--HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown															
(CONT OVER)															
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO											

25 PHOTOS AND SKETCH MAP OF LOCATION

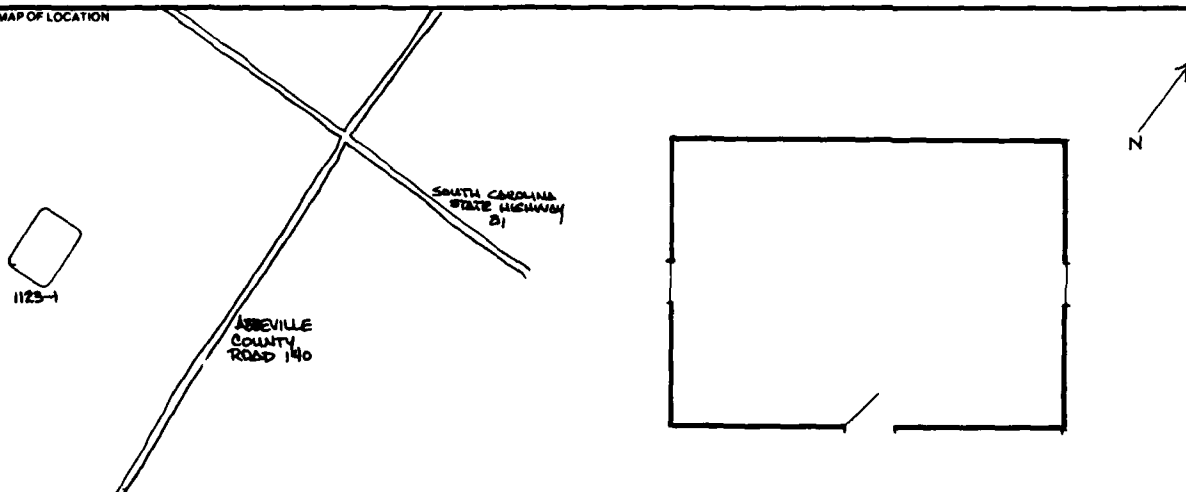

Significance

This is the only one-room cabin in the project area, and probably served as a hired man's house. Increasing decay of the structural members and ongoing salvage are likely to result in the collapse of this building.

11. (continued) County Road 140, then west on Co. 140 .1 mile to the site.

ABSTRACT																			
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
STUDY 4575-78

FHR-8-230 June 1978

OAHF INVENTORY


Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										A B 1 1 2 3 - 2									
2 Classification Residence										3 PRIORITY									
4 DANGER OF DEMOLITION SPECIFY THREAT										5 DATE CA. 1850									
6 GOVT SOURCE OF THREAT										7 OWNER ADMIN Am Trask Ltd.									
8 NAME(S) OF STRUCTURE Residence										9 OWNER'S ADDRESS c/o Mr. Neil Trask Lowndesville, South Carolina									
10 STATE S C										11 COUNTY NAME Abbeville									
12 VICINITY Lowndesville										13 LONG DIST 0 9									
14 SITE ADDRESS STREET & NO Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of										15 EXISTING SURVEYS 16 SPECIAL FEATURES 17 INTERIOR INTACT 18 EXTERIOR INTACT 19 ENVIRONS INTACT									
20 UTM ZONE 1 7										21 EASTING 3 4 9 0 0 0									
22 NORTHING 3 7 8 2 1 7 0										23 SIGN 0 9									
24 UTM ZONE										25 EASTING									
26 NORTHING										27 SIGN									
28 CONDITION 70 EXCELLENT 71 GOOD 72 FAIR 73 DETERIORATED 74 RUINS 75 UNEXPOSED 76 ALTERED 77 DESTROYED 78 DEMOLISHED										29 INVENTORIED BY John L. Hopkins, Emily J. Harris									
30 AFFILIATION Historic American Buildings Survey										31 DATE May 1, 1979									
32 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S) HISTORICAL DATE(S) PHYSICAL DIMENSIONS MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC Two-story, sawn frame dwelling with balloon frame additions (CA. 1930-1940), 63' (seven bays) X 45' (three bays). Gable roof, shed roofs on additions, covered with asphalt shingles; asbestos siding, exterior brick chimneys laid in common bond, 9x9 sash windows; two-story front porch (CA. 1870), with four columns; foundations of cement blocks, previously brick piers. Original plan two rooms with central hall stair, porch additions on front and sides, shed addition of four rooms across rear. Interior finish of lath and plaster, original chair rails, dado paneling, and mantels in place. This structure is on the verge of collapse due to extreme deterioration, making preservation or restoration nearly impossible. The structure is associated with a garage and privy (CA. 1930-1940), both extremely deteriorated and overgrown.																			
33 ORIGINAL USE Residence										34 PRESENT USE Abandoned									
35 ADAPTIVE USE										36 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown									
37 URBAN AREA 50 000 POP OR MORE? YES NO										38 NCAS Region									
39 PUBLIC ACCESSIBILITY YES LIMITED YES UNLIMITED NO UNKNOWN										40 EDITOR INDEXER									
41 LOCATED IN AN HISTORIC DISTRICT? YES NO										42 DISTRICT ID NO									

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

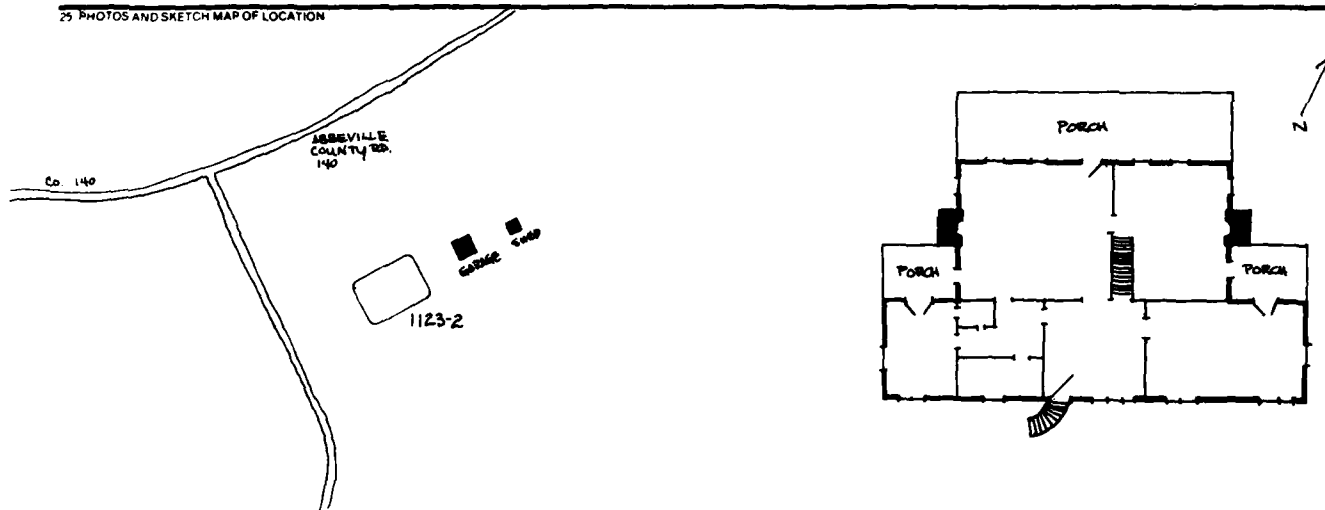

Significance

This structure is one of the few examples of an antebellum plantation house in the project area. It is one of two structures in the project area with lath and plaster walls, and contains rare examples of original interior finish. It is the only house in the project area with a two-story colonnaded porch, a rare feature in this region. Preservation of this building would be extremely difficult due to its advanced deterioration.

11. (continued) Lowndesville, proceed south on Abbeville Co. 65 1.7 miles to the intersection with Abbeville County Road 64, then east on Co. 64 0.6 mile to the intersection with Abbeville County Road 140, then southeast on Co. 140 1.6 miles to the site.

ABSTRACT											
HA	NO	LC	TECH	REPOR	HIST	REPORT	CONTEMP	PHOTO	HIST	PHOTO	CONTEMP
DRWG	HIST	DRWG	COLOR	PLATE	PHOTO	GRAM	SW	FILM			

INT 4575-78

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 2 2 0		2 CLASSIFICATION Residence		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
						5 DATE CA. 1880		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Residence								7 OWNER ADMIN Howard M. Smith and Annie Laurie Smith			
								9 OWNER'S ADDRESS 1630 N. Main St. Anderson, South Carolina 29621			
10 STATE S C		COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST 0 9		STATE S C		COUNTY NAME Anderson	
								CITY Anderson		CONG DIST	
11 SITE ADDRESS: STREET & NO Beginning at the intersection of South Carolina State Highway 71 and South Carolina State Highway 81, in the town of Lowndesville, proceed east on South Carolina State								12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURE: DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14 UTM ZONE 1 7		EASTING 3 4 9 8 3 0		NORTHING 3 7 8 7 8 6 0		SIGN		SCALE 1:24		QUAD NAME Lowndesville, S.C. - GA.	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input checked="" type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED		74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED	
								76 <input type="checkbox"/> ALTERED		80 <input type="checkbox"/> DESTROYED	
										85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY John L. Hopkins, Emily J. Harris				AFFILIATION Historic American Buildings Survey				DATE May 1, 1979			
17 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.)											

One-story balloon frame dwelling with rear addition and front porch, 32' (four bays) X 45' (three bays). Gable roofs covered with asphalt shingles, shed roof on addition covered with sheetmetal; asbestos siding over clapboard, addition covered with tar paper; two front doors; foundations of brick piers and cement blocks. L-shaped plan of four rooms with central stuccoed chimney. One-room addition on inside of L. Interior finish of sheathing and gypsum board. Associated with this structure is an open-sided post and frame well house with a sheetmetal gable roof and a small privy shed (not recorded). This structure is well preserved.

18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE		(CONT OVER)	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown							
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

The sketch map on the left shows a property layout. A road runs vertically, labeled "ABBEVILLE COUNTY TO 220". To the left of the road, there is a "WELL" marked with a dot, a "COLLAPSED DAME" marked with a square, and a "PRIVY" marked with a square. A rectangular area is labeled "1220". To the right of the road, there is a large rectangular area labeled "1220".

The floor plan on the right shows a rectangular building with a central hallway. There are four rooms: two on the left and two on the right. A "PORCH" is attached to the right side of the building. A door is shown in the center of the right wall, leading into the right-hand rooms.

This is a typical example of a tenant farmer or homesteaders' dwelling found throughout the project area and the Southeastern United States and is in a good state of preservation.

11. (continued) Highway 71 0.4 mile to the intersection with Abbeville County Road 228, then northeast on Abbeville Co. 228 0.9 mile to the site.

[illegible]

INT 4575-78



OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 2 2 7 - A		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Residence				5 DATE CA. 1830		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Residence						7 OWNER ADMIN Mrs. Gladys Rampey		9 OWNER'S ADDRESS 3911 Third Avenue Birmingham, Alabama 35222	
10 STATE S C		COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST 0 9		STATE A L	
								COUNTY NAME Birmingham	
11 SITE ADDRESS-STREET & NO. Beginning at the intersection of South Carolina State Highway 71 and South Carolina State Highway 81 in the town of Lowndesville, proceed east on Highway 71 0.4 mile						12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLF <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER			
						13 SPECIAL FEATURES-DESCRIBE BELOW <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT			
14 UTM ZONE 1 7		EASTING 3 4 9 6 6 0		NORTHING 3 7 8 6 8 5 0		SIGN		SCALE 1:24 1:124	
								QUAD NAME Lowndesville, S.C. - GA.	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input checked="" type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979					
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS MATERIALS EXANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC									
One and one-half story log dogtrot house with balloon frame additions to front and rear and enclosing dogtrot, 50' (four bays) X 67' (seven bays). Gable roofs covered with asphalt shingles over wooden shingles, boxed cornice; massive logs hewn on four sides with one-half dovetail joinery, frame additions covered with clapboard, collapsed front porch, detached exterior brick chimneys laid in common bond at ends of log section 9 x 6 sash windows; foundations of fieldstone granite piers. Original plan was two rooms with dogtrot, additions create L-shaped central hall plan of six rooms. Interior finish is sheathed throughout, with some original wainscot in place, suspended chimney in rear addition. Due to vandalism and extreme deterioration, this structure is in poor condition. The potential for preservation or restoration appears to be quite limited. The structure is associated with a collapsed frame house and a frame barn (AB1227-B), and a post and frame well house (AB1227-C), both extremely									
18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE					
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown									
20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER			
21 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO					

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

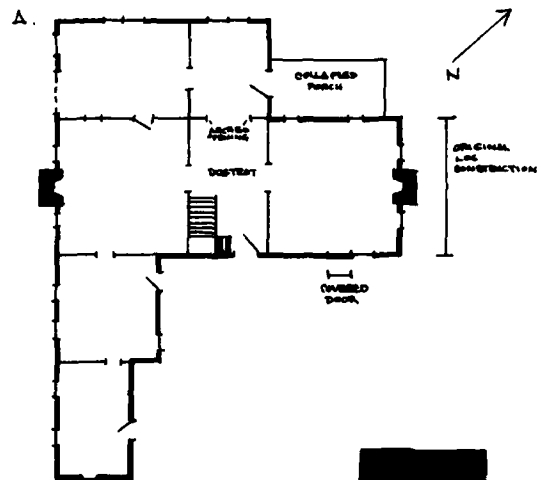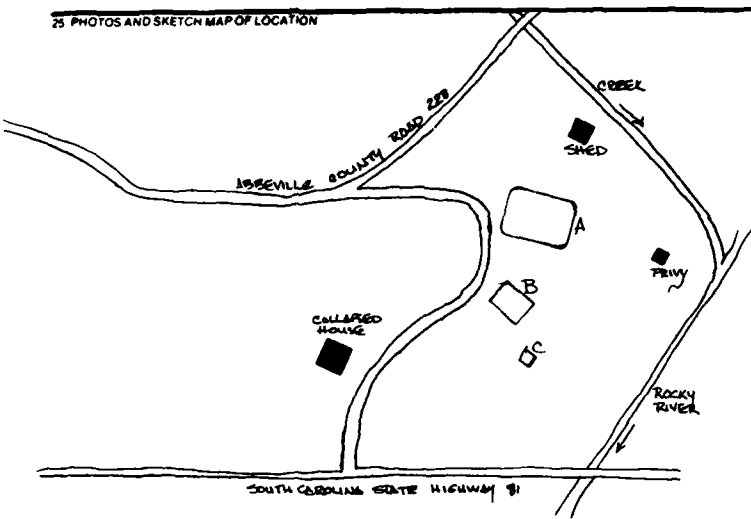

Significance

Although this structure is extremely deteriorated, the interior and exterior finish that remain intact reveal both important construction techniques and changes made over time. The building is an excellent example of early log construction, displaying superb one-half dovetail joinery of massive hewn logs. The frame additions and enclosed dogtrot exemplify the adaptation of an early structure to later styles and needs for expansion. Although this structure is outside the acquisition area, it has been included in this inventory because of its historic merit and proximity to the acquisition line.

Notes

11. (continued) to the intersection with Abbeville County Road 228, then northeast on Co. 228 0.4 mile to an unpaved private drive then southeast 0.1 mile on the private drive to the site.
17. (continued) deteriorated and overgrown.

ABSTRACT																			
HAZ	NO	LC	TECH	REPOR	HIST	REPOR	CONTEMP	PHOTO	HIST	PHOTO	CONTEMP	DRWG	HIST	DRWG	COLOR	PLATE	PHOTO	GRAM	SW

INT 4575-78
1100 000000 0000

FHR-8-230 June 1978

OAHMP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 2 2 7 - B																	
2 Classification Barn		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)															
		5 DATE CA. 1875-1885		6 GOVT SOURCE OF THREAT OWNER <input type="checkbox"/> ADMIN <input type="checkbox"/>															
8 NAME(S) OF STRUCTURE Barn		7 OWNER ADMIN Mrs. Gladys Rampey		9 OWNER'S ADDRESS 3911 Third Avenue Birmingham, Alabama 35222															
10 STATE COUNTY		SC		COUNTY NAME Abbeville		20 VICINITY Lowndesville		CONG DIST 09		STATE COUNTY		AL		COUNTY NAME Birmingham		CONG DIST			
11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South Carolina State Highway 71 and South Carolina State Highway 81 in the town of Lowndesville, proceed east on State Highway 71 0.4 mile to the intersection with										12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NML <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLB <input type="checkbox"/> FINE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER									
13 SPECIAL FEATURES (DESCRIBE BELOW) <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT																			
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE		QUAD NAME		Lowndesville, S.C. - GA.							
1 7		3 4 9 6 8 0		3 7 8 6 8 3 0				OTHER											
UTM ZONE		EASTING		NORTHING		SIGN		SCALE		QUAD NAME									
								OTHER											
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED		74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		82 <input type="checkbox"/> DESTROYED		85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY John L. Hopkins, Emily J. Harris										AFFILIATION Historic American Buildings Survey		DATE May 1, 1979							
17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC. Two-story hewn and balloon frame barn, 44' x 24'. Gable and shed roofs, covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. This barn is deteriorated and overgrown. It is associated with a log and frame house (AB1227-A), a collapsed frame house, and a well house (AB1227-C).																			

(CONT OVER)

18 ORIGINAL USE Barn		PRESENT USE Abandoned		ADAPTIVE USE	
19 REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 MCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

ABBEVILLE COUNTY RD 227

CRICK

SHED

A

B


C

COLLAPSED HOUSE

PANTRY

ROCKY RIVER

SOUTH CAROLINA STATE HIGHWAY 81

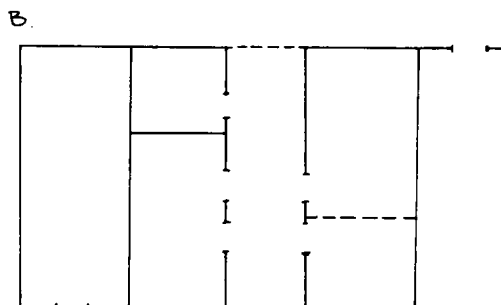

This structure is a good example of a post Civil War cattle or horse barn. The hewn frame members of the structure were probably incorporated from an earlier structure. This barn appears to have been associated with a later frame house, CA. 1875-1885, now collapsed. Although this structure is outside the acquisition area, it has been included in this inventory because of its relationship to Site AB1227-A.

11. (continued) Abbeville County Road 228, then northeast on Co. 228 0.4 mile to an unpaved private drive, then southeast 0.1 mile on the private drive to the site.

[illegible]

INT 4575-78

18-730 June 1978

OAHF INVENTORY


Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 2 2 7 - C											
2 Classification Well House		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)									
		5 DATE CA. 1875-1885		6 GOVT SOURCE OF THREAT OWNER ADMIN Mrs. Gladys Rampey									
7 NAME OF STRUCTURE Well House		8 OWNER'S ADDRESS 3911 Third Avenue Birmingham, Alabama 35222											
9 STATE SC		10 COUNTY NAME Abbeville		11 VICINITY Lowndesville		12 LONG DIST 09		13 STATE AL		14 COUNTY NAME Birmingham		15 CONG DIST	
16 SITE ADDRESS, STREET AND NO Beginning at the intersection of South Carolina State Highway 71 and South Carolina State Highway 81 in the town of Lowndesville, proceed east on State Highway 71 0.4 mile to the intersection with Abbeville		17 EXISTING SURVEYS <input type="checkbox"/> NPS <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CIA <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER											
18 UTM ZONE 17		19 EASTING 349700		20 NORTHING 3786820		21 SIGN		22 SCALE 1:4		23 QUAD NAME Lowndesville, S.C. - GA.		24 OTHER	
25 UTM ZONE		26 EASTING		27 NORTHING		28 QUAD		29 SCALE		30 QUAD NAME		31 OTHER	
32 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input checked="" type="checkbox"/> DETERIORATED		33 AFFILIATION Historic American Buildings Survey		34 DATE May 1, 1979		35 <input type="checkbox"/> RUINS 36 <input type="checkbox"/> UNEXPOSED 37 <input type="checkbox"/> ALTERED 38 <input type="checkbox"/> DESTROYED 39 <input type="checkbox"/> DEMOLISHED							
40 INVENTORIED BY John L. Hopkins, Emily J. Harris													
41 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC. Opensided post and frame well house, 10' x 10'. Gable roof covered with wooden shingles; apron of weatherboard; hewn posts. Wooden well cover and well crank in place. The structure is quite deteriorated and overgrown. It is associated with a log and frame house (AB1227-A), a collapsed frame house, and a frame barn (AB1227-B).													
42 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER Unknown													
43 ORIGINAL USE Well House		44 PRESENT USE Abandoned		45 ADAPTIVE USE									
46 URBAN AREA 50,000 POP OR MORE <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO													
47 LOCATED IN AN HISTORIC DISTRICT <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		48 NAME		49 DISTRICT I.D. NO.		50 EDITOR		51 INDEXER					

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

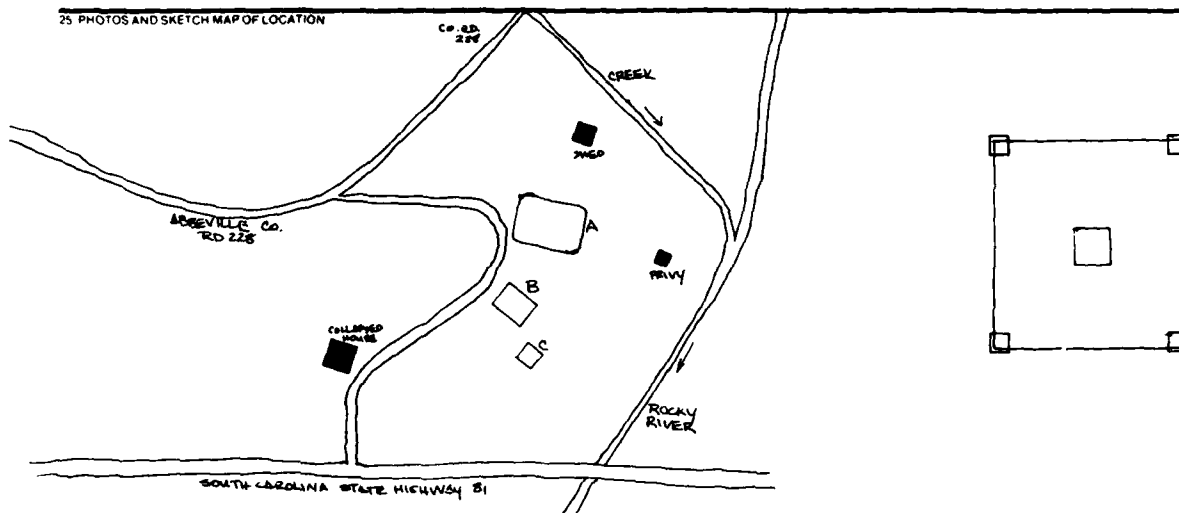

Significance

This structure is unusual in the use of hewn posts. It is likely that these posts were incorporated from an earlier structure, and that this well house was contemporary to a later frame house, CA. 1875-1885, now collapsed. Although this structure is outside the acquisition area, it has been included in this inventory because of its relationship to site AB1227-A.

11. (continued) County Road 228, then northeast on Co. 228 0.4 mile to an unpaved private drive, then southeast 0.1 mile on the private drive to the site.

ABSTRACT																			
HA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRAWG	HIST DRAWG	COLOR PLATE	PHOTOGRAPH	SW	FILM							

INT 4575-78
1125 000000 0000

FHR-8-230 June 1978

1 SITE ID NO

A B 1 3 0 0 - A

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240Classification
Barn

3 PRIORITY

4 DANGER OF DEMOLITION
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN
Corps of Engineers (Demolition)5 DATE
CA. 1880-
1890

6 GOVT SOURCE OF THREAT

OWNER ADMIN

7 OWNER ADMIN
Alan B. Sibley, Jr. and Winston H. Sibley, Jr.

8 NAME OF STRUCTURE

Barn

9 OWNER'S ADDRESS

Sibley Farms, Inc.
Route 1
Milledgeville, Georgia 31061

10 STATE COUNTY

S C Abbeville

VICINITY

Lowndesville

CONG

DIST

09

STATE

GA

COUNTY NAME

Baldwin

CITY

Milledgeville

CONG

DIST

11 SITE ADDRESS (STREET & NO.)

Beginning at the intersection of South Carolina State
Highway 81 and Abbeville County Road 65 in the town of
Lowndesville, proceed southwest on Co. 65 5.2 miles to

12 EXISTING

SURVEYS

☐ NHP☐ NHL☐ HABS☐ HAER-I☐ HAER☐ NPS☐ CLS☐ CONF☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURE: DESCRIBE BELOW

☒ INTERIOR INTACT☒ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☒ 1:24☐ 1:48☐ OTHER

QUAD

NAME Lowndesville, S.C. - GA.

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:48☐ OTHER

QUAD

NAME

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☒ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

John L. Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS
MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One-story, balloon frame barn with additions 37' (three bays) X 20'. Gable and side shed roofs covered with sheetmetal; clapboard siding; foundations not visible. This structure is one of three remaining outbuildings on the site, of which only one small shed (CA. 1930) was not recorded due to extreme overgrowth. This small farm complex dates to the early decades of the nineteenth century, but due to vandalism, no original structures remain. (The original main house burned a year ago, while the early log barn on the property collapsed on April 9 of this year due to the removal of major structural material by vandals.) This structure is in fair condition with most of its significant fabric intact.

(CONT OVER)

18 ORIGINAL USE

Barn

PRESENT USE

Abandoned

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE? ☐ YES ☒ NO

21 NCAS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER



24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

CEMETERY

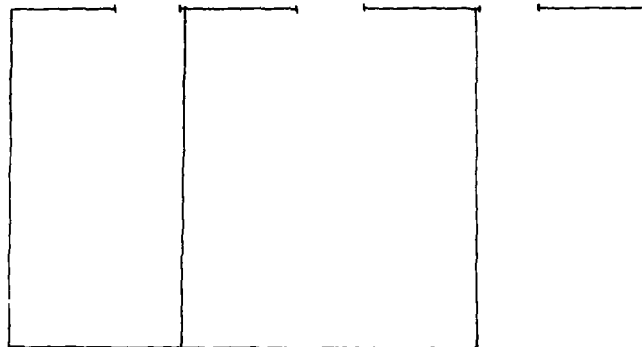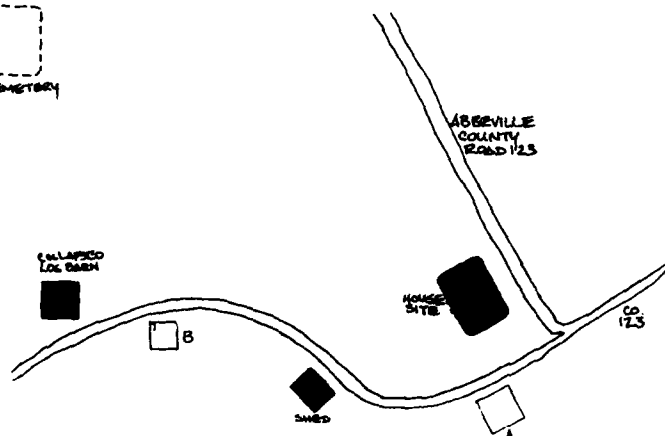

This small barn is a typical example of a late nineteenth century barn of which many examples exist throughout the project area and surrounding region. The significance of this building has been greatly undermined by the loss of the older, major buildings of this complex.

11. (continued) the intersection with Abbeville County Road 123, then generally west on Co. 123 1.2 miles to the site.

[illegible]

INT 4575-78


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 0 - B		3 PRIORITY		4 DANGER OF DEMOLITION* (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Barn		5 DATE		6 GOVT SOURCE OF THREAT		7 OWNER ADMIN	
				CA. 1880-1890		OWNER		ADMIN	
8 NAME(S) OF STRUCTURE		Barn		9 OWNER'S ADDRESS		Sibley Farms, Inc. Route 1 Milledgeville, Georgia 31061			
10 STATE		S C		COUNTY NAME		Abbeville		CITY VICINITY	
COUNTY						Lowndesville		CONG DIST	
						0 9			
11 SITE ADDRESS: STREET & NO.		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 5.2 miles to the intersection with Abbeville County Road		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES: DESCRIBE BELOW	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 4 3 9 3 5 3 7 7 9 6 9 0						1:24 1:62.5	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								1:24 1:62.5	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS		One-story, balloon-frame barn, 31' (three bays) x 17'. Gable roof with flanking shed roofs covered with sheetmetal; clapboard siding; foundations of fieldstone granite piers. This structure is one of three remaining structures on the site, of which only one small shed (CA. 1930) was not recorded due to overgrowth. This small farm complex dates from the early decades of the nineteenth century, but due to vandalism, no original structures remain. (The original main house burned a year ago, while the early log barn on the property collapsed April 9 of this year due to the removal of major structural material by vandals.) This structure is in fair condition, with most of its significant fabric intact.							
18 ORIGINAL USE		Barn		PRESENT USE		Abandoned		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER		Unknown							
20 URBAN AREA 50 000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
						<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

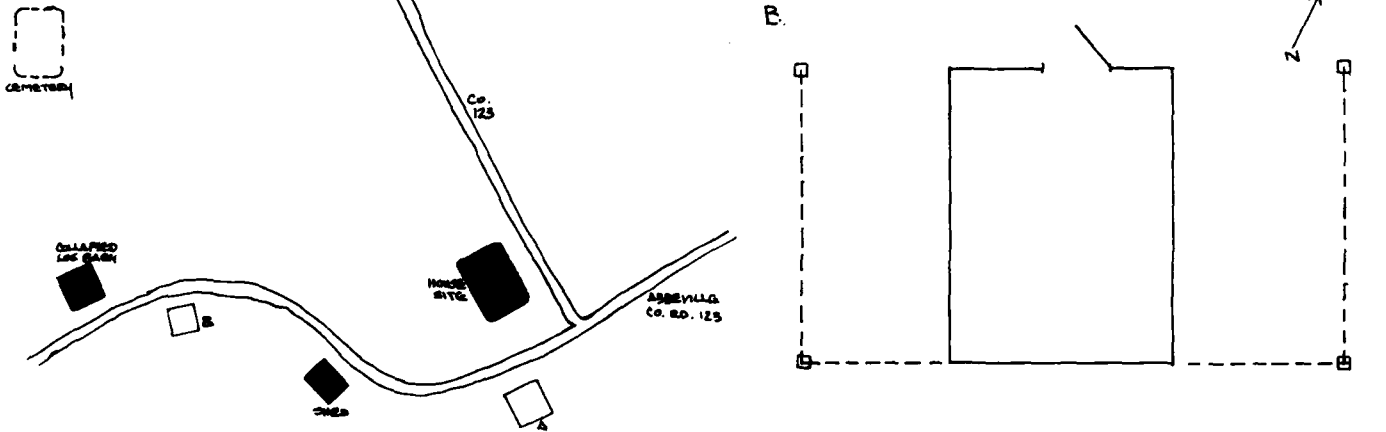

Significance

This small barn is a typical example of a late nineteenth century barn of which many examples exist throughout the project area and surrounding region. The significance of this building has been greatly undermined by the loss of the older, major buildings of this complex.

REFERENCE MATERIALS

11. (continued) 123, then generally west on Co. 123 1.2 miles to the site.

ABSTRACT																			
MAINT NO	LC	TECH REPT	HIST REPT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

TW 4575-78
11/8 11/8 11/8 11/8

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		A B 1 3 0 0 - 1 A		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
7 Classification Residence				8 DATE CA. 1880		6 GOVT SOURCE OF THREAT OWNER		ADMIN	
9 NAME OF STRUCTURE Residence				10 OWNER'S ADDRESS Sibley Farm, Inc. Route 1 Milledgeville, Georgia 31061		11 OWNER ADMIN Alan B. Sibley, Jr. and Winston H. Sibley, Jr.			
12 STATE S C		COUNTY NAME Abbeville		13 VICINITY Lowndesville		CONG DIST 0 9		14 STATE G A	
COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST 0 9		COUNTY NAME Baldwin		CITY Milledgeville	
15 EXISTING SURVEYS NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/>		CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER <input type="checkbox"/>		16 SPECIAL FEATURES DESCRIBE BELOW INTERIOR INT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT <input type="checkbox"/>					
17 UTM ZONE 1 7		EASTING 3 4 4 0 7 0		NORTHING 3 7 7 9 9 4 0		SIGN 1 2 4 1 6 1 1		QUAD NAME Lowndesville, S.C. - GA.	
18 UTM ZONE		EASTING		NORTHING		SIGN		QUAD NAME	
19 CONDITION 70 EXCELLENT 71 GOOD 72 FAIR 73 DETERIORATED 74 RUINS 75 UNEXPOSED 76 ALTERED 82 DESTROYED 85 DEMOLISHED									
16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979					

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC
One-story balloon frame dwelling. Gable roof covered with sheetmetal; boxed eaves; clapboard siding; foundations of fieldstone granite piers. T-shaped plan of three rooms. Central brick chimney; interior sheathed throughout. Not measured due to extreme deterioration and overgrowth. There is one well house associated with this structure (see AB-1300-1-A). Continuing decay of the structure makes preservation nearly impossible.

18 ORIGINAL USE Residence		PRESENT USE Abandoned		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown					

20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

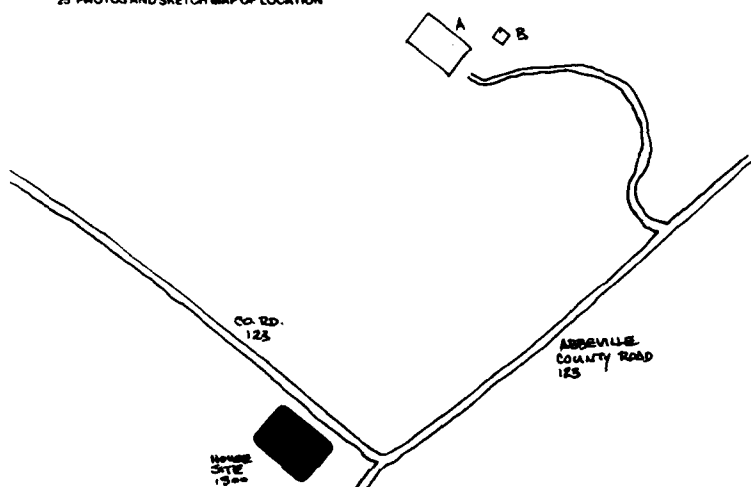

NOT MEASURED
DUE TO OVERGROWTH
AND DECAY



Significance

This is a typical example of a small tenant or homestead dwelling found throughout the project area and the Southeastern United States. The structure is in near-archaeologic condition.

Directions to Site

11. (continued) then generally west on Co. 123 1.1 miles to an overgrown private road, then east .1 mile to the site.

ABSTRACT															
HAS. NO.	LC	TECH. REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRWG.	HIST. DRWG.	COLOR PLATE	PHOTOGRAM	SW	FILM				

INT 4575-78
110 00 000000 0000



FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 0 - 1 B		3 PRIORITY		4 DANGER OF DEMOLITION* (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers	
2 Classification Well House				5 DATE CA. 1880		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Well House				9 OWNER'S ADDRESS Sibley Farm, Inc. Route 1 Milledgeville, Georgia 31061					
10 STATE S C		COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST		STATE G A	
COUNTY						COUNTY Baldwin		CITY Milledgeville	
11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 5.2 miles to the intersection with Abbeville County Road 123.				12 EXISTING SURVEYS: <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER					
13 SPECIAL FEATURES (DESCRIBE BELOW) <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT									
14 UTM ZONE 1 7		EASTING 3 4 4 0 7 0		NORTHING 3 7 7 9 9 4 0		SIGN		SCALE 1:24 1:24 1:24	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 80 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979					
17 DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.									

Open-sided post and frame well house. Gable roof previously covered with sheetmetal (now absent), board apron. The structure is associated with an extremely deteriorated dwelling (AB-1300-1-A). Not measured due to extreme overgrowth.


(CONT OVER)

18 ORIGINAL USE Well House		PRESENT USE Well House		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

28 PHOTOS AND SKETCH MAP OF LOCATION

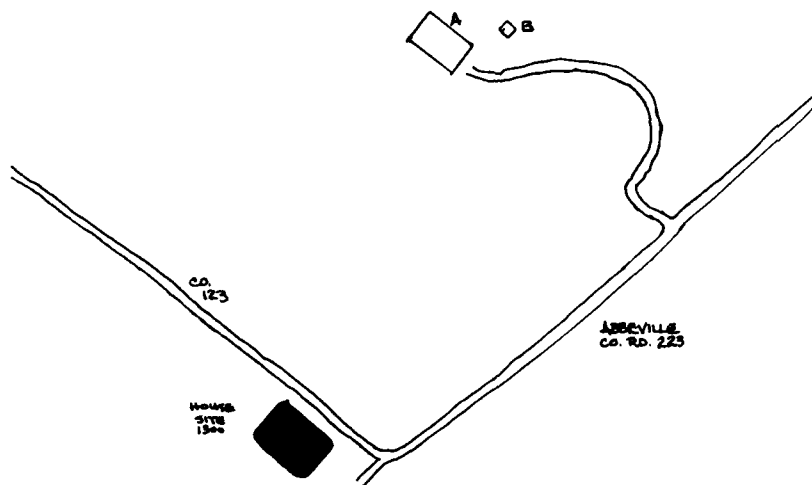

Significance


See Site AB1300-1A.

11. (continued) then generally west on Co. 123 1.1 miles to an overgrown, private road, then east .1 mile to the site.

ABSTRACT																			
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAPH	SW	FILM								

INT 4575-78
FBI LABORATORY

1 SITE ID NO A B 1 3 0 1 - A										2 CLASSIFICATION Residence										3 PRIORITY 5 DATE CA. 1810-1820										4 DANGER OF DEMOLITION? (SPECIFY THREAT) Corps of Engineers (Demolition)										6 GOVT SOURCE OF THREAT OWNER <input type="checkbox"/> ADMIN <input type="checkbox"/> UNKNOWN <input type="checkbox"/>																			
8 NAME(S) OF STRUCTURE Hutchison Farm																				9 OWNER'S ADDRESS Hutchison Farm Route 1 Iva, South Carolina 29655																																							
10 STATE S C COUNTY NAME Abbeville CITY Lowndesville CONG DIST 0 9										10 STATE S C COUNTY NAME Abbeville CITY VICINITY Lowndesville CONG DIST 0 9																																																	
11 SITE ADDRESS (STREET & NO): Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.																				12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLK <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER																																							
13 SPECIAL FEATURES: DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT																																																											
14 UTM ZONE 1 7 EASTING 3 4 4 0 6 0 NORTHING 3 7 8 0 8 3 0 SIGN <input type="checkbox"/> SCALE <input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:60 <input type="checkbox"/> OTHER										14 UTM ZONE 1 7 EASTING 3 4 4 0 6 0 NORTHING 3 7 8 0 8 3 0 SIGN <input type="checkbox"/> SCALE <input type="checkbox"/> 1:24 <input type="checkbox"/> 1:60 <input type="checkbox"/> OTHER										QUAD NAME Lowndesville, S.C. - GA.																																							
15 CONDITION <input type="checkbox"/> 70 EXCELLENT <input checked="" type="checkbox"/> 71 GOOD <input type="checkbox"/> 72 FAIR <input type="checkbox"/> 73 DETERIORATED <input type="checkbox"/> 74 RUINS <input type="checkbox"/> 75 UNEXPOSED <input type="checkbox"/> 76 ALTERED <input type="checkbox"/> 82 DESTROYED <input type="checkbox"/> 85 DEMOLISHED																																																											
16 INVENTORIED BY John L. Hopkins, Emily J. Harris																				AFFILIATION Historic American Buildings Survey																				DATE May 1, 1979																			
17 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.) Two-story log dog-trot house with frame additions; 47' (four bays and dogtrot) X 60' (five bays). Gable roofs covered with sheetmetal, boxed eaves. One-half dovetail log joinery, clapboard siding on additions, boxed eaves, 6x6 sash windows, exterior brick chimneys laid on fieldstone foundations, original hardware or hand-forged replacement hardware in place throughout; foundations of fieldstone granite piers. Original plan of one room on either side of dogtrot; present plan two rooms deep on each side of dogtrot, with rear wing; original roof raised to its present height by addition of three logs to walls. This structure is in good condition with little damage to the fabric from deterioration and the preservation of this structure could be easily accomplished. Associated with this structure are six outbuildings: (b) smokehouse, CA. 1810-1820; (c) well house, CA. 1900; (d) corn crib, CA. 1880; (e) blacksmith shop, CA. 1850; (f) garage, CA. 1930-1940; (g) garage, CA. 1930. All of these associated structures are maintained at present and range from good to fair condition.																																																											
18 ORIGINAL USE Residence																				PRESENT USE Residence																				ADAPTIVE USE																			
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown																																																											
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO										21 NCAS Region <input type="checkbox"/>										22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR <input type="checkbox"/> INDEXER <input type="checkbox"/>																													
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO										NAME										DISTRICT ID NO																																							

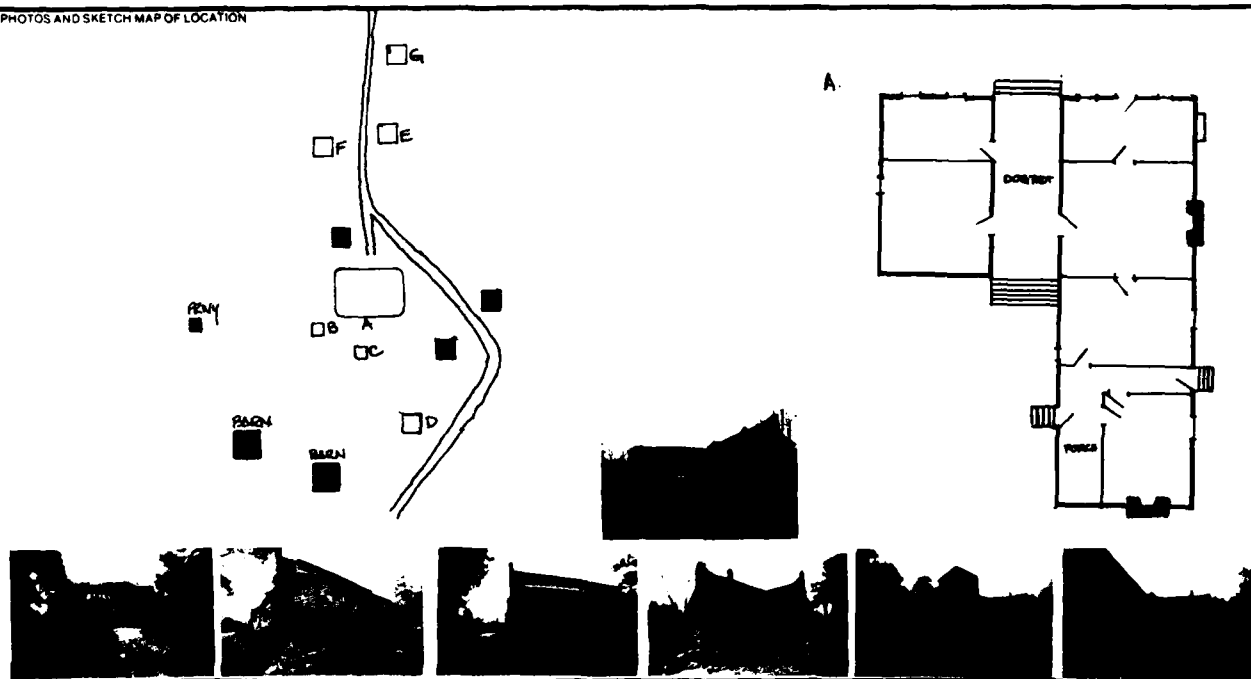**Significance**

Composed of massive hewn logs with one-half dovetail joinery. This well preserved farmhouse is an excellent example of the construction skill of the early settlers of Abbeville County. This is certainly the most impressive log dwelling in the project area, if not in the whole of Abbeville County. The farm has been in the possession of the Hutchison family since 1877, though the original two buildings may date from as early as CA. 1810-1820.

Reference Coordinates

11. (continued) then southwest on Co. 81 1.0 mile to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 mile to the site.

ABSTRACT		HIST PHOTO		CONTEMP PHOTO		HIST DRAWG		CONTEMP DRAWG		COLOR PLATE		PHOTOGRAM		SW		FILM	

INT 4575-78
11 10 11 10 11 10 11 10


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 1 - B		2 Classification Smokehouse		3 PRIORITY		4 DANGER OF DEMOLITION SPECIFY THREAT: <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
						5 DATE CA. 1810-1820		6 GOVT SOURCE OF THREAT OWNER ADMIN	
8 NAME(S) OF STRUCTURE Hutchison Farm						9 OWNER'S ADDRESS Route 1 Iva, South Carolina 29655			
10 STATE S C		COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST 0 9		STATE S C	
COUNTY								COUNTY NAME Abbeville	
								VICINITY Abbeville	
								CONG DIST 0 9	
11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.									
12 EXISTING SURVEYS <input type="checkbox"/> NPL <input type="checkbox"/> H&B <input type="checkbox"/> H&P <input type="checkbox"/> H&R <input type="checkbox"/> NPS <input type="checkbox"/> CLF <input type="checkbox"/> CONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER									
13 SPECIAL FEATURES: DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT									
14 UTM ZONE EASTING NORTHING SIGN 1 7 3 4 4 0 6 0 3 7 8 0 8 2 5 UTM ZONE EASTING NORTHING SIGN									
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input checked="" type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 78 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY John L. Hopkins, Emily J. Harris									
AFFILIATION Historic American Buildings Survey									
DATE May 1, 1979									
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC. Log smokehouse, 11' (one bay) x 16'. Gable roof covered with wooden shingles; one-half dovetail log joinery, clapboards on gable ends, door frame pegged into log ends; foundations of fieldstone granite piers. Plan of one room. There has been little damage to the original fabric of this structure and preservation could be easily achieved. Associated with this structure are six additional structures as part of the Hutchison Farm Complex. See Site AB1301-A for general comments.									
(CONT OVER)									
18 ORIGINAL USE Smokehouse									
PRESENT USE Storage									
ADAPTIVE USE									
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown									
(CONT OVER)									
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO									
21 NCRS Region									
22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN									
23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO NAME DISTRICT ID NO									

25 PHOTOS AND SKETCH MAP OF LOCATION

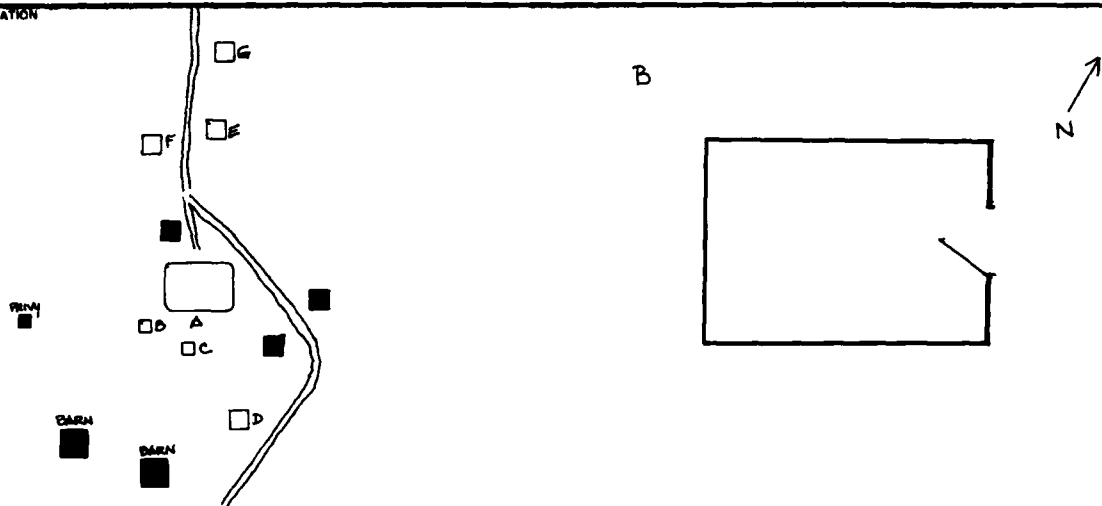

Significance

This small smokehouse is possibly the only outbuilding left standing from the original Hutchison Farm Complex. The log construction with one-half dovetail joinery indicates that it was built during the same period as the Hutchison house, Site ABI301-A, CA 1810-1820.

REFERENCES CONTAINED

11. (continued) then southwest on Co. 81 1.0 miles to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 mile to the site.

ABSTRACT																			
HAT NO	LC	TECH REPO	HIST REPO	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
110 2 510000 0000

230 June 1978

SITE ID NO

A B 1 3 0 1 - C

OAHB INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240Classification
Well House

PRIORITY

DANGER OF DEMOLITION
SPECIFY THREATYES NO UNKNOWN
Corps of Engineers (Demolition)

DATE

CA. 1900

OWNER

ADMIN

OWNER ADMIN

B. B. Hutchison

Administrator, Estate of H. B. Hutchison

NAME OF SITE

Hutchison Farm

OWNER'S ADDRESS

Route 1

Iva, South Carolina 29655

STATE S C COUNTY NAME Abbeville VICINITY Lowndesville CONG DIST 09
STATE S C COUNTY NAME Abbeville VICINITY Lowndesville CONG DIST 09

ADDRESS: BEGIN STREET AND NO. Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.

EXISTING SURVEYS

NR

NHL

HABS

MAER-1

MAER

NPS

CLB

CONF

STATE

COUNTY

LOCAL

OTHER

SPECIAL FEATURES: DESCRIBE BELOW

INTERIOR INTACT

EXTERIOR INTACT

ENVIRONS INTACT

UTM ZONE EASTING NORTHING SIGN SCALE QUAD NAME Lowndesville, S.C. - GA.
UTM ZONE EASTING NORTHING SIGN SCALE QUAD NAME

UTM ZONE EASTING NORTHING SIGN SCALE QUAD NAME

CONDITION 1 EXCELLENT 2 GOOD 3 FAIR 4 DETERIORATED 5 RUINS 6 UNEXPOSED 7 ALTERED 8 DESTROYED 9 DEMOLISHED

INVENTORIED BY
John L. Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS; EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC.

Open-sided cedar post and frame well house, 12' x 12'. Gable roof covered with wooden shingles and sheetmetal; clapboard on gable ends. Well at center well crank in place. This structure is well preserved and the well is still in use. It is associated with six additional buildings as part of the Hutchison Farm Complex. See Site AB1301-A for general comments.

(CONT OVER)

ORIGINAL USE Well House PRESENT USE Well House ADAPTIVE USE



REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? YES NO 21 NCRS Region 22 PUBLIC ACCESSIBILITY YES LIMITED YES UNLIMITED NO UNKNOWN 23 EDITOR INDEXER
24 LOCATED IN AN HISTORIC DISTRICT? YES NO NAME DISTRICT ID NO

25 PHOTOS AND SKETCH MAP OF LOCATION

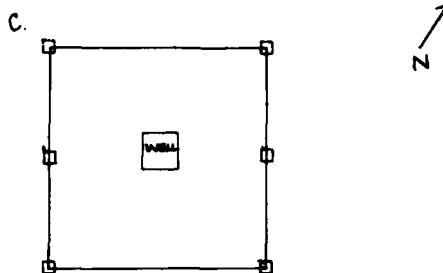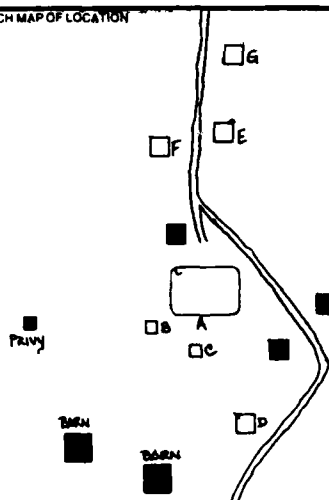

Significance

See Site AB1301-A.

11. (continued)

then southwest on Co. 81 1.0 miles to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 mile to the site.

ABSTRACT																			
HAZ. NO.	LC	TECH. REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRWG	HIST. DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11


FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 1 - D		2 CLASSIFICATION		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		5 DATE		6 GOVT SOURCE OF THREAT		7 OWNER ADMIN		8 NAME(S) OF STRUCTURE		9 OWNER'S ADDRESS							
				Corn Crib				Corps of Engineers (Demolition)		CA. 1880				B. B. Hutchison Administrator, Estate of M. B. Hutchison		Hutchison Farm		Route 1 Iva, South Carolina 29655							
10 STATE COUNTY		S C		COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST		STATE COUNTY		S C		COUNTY NAME Abbeville		VICINITY Lowndesville		CONG DIST							
																		0 9							
11 SITE ADDRESS (STREET & NO): Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.																		12 EXISTING SURVEYS		13 SPECIAL FEATURES (DESCRIBE BELOW)					
																		<input type="checkbox"/> NPL <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLH		<input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT					
14 UTM ZONE EASTING NORTHING SIGN SCALE																		15 CONDITION		16 INVENTORIED BY		17 AFFILIATION		18 DATE	
1 7 3 4 4 0 6 0 3 7 8 0 8 0 0																		70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED		John L. Hopkins, Emily J. Harris		Historic American Buildings Survey		May 1, 1979	
19 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC.)																		20 URBAN AREA 50 000 POP OR MORE?		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
One-story balloon frame corn crib with shed addition to one side, 18' (two bays) x 24'. Gable roof covered with sheetmetal, clapboard siding and vertical board sheathing; foundations of fieldstone granite piers. This structure has suffered minimal deterioration and could be easily preserved. It is associated with six additional structures as part of the Hutchison Farm Complex. See Site AB1301-A for general comments.																		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		2		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?																		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

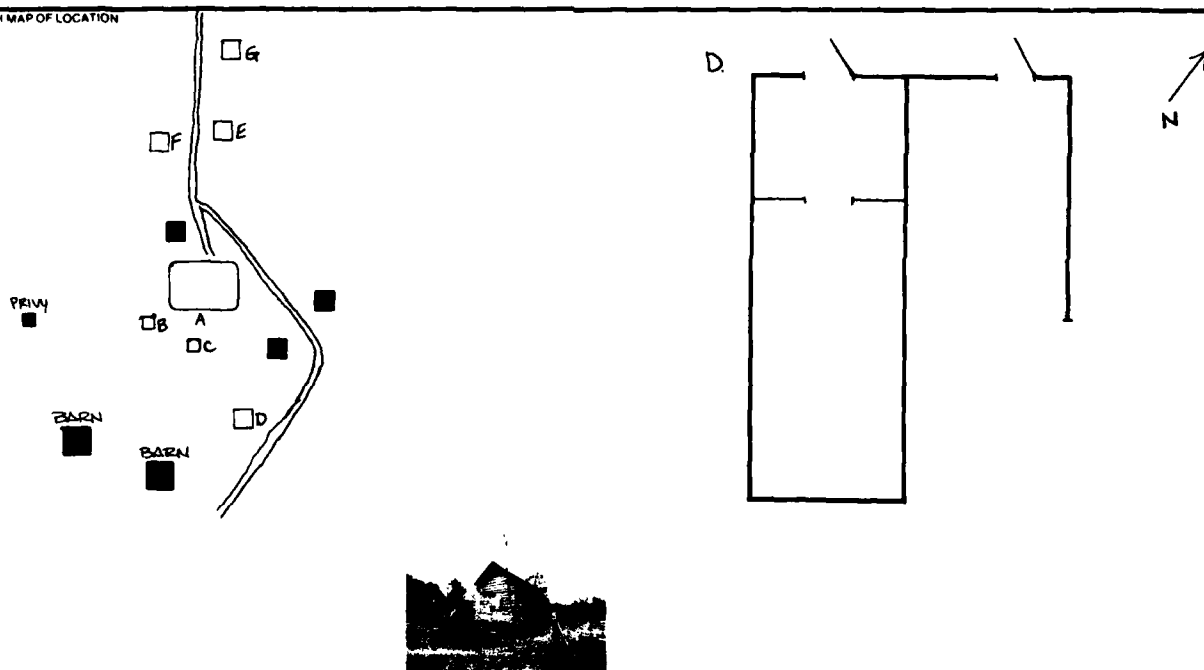

Significance

See Site AB1301-A.

11. (continued)

then southwest on Co. 81 1.0 mile to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 mile to the site.

ABSTRACT											
HA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	FILM

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 1 - E		2 CLASSIFICATION		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
				Blacksmith Shop				Corps of Engineers (Demolition)			
						4 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
						CA. 1850					
								7 OWNER ADMIN		B. B. Hutchison Administrator, Estate of M. B. Hutchison	
								9 OWNER'S ADDRESS			
								Route 1 Iva, South Carolina 29655			
10 STATE		COUNTY NAME		VICINITY		CONG DIST		STATE		COUNTY NAME	
S C		Abbeville		Lowndesville				S C		Abbeville	
										CONG DIST 09	
11 SITE ADDRESS STREET & NO		12 EXISTING SURVEYS		13 SPECIAL FEATURES DESCRIBE BELOW							
Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6		<input checked="" type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT							
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE		QUAD NAME	
17		344060		3780800				1:24 <input checked="" type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER <input type="checkbox"/>		Lowndesville, S.C. - GA.	
15 CONDITION		20 EXCELLENT		21 GOOD		22 FAIR		23 DETERIORATED		24 RUINS	
		<input type="checkbox"/>		<input checked="" type="checkbox"/>		<input type="checkbox"/>		<input type="checkbox"/>		<input type="checkbox"/>	
25 INVENTORIED BY		AFFILIATION		DATE							
John L. Hopkins, Emily J. Harris		Historic American Buildings Survey		May 1, 1979							
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.											
One-story hewn-frame blacksmith shop, 18' (one bay) x 14' (one bay). Gable roof covered with wooden shingles; clapboard siding, windows of no lights covered with board shutters; foundations of fieldstone granite piers. One room; no chimney. Original firepit in place; many original tools present. There has been little damage to the original fabric of this structure and preservation could be easily achieved. This building is associated with six additional structures as part of the Hutchison Farm Complex. See Site AB1301-A for general comments.											

(CONT OVER)

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
Blacksmith Shop		Blacksmith Shop			
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER					
Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
				<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

This is a rare and extremely well preserved example of a blacksmith shop which were integral parts of many nineteenth century southern farm complexes. The original tools present within the shop, and its continued use for blacksmithing, make it a unique example of the continuity of traditional farming practices. See Site ABI301-A for the relationship of this site to the remainder of the farm complex.

11. (continued) intersection with Abbeville County Road 81, then southwest on Co. 81 1.0 mile to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 mile to the site.

[illegible]

INT 4575-78

FHR-8-230 June 1978

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


OAHF INVENTORY

1 SITE ID NO		A B 1 3 0 1 - F		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Garage		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1930 - 1940					
8 NAME(S) OF STRUCTURE				9 OWNER'S ADDRESS					
Hutchison Farm				B. B. Hutchison, Administrator, Estate of M. B. Hutchison Route 1 Iva, SC 29655					
10 STATE		COUNTY NAME		CITY/VICINITY		CONG DIST		10 STATE	
S C		Abbeville		Lowndesville		09		S C	
COUNTY								COUNTY NAME	
								Abbeville	
								Lowndesville	
								CONG DIST	
								09	
11 SITE ADDRESS (STREET & NO): Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co.65 3.0 miles to the intersection with Abbeville County (Con't Reverse)									
12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS									
13 SPECIAL FEATURES (DESCRIBE BELOW): <input type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT									
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
17		3 4 4 0 5 0 3 7 8 0 8 6 0						1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER <input type="checkbox"/>	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER <input type="checkbox"/>	
								QUAD NAME	
								QUAD NAME	
15 CONDITION <input type="checkbox"/> EXCELLENT <input checked="" type="checkbox"/> GOOD <input type="checkbox"/> FAIR <input type="checkbox"/> DETERIORATED <input type="checkbox"/> RUINS <input type="checkbox"/> UNEXPOSED <input type="checkbox"/> ALTERED <input type="checkbox"/> DESTROYED <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY: John Linn Hopkins, Emily J. Harris									
AFFILIATION: Historic American Buildings Survey									
DATE: May 1, 1979									
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC									

One-story, post-and-frame, open-sided garage. Gable and shed roofs covered with sheetmetal; clapboards on gable ends. This garage structure is well maintained and in good repair. Associated with this structure are six additional structures that form the Hutchison Farm Complex. For general comments on the whole complex, see AB1301-A.

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE		(CONT OVER)	
Garage		Garage					
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER							
Unknown							
20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

25 PHOTOS AND SKETCH MAP OF LOCATION

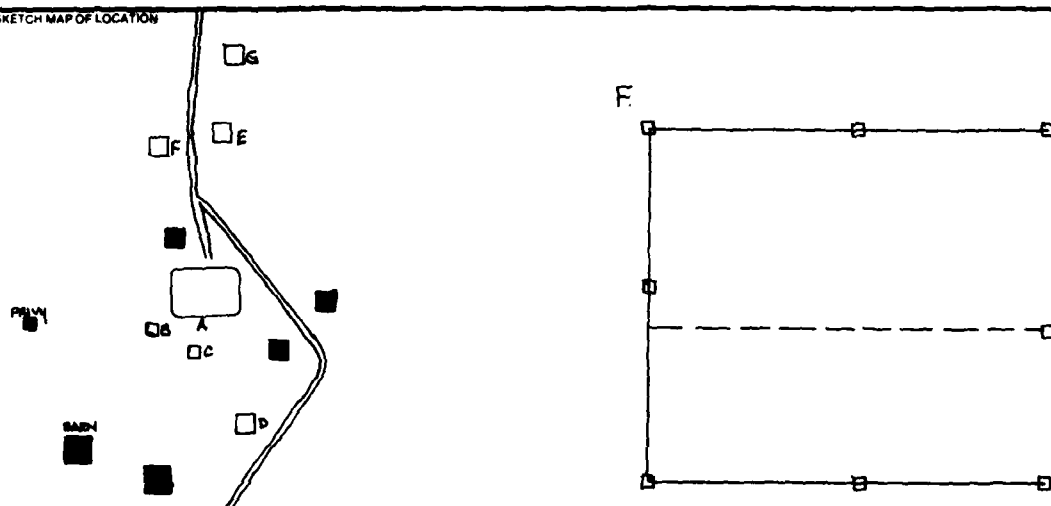

Significance

See AB1301-A

11. Site Address (Street & No) (Continued)

Road 81, then southwest on Co. 81 1.0 miles to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 miles to the site.

ABSTRACT																			
MA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM							

INT 4575-78

FHR 8-730 June 1978

OAHF INVENTORY


Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 1 - G		2 CLASSIFICATION		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>	
Residence						6 DATE		7 GOVT SOURCE OF THREAT		OWNER ADMIN	
						CA. 1930					
8 NAME OF SITE (HERE)		Hutchison Farm		9 OWNER'S ADDRESS		B. B. Hutchison, Administrator, Estate of M. B. Hutchison		Route 1		Iva, SC 29655	
10 STATE		SC		COUNTY NAME		Abbeville		VICINITY		Lowndesville	
CONG DIST		09		11 SITE ADDRESS (STREET AND NO)		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville (Con't Reverse)		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLS <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER	
13 SPECIAL FEATURES (DESCRIBE BELOW)		<input type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT		14 UTM ZONE		EASTING		NORTHING		SIGN	
15 CONDITION		<input type="checkbox"/> EXCELLENT <input checked="" type="checkbox"/> GOOD <input type="checkbox"/> FAIR <input type="checkbox"/> DETERIORATED <input type="checkbox"/> RUINS <input type="checkbox"/> UNEXPOSED <input type="checkbox"/> ALTERED <input type="checkbox"/> DESTROYED <input type="checkbox"/> DEMOLISHED		16 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.				DATE		May 1, 1979					

One story opensided post and frame garage with loft. Gable roof covered with wooden shingles; clapboards on gable ends. This garage structure is well maintained and in good repair. This garage is associated with six additional structures as part of the Hutchison Farm Complex. See site AB1301-A for general comments.

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE		(CONT OVER)	
Garage		Garage					
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER							
Unknown							
20 URBAN AREA 50,000 POP OR MORE?		21 NCAS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR INDEXER	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	
24 LOCATED IN AN HISTORIC DISTRICT?		NAME		DISTRICT ID NO			
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO							

25 PHOTOS AND SKETCH MAP OF LOCATION

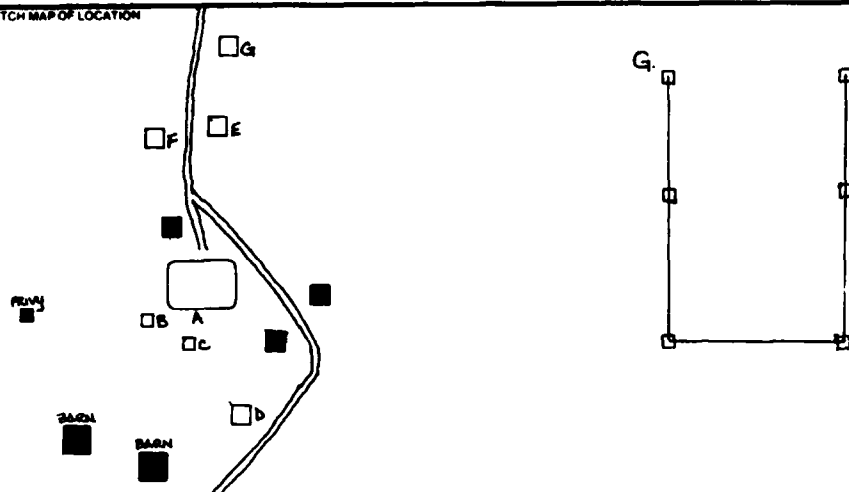

Significance
See site AB1301-A for general comments.

11. Site Address (Street & No) (Continued)

County Road 81, then southwest on Co. 81 1.0 miles to the intersection with Abbeville County Road 93, then south on Co. 93 1.0 miles to the site.

ABSTRACT																			
MAST NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
H B B

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO

A B 1 3 0 1 - 2 A

2 Classification
Residence

3 PRIORITY

4 DANGER OF DEMOLITION?
(SPECIFY THREAT)☐ YES ☒ NO ☐ UNKNOWN5 DATE
CA. 1870

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER/ADMIN

B. B. Hutchison, Administrator, Estate of M. B. Hutchison

8 NAME OF STRUCTURE

Long House

9 OWNER'S ADDRESS

Route 1
Iva, SC 2965510 STATE
COUNTY

S C

COUNTY NAME

Abbeville

CITY/VICINITY

Lowndesville

CONG

DIST

0 9

STATE

COUNTY

S C

COUNTY NAME

Abbeville

CITY/VICINITY

Lowndesville

CONG

DIST

0 9

11 SITE ADDRESS (STREET AND NO) Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville (Con't Reverse)

12 EXISTING SURVEYS

☐ NR☐ NML☐ HABS☐ HAER-I☐ HAER☐ NPS☐ CL6☐ CONF☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

13 SPECIAL FEATURES (DESCRIBE BELOW)

☐ INTERIOR INTACT☒ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

☐ OTHER

QUAD

NAME

Lowndesville, SC - GA

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

☐ OTHER

QUAD

NAME

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☐ FAIR73 ☒ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.)

One-story, balloon-frame house; 44' (four bays) x 48' (four bays). Gable roofs covered with sheetmetal; clapboard siding, boxed eaves, windows covered with board shutters front door with sidelights, small exterior cupboard with five shelves; foundation of fieldstone granite piers. Interior inaccessible. Central chimney of brick laid on fieldstone granite foundations. This structure has been used for hay storage, resulting in the collapse of its floors. The potential for preservation of the structure therefore appears to be limited. The structure is associated with a small log dogtrot barn (site AB1301-2B).

(CONT OVER)

18 ORIGINAL USE

Residence

PRESENT USE

Hay storage

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000
POP OR MORE? ☐ YES ☒ NO

21 NCAS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER



24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

25 PHOTOS AND SKETCH MAP OF LOCATION

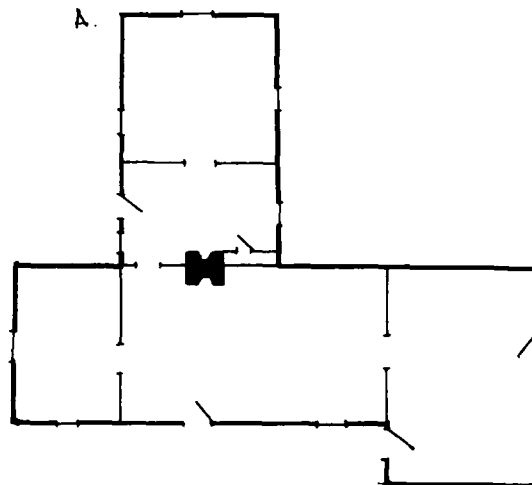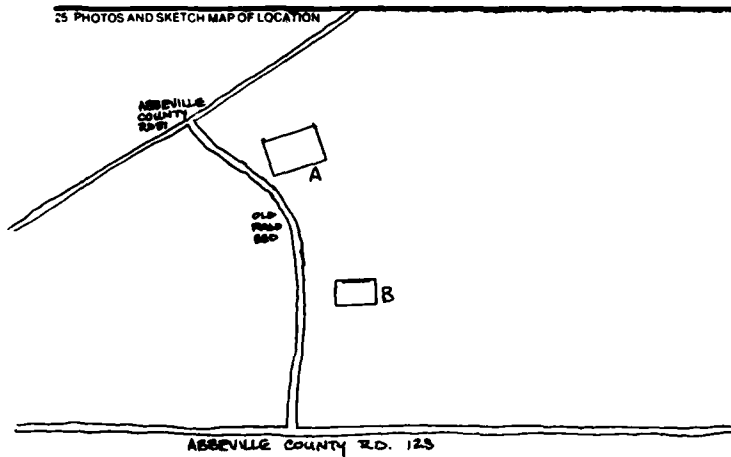

Significance This structure is a fine example of a post-civil war homestead dwelling. The front door with sidelights is an unusual feature in the project area, and even more unique is the small cupboard on an exterior wall, where there was previously a porch. This structure was recorded as part of the Hutchison Farm Complex (AB1301), although this house site and associated barn lie outside the acquisition line of the Russell Project.

~~XXXXXXXXXXXX~~ 11. Site Address (Street & No) (Continued)

County Road 81, then southwest on Co. 81 2.1 miles to Abbeville County Road 123, then south on Co. 123 .1 mile to an unpaved drive, then east 1000 feet to the site.

ABSTRACT																			
HAT NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
1100 000000 0000

1 SITE ID NO

A B 1 3 0 1 - 2 B

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Barn

3 PRIORITY

4 DANGER OF DEMOLITION

☐ YES ☒ NO ☐ UNKNOWN

5 DATE

CA. 1914 -
1917

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

8 NAME(S) OF STRUCTURE

Barn

7 OWNER ADMIN

B. B. Hutchison, Administrator, Estate of M. B. Hutchison

9 OWNER'S ADDRESS

Route 1
Iva, SC 29655

10 STATE

S C

COUNTY NAME

Abbeville

XXX VICINITY

Lowndesville

CONG

DIST

0 9

STATE

S C

COUNTY NAME

Abbeville

XXX VICINITY

Lowndesville

CONG

DIST

0 9

11 SITE ADDRESS (STREET & NO.): Beginning at the intersection of South
Carolina State Highway 81 and Abbeville County Road 65 in the
town of Lowndesville, proceed southwest on Co. 65 3.0 miles
to the intersection with Abbeville County (Con't Reverse)

12 EXISTING

SURVEYS

☐ NH☐ NHL☐ HABS☐ HAER☐ HAER☐ NPS☐ CLP

13 SPECIAL FEATURES DESCRIBE BELOW

☒ INTERIOR INTACT☒ EXTERIOR INTACT☒ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☒ 1:24☐ 1:48

QUAD

NAME

Lowndesville, SC - GA

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24☐ 1:48

QUAD

NAME

15 CONDITION

70 EXCELLENT

71 GOOD

72 FAIR

73 DETERIORATED

74 RUINS

75 UNEXPOSED

76 ALTERED

77 DESTROYED

78 DEMOLISHED

16 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS

MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC

Two story log dogtrot barn, 28' x 10', dogtrot 3'9" high. Gable roof covered with sheetmetal; unhewn logs with v-notch joinery, openings in center of dog trot and door to loft in one end wall. Pens on either side originally intended for animals, with hayloft above. According to informant evidence, dogtrot was approximately 6' in height when the barn was constructed in 1914 - 1917, and the building has settled to its present height. The remainder of the structure is well preserved, although its original integrity is partially lost. This structure is associated with a house, site AB1301-2A.

(CONT OVER)

18 ORIGINAL USE

Barn

PRESENT USE

Barn

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Numerous personal conversations with A. Bandon Hutchison and Alvin Hutchison April 1979.

(CONT OVER)

20 URBAN AREA 50 000

POP OR MORE?

☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER


24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO


NAME

DISTRICT ID NO

25 PHOTOS AND SKETCH MAP OF LOCATION

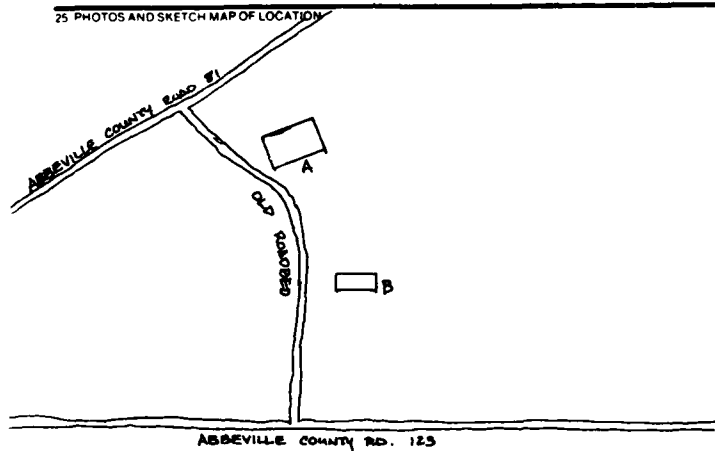

B.

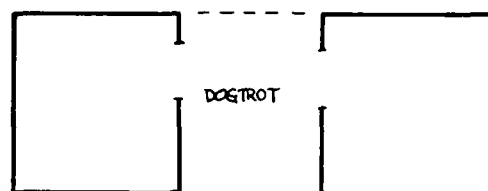

Significance This structure exemplifies a unique form of log barn construction, not seen in the project area or in the surrounding region. Although the building has settled considerably, it continues to be a utilitarian farm structure of unique integrity. Informant evidence indicates that the barn was built sometime between 1914 and 1917, thus revealing the survival, or perhaps imitation, of traditional log construction techniques in the early twentieth century. This structure was recorded as part of the Hutchison Farm Complex (AB1301), although this barn and its associated house lie outside the acquisition area of the Russell Project.)

XXXXXXXXXX (CONTINUED) 11. Site Address (Street & NO) (Continued)

XXXXXXXXXX 11. Site Address (Street & No.) (continued)
Road 81, then southwest on Co. 81 2.1 miles to Abbeville County Road 123, then south on Co. 123 .1 mile to an unpaved
drive, then east 500 feet to the site.

[illegible]

INT 4575-71

1-230 June 1978

SITE ID NO

A B 1 3 0 1 - 3

OAHB INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240Classification
Residence

1 PRIORITY

4 DANGER OF DEMOLITION
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

5 DATE
CA. 1880

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

8 NAME OF STRUCTURE
Residence9 OWNER ADMIN
B. B. Hutchison, Administrator, Estate of M. B. Hutchison10 OWNER'S ADDRESS
Route 1
Iva, SC 29655

11 STATE

SC

COUNTY NAME

Abbeville

12 VICINITY

Lowndesville

13 CONG DIST

09

14 STATE

SC

COUNTY NAME

Abbeville

15 VICINITY

Lowndesville

16 CONG DIST

09

17 SITE ADDRESS (STREET AND NO) Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed outhwest on Co. 65 3.0 miles to the intersection with Abbeville County (Con't Reverse)

18 EXISTING SURVEYS

☐ NPL☐ HABS☐ HAER☐ HAER☐ NPS☐ CLH☐ STATE☐ COUNTY☐ LOCAL☐ OTHER

19 SPECIAL FEATURES (DESCRIBE BELOW)

☐ INTERIOR INTACT☒ EXTERIOR INTACT☐ ENVIRONS INTACT

20 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☒ 1:24☐ 1:60☐ OTHER

QUAD NAME

Lowndesville SC - GA

21 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☒ 1:24☐ 1:60☐ OTHER

QUAD NAME

22 CONDITION

23 EXCELLENT

24 GOOD

25 FAIR

26 DETERIORATED

27 RUINS

28 UNEXPOSED

29 ALTERED

30 DESTROYED

31 DEMOLISHED

32 INVENTORIED BY

John Linn Hopkins, Emily J. Harris

33 AFFILIATION

Historic American Buildings Survey

34 DATE

May 1, 1979

35 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One story, balloon frame hired man's dwelling, 29' (three bays) x 14' (one bay). Gable roof covered with wooden shingles; clapboard siding, windows of no lights covered with board shutters; foundations of fieldstone granite piers. Two room plan with central brick chimney laid on fieldstone granite foundation. This building has deteriorated seriously as the result of its use as a storage barn. Informant evidence indicates that this hired man's dwelling was associated with a no longer extant house across the road and a small store, now in ruins. It is presently associated with the Hutchison farm complex (site AB1301-A).

(CONT OVER)

36 ORIGINAL USE

37 PRESENT USE

38 ADAPTIVE USE

Residence

Storage

39 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER

Personal conversation with A. B. Hutchison and Catherine Hutchison 4/14/79.

(CONT OVER)

40 URBAN AREA 50,000
POP OR MORE?☐ YES ☒ NO

41 NCRS Region

42 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

43 EDITOR

INDEXER

44 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

25 PHOTOS AND SKETCH MAP OF LOCATION



Significance This structure is one of the few that can be positively identified as a post-civil war hired man's dwelling in the project area. It is the only surviving part of a complex of buildings which included a house and a small store, and was associated with other nearby farms, few of which still exist. This structure was recorded as part of the Hutchison Farm Complex (AB1301), although it lies outside of the acquisition area of the Russell Project.

~~XXXXXXXX~~ CONTINUED: 11. Site Address (Street & No) (Continued)

Road 81, then southwest on Co. 81 1.0 miles to the intersection with Abbeville County Road 93, then south on Co. 93 .4 miles to the site.

ABSTRACT																			
NAE NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRAWG	HIST DRAWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
1100 000000 0000

FHR-8-230 June 1978



OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 4 - A		3 PRIORITY		4 DANGER OF DEMOLITION* (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)			
2 Classification		Blacksmith shop		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN Estate of Douglas Featherstone			
7 NAME S. OF STRUCTURE		Harper Farm		8 OWNER'S ADDRESS		% R. B. Curry, Jr. 201 N. Main Street Greenwood, SC 29646					
9 STATE		S C		COUNTY NAME		Abbeville		CITY/VICINITY			
10 CONG DIST		D 9		11 SITE ADDRESS STREET & NO		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville (Con't Reverse)		12 EXISTING SURVEYS			
13 UTM ZONE		17		EASTING		3 4 1 9 1 5 3 7 8 1 2 7 5		14 QUAD NAME			
15 NORTHING		17		16 SIGN		-		17 QUAD NAME			
18 SCALE		1:24		19 OTHER		1:24		20 QUAD NAME			
21 CONDITION		70 EXCELLENT		71 GOOD		72 FAIR		73 DETERIORATED			
22 RUINS		74 UNEXPOSED		75 ALTERED		76 DESTROYED		77 DEMOLISHED			
23 INVENTORIED BY		John Linn Hopkins, Emily J. Harris		24 AFFILIATION		Historic American Buildings Survey		25 DATE			
26 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.		One story, log blacksmith shop, 10' (one bay) x 15' (one bay). Gable roof covered with sheetmetal; unhewn logs with saddle-notch joinery, windows of no lights covered with board shutter. One room, no chimney, brick firepit in place. This structure is in fairly good repair, and could be easily preserved. The structure is one of ten outbuildings that made up the Harper farm complex: B) Well house (CA. 1850); C) Generator house (CA. 1920); D) Pig house (CA. 1930); E) Barn (CA. 1850); F) Barn (CA. 1830); G) Feeding crib (CA. 1900); H) Horse Barn (CA. 1880); I) Garage (CA. 1930); J) Garage (CA. 1930). Two chimneys are all that remain of the original farmhouse (AB1304-K), which was destroyed by fire, CA. 1974. Most of these structures are in good condition and could be easily preserved or restored.		27 ORIGINAL USE		Blacksmith shop		28 PRESENT USE		Abandoned	
29 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER		Unknown		30 ADAPTIVE USE							
31 URBAN AREA 50 000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		32 NCRS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN			
33 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		34 NAME		35 DISTRICT ID NO		23 EDITOR INDEXER			

(CONT OVER)

(CONT OVER)

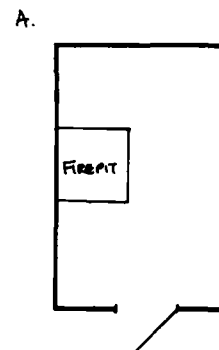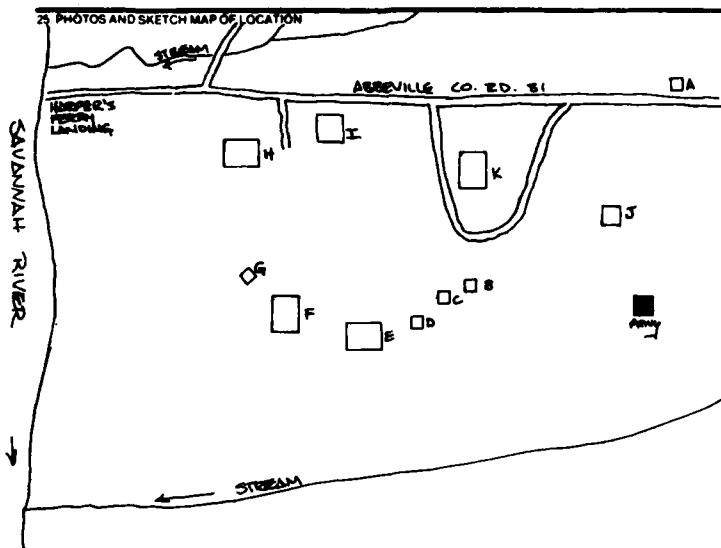

Significance The saddlenotch log joinery in this structure indicate that it was build CA. 1900. It represents the survival of traditional log construction in the early twentieth century. The structure was part of the larger Harper Farm complex, which originated as an early nineteenth century plantation. The complex includes structures of different periods; illustrating the continual evolution of the Southern farm. Several structures in the complex are of unique architectural character. The complex, associated with the site of Harper's Ferry, played a central role in the economic development and history of the project area.

~~XXXXXXXX~~ CONTINUED 11. Site Address (Street & No) (Continued)

County Road 81, then southwest on Co. 81 2.9 miles to the site.

ABSTRACT																			
HAER NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
U.S. GOVERNMENT PRINTING OFFICE: 1975

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO A B 1 3 0 4 - B		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification Well house		5 DATE CA. 1850		6 GOVT SOURCE OF THREAT OWNER ADMIN	
7 NAME S OF STRUCTURE Harper Farm		8 OWNER-ADMIN Estate of Douglas Featherstone		9 OWNER S ADDRESS % R. B. Curry, Jr. 201 N. Main Street Greenwood, SC 29646	
10 STATE S C		COUNTY NAME Abbeville		CITY VICINITY Lowndesville	
11 SITE ADDRESS, STREET & NO. Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville (Con't Reverse)		12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14 UTM ZONE 17		EASTING 3417753		NORTHING 781140	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input checked="" type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED		16 INVENTORIED BY John Linn Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC. Two story embankment well house, larder and buttery, partially opensided, hewn timber fram, 13' x 23'. Gable roof covered with sheetmetal; clapboard siding, louvered vent openings, 242 sash windows; foundations of brick and timber piers. Opensided well area beside one room larder, one room buttery or cold room below larder. Wooden well cover and pump mechanism partially intact, concrete floor and water tub in buttery. This structure has suffered little deterioration although minor alterations, including closing off the larder, have occurred. The building could be easily restored and preserved. The structure is one of ten remaining from the Harper farm complex (See site AB1304-A for general comments).		DATE May 1, 1979			
18 ORIGINAL USE Well house, larder, buttery		PRESENT USE Abandoned		ADAPTIVE USE	
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown					
20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region 1		22 PUBLIC ACCESSIBILITY <input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN	
23 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO	

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

The sketch map shows the Savannah River on the left, flowing downwards. Middleville County Rd. 31 runs horizontally across the top. A stream flows from the top left towards the center. Various points are marked with letters A through S. A legend indicates that a solid black square represents a 'COLLAPSED' structure and a solid black square represents a 'PRIVY'. The map also shows 'HARTER'S FERRY LANDING' and a 'STREAM' flowing from the top left towards the center.

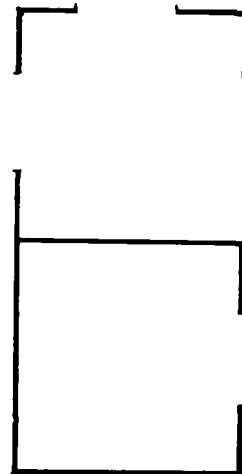B

Significance

This structure is a unique example of a combination well house, ladder and buttry and is one of three embankment structures in the project area. See site AB1304-A for significance of complex.

11. Site Address (Street & No) (Continued)

County Road 81. then southwest on Co. 81 3.0 miles to the site.

ABSTRACT					
HAS NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIS PHOTO
				CONTEMP DRWG	HIS DRWG
				COLOR PLATE	PHOTOGRAPH
				SW	FILM

INT 4575-78

[illegible]

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		A B 1 3 0 4 - C		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification Generator House				5 DATE CA. 1920		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Harper Farm						7 OWNER ADMIN Estate of Douglas Featherstone			
10 STATE		COUNTY NAME		CITY VICINITY		CONG DIST		11 SITE ADDRESS, STREET & NO	
S C		Abbeville		Lowndesville		09		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the	
12 EXISTING SURVEYS		STATE		COUNTY NAME		CITY VICINITY		CONG DIST	
<input type="checkbox"/> NP <input type="checkbox"/> NHE <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLP <input type="checkbox"/> ONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		S C		Greenwood		Greenwood			
13 SPECIAL FEATURE (DESCRIBE BELOW)									
<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONMENTAL INTACT									
14 UTM ZONE		EASTING		NORTHING		SIGN		QUAD NAME	
17		3 4 1 7 4 0 3 7 8 1 1 3 5						Lowndesville, S.C. - GA.	
15 CONDITION		70 EXCELLENT		71 GOOD		72 FAIR		73 DETERIORATED	
70		71		72		73		74 RUINS	
74		75 UNEXPPOSED		76 ALTERED		77 DESTROYED		78 DEMOLISHED	
75		76		77		78		DATE	
16 INVENTORIED BY		AFFILIATION		DATE					
John L. Hopkins, Emily J. Harris		Historic American Buildings Survey		May 1, 1979					

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One-story, balloon frame well or generator house. Gable roof covered with sheetmetal; vertical sheathing and clapboard siding, lattice door. One room containing concrete foundation for heavy equipment, pieces of electrical equipment on walls. The structure is well preserved. It is one of ten structures remaining from the Harper Farm Complex (See Site AB1304-A for general comments).

18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
Generator House		Abandoned			
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER					
Unknown					

20 URBAN AREA 50,000 POP OR MORE?		21 NCRS Region		22 PUBLIC ACCESSIBILITY		23 EDITOR	
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN				INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT?		NAME		DISTRICT ID NO			
<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO							

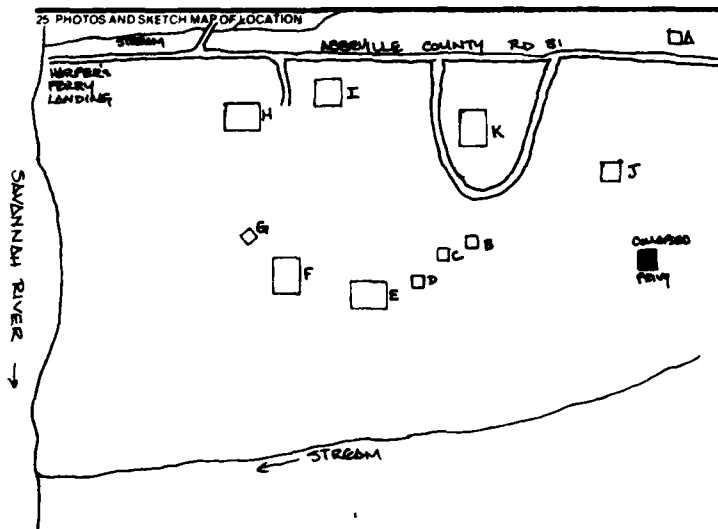

C.

NO MEASUREMENTS TAKEN
OF THIS STRUCTURE.

Significance
See Site AB1304-A

11. (continued) intersection with Abbeville County Road 81, then southwest on Co. 81 3.0 miles to the site.

ABSTRACT																				
HA	AND	LC	TECH	REPORT	HIST	REPORT	CONTEMP	PHOTO	HIST	PHOTO	CONTEMP	DRWG	HIST	DRWG	COLOR	PLATE	PHOTO	GRAM	SW	FILM

INT 4575-78
100 000000 000

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		A B 1 3 0 4 - D		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification Pig House				5 DATE CA. 1930		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
8 NAME(S) OF STRUCTURE Harper Farm						7 OWNER ADMIN Estate of Douglas Featherstone			
10 STATE S C		COUNTY NAME Abbeville		CITY VICINITY Lowndesville		CONG DIST 09		STATE S C	
11 SITE ADDRESS, STREET & NO. Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to						12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES, DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT	
14 UTM ZONE 17		EASTING 341740		NORTHING 3781135		SIGN		SCALE 1:24 1:62.5 OTHER	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input checked="" type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED								QUAD NAME Lowndesville, S.C. - GA.	
16 INVENTORIED BY John L. Hopkins, Emily J. Harris				AFFILIATION Historic American Buildings Survey		DATE May 1, 1979			
17 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS; EXTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.) A-frame pig house. Gable roof covered with sheetmetal; horizontal sheathing; no foundation. This structure is quite overgrown and has suffered some deterioration. It is one of ten structures remaining from the Harper Farm Complex. (See Site AB1304-A for general comments.)									

(CONT OVER)

18 ORIGINAL USE Pig House		PRESENT USE Abandoned		ADAPTIVE USE	
19 REFERENCES—HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER Unknown					

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES, LIMITED <input type="checkbox"/> YES, UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO			

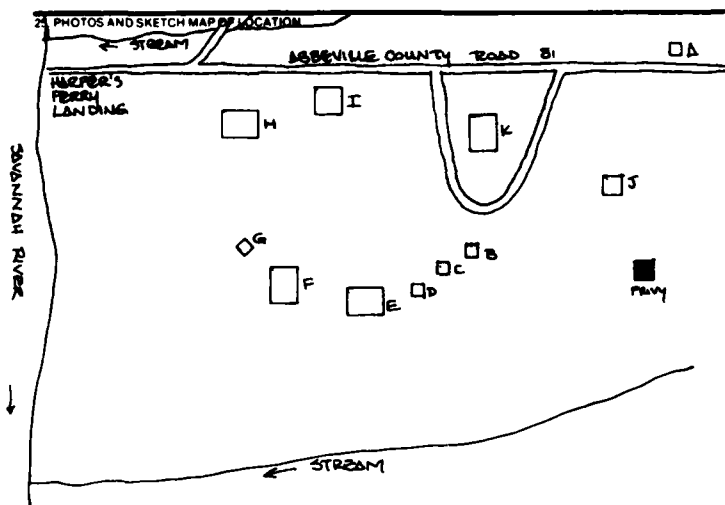

D.
NO MEASUREMENTS TAKEN OF
THIS STRUCTURE, DUE
TO EXTREME OVERGROWTH.

Significance

See Site AB1304-A.

11. (continued) the intersection with Abbeville County Road 81, then southwest on Co. 81 3.0 miles to the site.

ABSTRACT																			
HAZ NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								


INT 4575-78
110 000000 000

FHR-8-230 June 1978

OAHIP INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 4 - E		3 PRIORITY		4 DANGER OF DEMOLITION? -SPECIFY THREAT		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN			
Classification Barn				5 DATE CA. 1850		6 GOVT SOURCE OF THREAT		OWNER ADMIN			
NAME OF STRUCTURE Harper Farm						7 OWNER ADMIN Estate of Douglas Featherstone		8 OWNER'S ADDRESS c/o R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646			
9 STATE S C		COUNTY NAME Abbeville		CITY VICINITY Lowndesville		CONG DIST 0 9		10 STATE S C			
11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81,		12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER - I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES - DESCRIBE BELOW <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT		14 UTM ZONE 1 7		EASTING 3 4 1 6 6 0		NORTHING 3 7 8 1 1 2 5	
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED		16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey		DATE May 1, 1979					
17 DESCRIPTION AND BACKGROUND HISTORY (INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS EXANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC) Three story, hewn frame embankment barn with balloon frame shed additions at both ends, 60' x 30'. Gable and gable-end shed roofs covered with sheetmetal; sheetmetal over clapboard siding; foundations of log and fieldstone granite piers. Two upper floors originally used for storage of hay and feed, and contain original grain bins with original hardware in place, later cribbed lofts for hay storage; lower floor used for dairy cattle and contains pens, six stanchions and concrete feed trough. The structure is well preserved. It is one of ten remaining structures in the Harper Farm Complex. (See Site AB1304-A for general comments.)											
(CONT OVER)											
18 ORIGINAL USE Barn		PRESENT USE Abandoned		ADAPTIVE USE							
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown											
(CONT OVER)											
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region []		22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER					
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO							

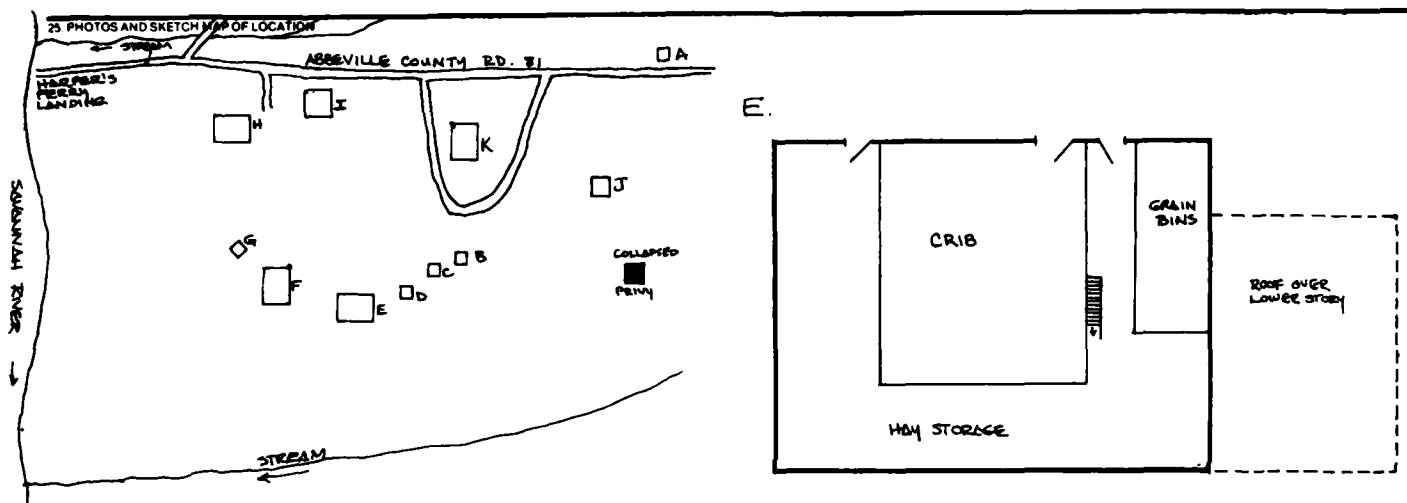

Significance

This unusually large barn is one of three embankment structures in the project area. See Site AB1304-A for for significance of complex.

REFERENCES

11. (continued) then Southwest on Co. 81 3.0 miles to the site.

ABSTRACT																			
MAF NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78

FHR-8-230 June 1978

1 SITE ID NO

A B 1 3 0 4 - F

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification

Barn

3 PRIORITY

4 DANGER OF DEMOLITION?
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN

Corps of Engineers (Demolition)

5 DATE

CA. 1830

6 GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER ADMIN

Estate of Douglas Featherstone

8 NAME(S) OF STRUCTURE

Harper Farm

9 OWNER'S ADDRESS

c/o R. B. Curry, Jr.
201 N. Main Street
Greenwood, South Carolina 29646

10 STATE

S C

COUNTY NAME

Abbeville

CITY/VICINITY

Lowndesville

CONG

DIST

09

STATE

S C

COUNTY NAME

Greenwood

CITY/VICINITY

Greenwood

CONG

DIST

11 SITE ADDRESS (STREET & NO.) Beginning at the intersection of South
Carolina State Highway 81 and Abbeville County Road 65 in
the town of Lowndesville, proceed southwest on Co. 65 3.0
miles to the intersection with Abbeville County Road 81.12 EXISTING
SURVEYS☐ NH☐ NHL☐ HABS☐ HAER☐ HAER☐ NPS☐ CLF

13 SPECIAL FEATURE: DESCRIBE BELOW

☒ INTERIOR INTACT☐ EXTERIOR INTACT☒ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☒ 1:24 ☐ 1:62.5

QUAD

NAME Lowndesville, S.C. - GA.

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

☐ 1:24 ☐ 1:62.5

QUAD

NAME

15 CONDITION

70 ☐ EXCELLENT71 ☐ GOOD72 ☐ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

John L. Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS
MATERIALS EXTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETCLog barn with post and frame shed additions, 35' X 32'. Gable and shed roofs covered with sheetmetal; massive logs
hewn on four sides with one-half dovetail joinery, partially covered with sheetmetal, some original hardware intact;
foundations of brick and fieldstone granite piers. Two rooms with loft, used for hay. The structure is well
preserved, due largely to its sheetmetal covering. It is one of ten structures remaining from the Harper Farm
Complex. (See Site AB1304-A for general comments.)

18 ORIGINAL USE

Hay Barn

PRESENT USE

Abandoned

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

20 URBAN AREA 50,000
POP OR MORE?☐ YES ☒ NO

21 NCAS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?


☐ YES☒ NO

NAME

DISTRICT ID NO

CONT OVER

25 PHOTOS AND SKETCH MAP OF LOCATION

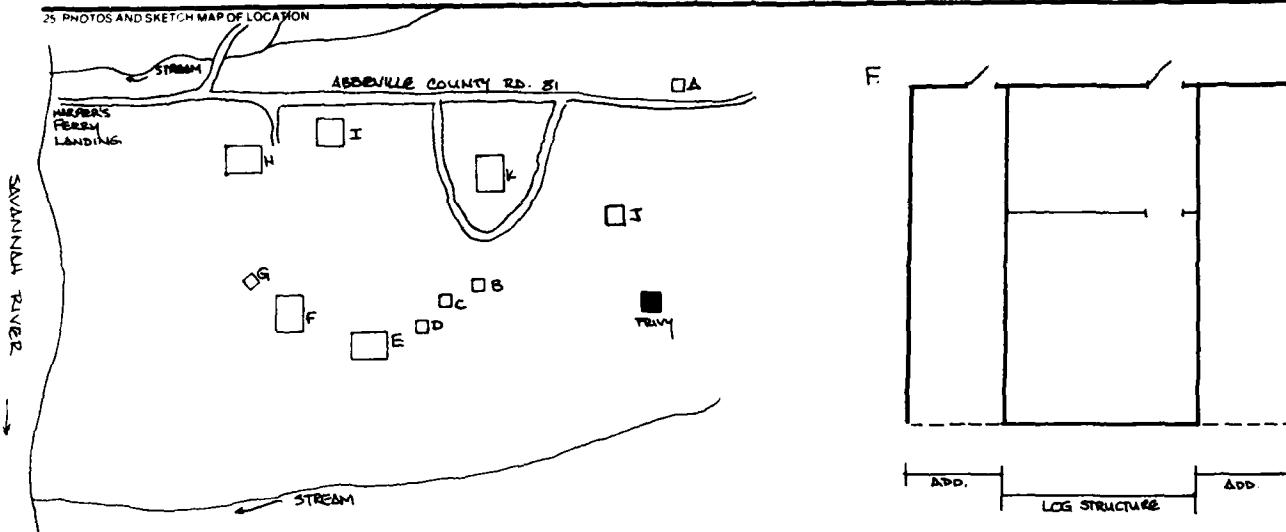

Significance

This fine example of early log construction is probably the oldest standing structure in the Harper Farm Complex. Although log barns and other buildings were common in this area in the nineteenth century, this is one of the relatively few examples that survives intact. See Site AB1304-A for significance of complex.

References

11. (continued) then southwest on Co. 81 3.0 miles to the site.

ABSTRACT																			
HA	NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM							

INT 4575-78

FHR 8 730 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

A B 1 3 0 4 - G										OAHF INVENTORY										Office of Archeology and Historic Preservation Department of the Interior, Washington, D.C. 20240									
Classification Feeding Crib										4 DANGER OF DEMOLITION? (SPECIFY THREAT) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)										6 GOVT SOURCE OF THREAT OWNER <input type="checkbox"/> ADMIN <input type="checkbox"/>									
7 DATE CA. 1900										8 OWNER ADMIN Estate of Douglas Featherstone										9 OWNER'S ADDRESS c/o R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646									
10 STATE S C										11 COUNTY Abbeville										12 CITY/VICINITY Lowndesville									
13 BEGINNING AT THE INTERSECTION OF SOUTH CAROLINA STATE HIGHWAY 81 AND ABBEVILLE COUNTY ROAD 65, PROCEED SOUTHWEST ON Co. 65 3.0 MILES TO THE INTERSECTION OF ABBEVILLE COUNTY ROAD 81, THEN SOUTHWEST ON Co. 81 3.0										14 EXISTING SURVEYS <input type="checkbox"/> NHD <input type="checkbox"/> NHD <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLG <input type="checkbox"/> FONE <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER										15 SPECIAL FEATURE (DESCRIBE BELOW) <input type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT									
16 QUAD NAME 1 7 3 4 1 6 4 0 3 7 8 1 1 3 0										17 QUAD NAME Lowndesville, S.C. - GA.										18 QUAD NAME Lowndesville, S.C. - GA.									
19 INVENTOR John L. Hopkins, Emily J. Harris										20 AFFILIATION Historic American Buildings Survey										21 DATE May 1, 1979									

DESCRIPTION AND BACKGROUND HISTORY, INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTING EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One-story, post-and-frame open-sided feeding crib for cattle. Gable roof covered with sheetmetal. V-shaped arrangement of posts to hold cattle feed. This structure is well preserved. It is one of ten structures remaining from the Harper Farm Complex (See Site AB1304-A for general comments).

(CONT OVER)

18 ORIGINAL USE Cattle Feeding Crib										19 PRESENT USE Abandoned										20 ADAPTIVE USE									
21 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown																													

(CONT OVER)

22 URBAN AREA 50,000 POP OR MORE <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO										23 NEHS Region <input type="checkbox"/> 1 <input type="checkbox"/> 2 <input type="checkbox"/> 3 <input type="checkbox"/> 4 <input type="checkbox"/> 5 <input type="checkbox"/> 6 <input type="checkbox"/> 7 <input type="checkbox"/> 8 <input type="checkbox"/> 9										24 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										25 EDITOR INDEXER									
26 LOCATED IN AN HISTORIC DISTRICT <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO										NAME										DISTRICT ID NO																			

25 PHOTOS AND SKETCH MAP OF LOCATION

A hand-drawn sketch map showing the distribution of 13 photos (A-M) in a field. A horizontal line represents 'ASHEVILLE COUNTY ROAD 81'. To the left of the road, a stream flows left, indicated by an arrow and the word 'STREAM'. Below the road, another stream flows left, also indicated by an arrow and the word 'STREAM'. On the far left, a label reads 'HAGGERS FORD LANDING'. The photos are marked as follows: A (square) is on the road to the right; B (square) is in the upper right; C (square) is in the center right; D (square) is in the center; E (square) is in the center; F (square) is in the center; G (square) is in the center; H (square) is on the left; I (square) is on the left; J (square) is on the right; K (square) is in a pond-like area; L (square) is in the center; M (solid black square) is on the right. The text 'HAGGERS FORD LANDING' is written vertically on the left side of the map.

See Site AB1304-A for general comments.

ABSTRACT																																																											
HAS NO	LC	TECH REPT	HIST REPT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM																																																

INT 4575-78

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 4 - H		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	
2 Classification		Horse Barn		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN	
				CA. 1880					
8 NAME(S) OF STRUCTURE		Harper Farm		9 OWNER'S ADDRESS		c/o R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646			
10 STATE		S C		COUNTY NAME		Abbeville		CITY VICINITY	
COUNTY				VICINITY		Lowndesville		CONG DIST	
11 SITE ADDRESS (STREET & NO.)		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.		12 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER-I <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6			
13 SPECIAL FEATURE: DESCRIBE BELOW				<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT					
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 4 1 6 4 0		3 7 8 1 1 3 5				1:24 1:62.5	
UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
								1:24 1:12.5	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT 71 <input checked="" type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED		74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED					
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
								May 1, 1979	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS									
Sawn frame horse barn with post-and-frame shed additions, 50' x 36'. Gable and shed roofs covered with sheetmetal; vertical sheathing on exterior walls; foundations of fieldstone granite piers. Interior pens and frame crib stalls constructed of stacked horizontal frame members joined by one-half dovetails; original tack equipment and hardware intact; some graffiti, such as names and dates, carved in interior walls. The building is well preserved. It is one of ten structures remaining from the Harper Farm Complex. (See Site AB1304-A for general comments.)									

(CONT OVER)


18 ORIGINAL USE		PRESENT USE		ADAPTIVE USE	
Horse Barn		Abandoned			
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER					
Unknown					

(CONT OVER)

20 URBAN AREA 50 000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCRS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO					

25 PHOTOS AND SKETCH MAP OF LOCATION

25 PHOTOS AND SKETCH MAP OF LOCATION

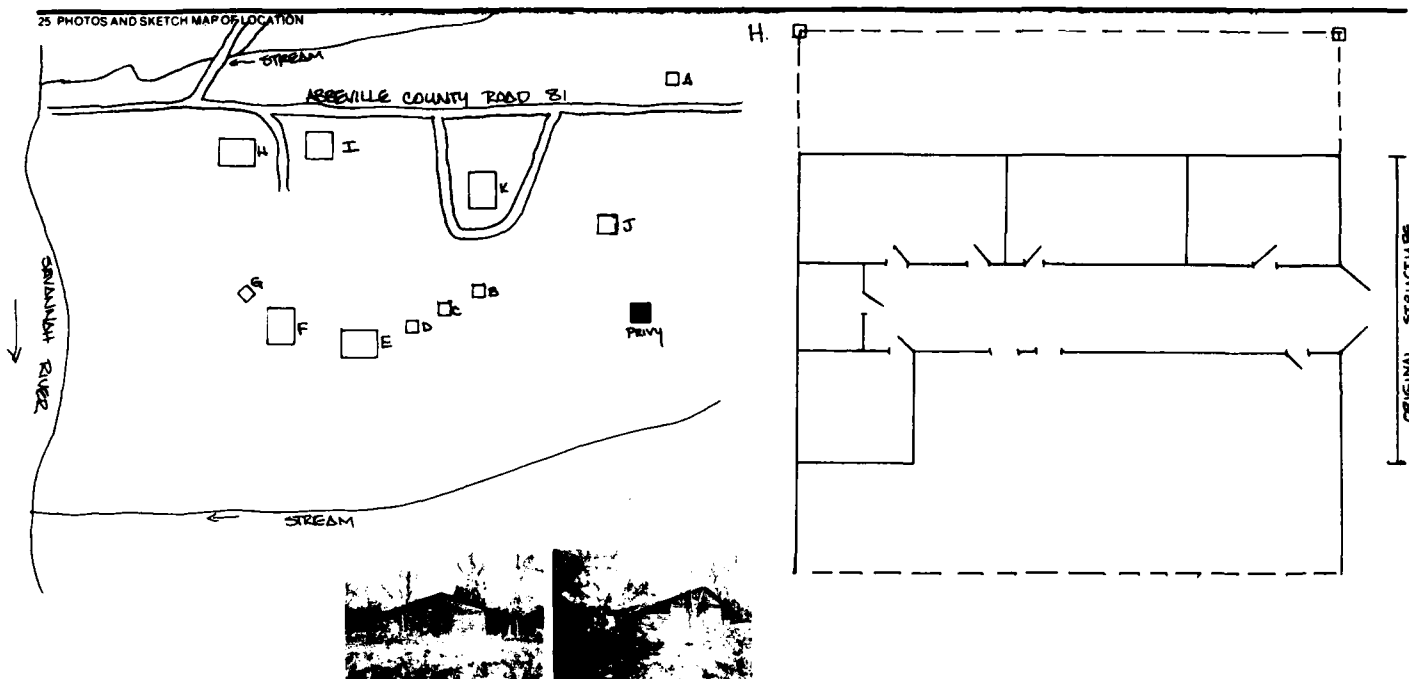

Significance


The use of one-half dovetail joinery in constructing frame stalls makes this structure unique. This joinery method was employed in early log construction, but there are no other examples of its use with frame members in the project area, nor has it been documented in the surrounding region. See Site AB1304-A for significance of complex.

Recommendations

11. (continued) then southwest on Co. 81 3.0 miles to the site.

ABSTRACT																			
HATCH NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

TNT 4575-78

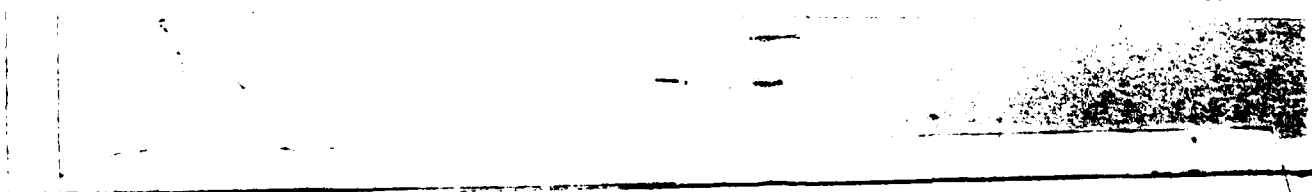

FHR-8-730 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										A B 1 3 0 4 - I									
2 Classification Garage										3 PRIORITY									
4 DANGER OF DEMOLITION (SPECIFY THREAT)										5 DATE CA. 1930									
6 GOVT SOURCE OF THREAT										7 OWNER ADMIN Estate of Douglas Featherstone									
8 NAME OF STRUCTURE Harper Farm										9 OWNER'S ADDRESS c/o R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646									
10 STATE S C COUNTY NAME Abbeville CITY VICINITY Lowndesville CONG DIST										11 STATE S C COUNTY NAME Greenwood CITY VICINITY Greenwood CONG DIST									
12 EXISTING SURVEYS										13 SPECIAL FEATURES DESCRIBE BELOW:									
14 UTM ZONE EASTING NORTHING SIGN SCALE										15 CONDITION									
16 INVENTORIED BY										17 DESCRIPTION AND BACKGROUND HISTORY									

Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the



Post-and-frame truck garage. Gable roof covered with sheetmetal; walls of horizontal sheathing. This structure is well preserved. It is one of ten structures remaining from the Harper Farm Complex. (See Site AB1304-A for general comments.)

(CONT OVER)

18 ORIGINAL USE Garage										PRESENT USE Abandoned										ADAPTIVE USE																													
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER Unknown										20 URBAN AREA 50,000 POP OR MORE?										21 NCAS Region										22 PUBLIC ACCESSIBILITY										23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT?										25 YES LIMITED										26 YES UNLIMITED										27 UNKNOWN										DISTRICT ID NO									

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

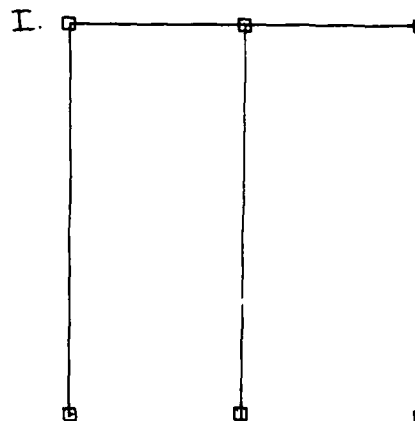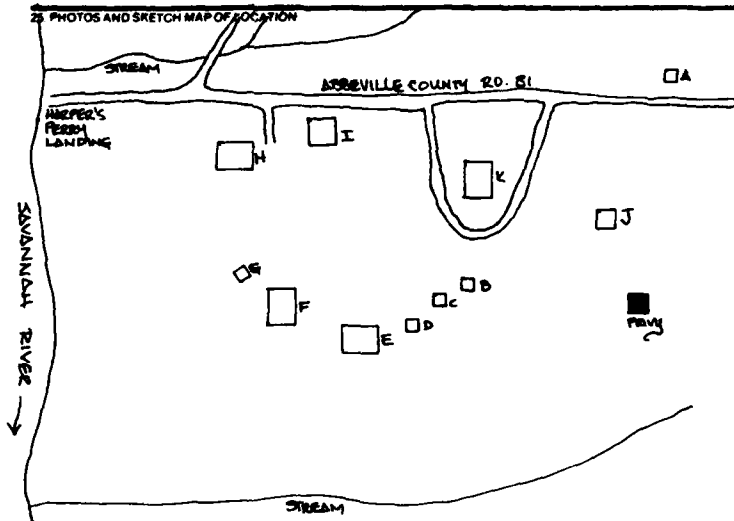

Significance

See Site AB1304-A for general comments.

11. (continued)

intersection with Abberville County Road 81, then southwest on Co. 81 3.0 miles to the site.

ABSTRACT																			
HAER NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11 11

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		A B 1 3 0 4 - J		3 PRIORITY		4 DANGER OF DEMOLITION* (SPECIFY THREAT)		<input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
2 Classification		Garage		5 DATE		6 GOVT SOURCE OF THREAT		OWNER ADMIN [] [] [] [] [] [] [] [] [] []	
8 NAME(S) OF STRUCTURE		Harper Farm		9 OWNER'S ADDRESS		Estate of Douglas Featherstone c/o R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646			
10 STATE		S C		COUNTY NAME		Abbeville		CITY VICINITY	
COUNTY		[] [] [] [] [] [] [] [] [] []		CONG DIST		[] [] [] [] [] [] [] [] [] []		[] [] [] [] [] [] [] [] [] []	
11 SITE ADDRESS (STREET & NO.)		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to		12 EXISTING SURVEYS		<input type="checkbox"/> NHP <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		13 SPECIAL FEATURES: DESCRIBE BELOW	
14 UTM ZONE		EASTING		NORTHING		SIGN		SCALE	
1 7		3 4 1 7 7 0		3 7 8 1 1 4 0		[] [] [] [] [] [] [] [] [] []		<input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5 <input type="checkbox"/> OTHER	
UTM ZONE		EASTING		NORTHING		SIGN		QUAD NAME	
[] [] [] [] [] [] [] [] [] []		[] [] [] [] [] [] [] [] [] []		[] [] [] [] [] [] [] [] [] []		[] [] [] [] [] [] [] [] [] []		Lowndesville, S.C. - GA.	
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input type="checkbox"/> GOOD		72 <input checked="" type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED	
74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		82 <input type="checkbox"/> DESTROYED		85 <input type="checkbox"/> DEMOLISHED	
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC								May 1, 1979	

One-story post-and-frame, one-car garage. Gable roof covered with sheetmetal; board and batten siding. This structure is quite overgrown, but appears to be relatively well preserved. It is one of ten structures remaining from the Harper Farm Complex. (See Site AB1304-A for general comments.)

18 ORIGINAL USE		Garage		PRESENT USE		Abandoned		ADAPTIVE USE	
19 REFERENCES—HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER		Unknown							

20 URBAN AREA 50 000 POP OR MORE?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR	
24 LOCATED IN AN HISTORIC DISTRICT?		<input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO		INDEXER	

25 PHOTOS AND SKETCH MAP OF LOCATION

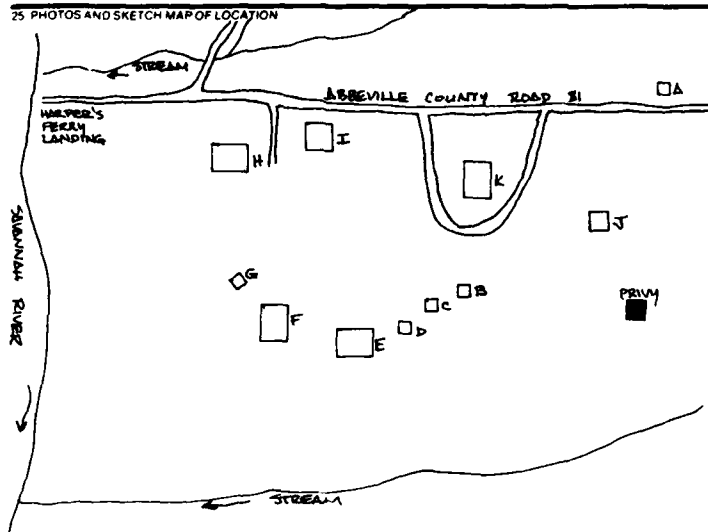

J.
NO MEASUREMENTS TAKEN OF THIS
STRUCTURE DUE TO EXTREME
OVERGROWTH.

Significance

See Site AB1304-A.

RESEARCH AND DEVELOPMENT

11. (continued) the intersection with Abbeville County Road 81, then southwest on Co. 81 3.0 miles to the site.

ABSTRACT																			
HAS NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
HQS 000000 0000

FHR-8-230 June 1978

1 SITE ID NO **A B 1 3 0 4 - K****OAHP INVENTORY**Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


2 Classification Ruin of Residence		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT) <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN Corps of Engineers (Demolition)	
		5 DATE CA. 1810-1820		6 GOVT SOURCE OF THREAT OWNER <input type="checkbox"/> ADMIN <input type="checkbox"/>	
8 NAME OF STRUCTURE Harper House		7 OWNER/ADMIN Estate of Douglas Featherstone			
9 OWNER'S ADDRESS c/o R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646					
10 STATE COUNTY S C	COUNTY NAME Abbeville	CITY/VICINITY Lowndesville	CONG DIST <input type="checkbox"/>	STATE COUNTY S C	CITY/VICINITY Greenwood
11 SITE ADDRESS (STREET & NO) Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.			12 EXISTING SURVEYS <input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER		
13 SPECIAL FEATURES: DESCRIBE BELOW <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input checked="" type="checkbox"/> ENVIRONS INTACT					
14 UTM ZONE 17	EASTING 341760	NORTHING 3781175	SIGN <input type="checkbox"/>	SCALE <input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5	QUAD NAME Lowndesville, S.C. - GA
UTM ZONE	EASTING	NORTHING	SIGN	SCALE <input type="checkbox"/> 1:24 <input type="checkbox"/> 1:62.5	QUAD NAME
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input checked="" type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED					
16 INVENTORIED BY John L. Hopkins, Emily J. Harris			AFFILIATION Historic American Buildings Survey		DATE May 1, 1979
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXISTANT EQUIPMENT AND IMPORTANT BUILDERS, ENGINEERS, ETC.					

This site contains the archaeological remains of the Harper Farm House, destroyed CA. 1974 by fire. The structure was a two-story log house, possibly dating CA. 1810-1820. The two brick chimneys are laid in common bond with a relieving arch over the fireplace openings to distribute the weight of the brick above. The size of the chimneys gives an impression of the large scale of the original home. The site is associated with ten outbuildings. (See Site AB1304-A for general comments.)

18 ORIGINAL USE Residence		PRESENT USE Ruins		ADAPTIVE USE	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown					
20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region <input type="checkbox"/>	22 PUBLIC ACCESSIBILITY <input checked="" type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO	

(CONT OVER)

(CONT OVER)

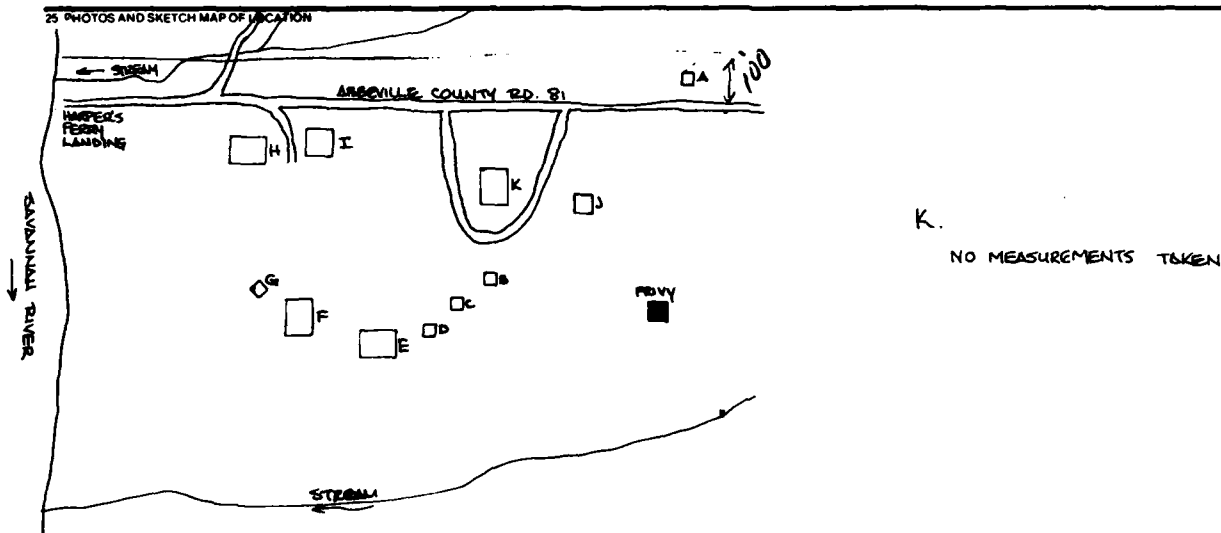

Significance

These remains were included in this inventory to lend a sense of completion to the Harper Farm Complex of which ten outbuildings survive. The two chimneys exhibit an unusual construction technique for this region, with a brick relieving arch over the fireplace openings. This is the only known example of this form of brick construction in the project area. See Site AB1304-A for significance of this complex.

11. (continued) then southwest on Co. 81 3.0 miles to the site.

ABSTRACT											
HAER NO	LC	TECH REPORT	HIST REPORT	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM

INT 4575-78
1100 1100000000

FHR-8-230 June 1978

1 SITE ID NO **A B 1 3 0 4 - 2 A****OAHF INVENTORY**Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 202402 Classification
Residence

3 PRIORITY

4 DANGER OF DEMOLITION?
(SPECIFY THREAT)☒ YES ☐ NO ☐ UNKNOWN
Corps of Engineers (Demolition)

5 DATE

CA. 1825-1835

6

GOVT SOURCE OF THREAT

OWNER

ADMIN

7 OWNER ADMIN

Estate of Douglas Featherstone

8 NAME(S) OF STRUCTURE

Residence

9 OWNER'S ADDRESS

c/o Mr. R. B. Curry, Jr.**201 N. Main St.****Greenwood, South Carolina 29646**10 STATE
COUNTY**S C**

COUNTY NAME

Abbeville

VICINITY

Lowndesville

CONG

DIST

STATE

S C

COUNTY NAME

Greenwood

CITY

Greenwood

CONG

DIST

11 SITE ADDRESS (STREET & NO.) **Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.**

12 EXISTING SURVEYS

☐ NPL☐ HABS☐ HAER☐ HAER☐ NPS☐ CLK

13 SPECIAL FEATURE: DESCRIBE BELOW

☒ INTERIOR INTACT☒ EXTERIOR INTACT☐ ENVIRONS INTACT

14 UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

QUAD NAME

Lowndesville, S.C. - GA

UTM ZONE

EASTING

NORTHING

SIGN

SCALE

1:24

1:62.5

QUAD NAME

15 CONDITION

70 ☐ EXCELLENT71 ☒ GOOD72 ☐ FAIR73 ☐ DETERIORATED74 ☐ RUINS75 ☐ UNEXPOSED76 ☐ ALTERED82 ☐ DESTROYED85 ☐ DEMOLISHED

16 INVENTORIED BY

John L. Hopkins, Emily J. Harris

AFFILIATION

Historic American Buildings Survey

DATE

May 1, 1979

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS; MATERIALS; EXISTANT EQUIPMENT AND IMPORTANT BUILDERS ENGINEERS ETC.

One-story log cabin with frame addition, 32' (two bays) X 18' (one bay). Gable roof covered with sheetmetal, boxed eaves; logs hewn on four sides, one-half dovetail joinery, horizontal battens cover some open spaces between logs, gap in end wall indicates collapsed or removed chimney, windows of no lights covered with board shutters, vertical board door, original door frame pegged into butt ends of logs, clapboard siding on frame addition and gable ends; foundations of massive hewn logs and fieldstone granite piers. Original plan of one room with one room addition. This structure is somewhat deteriorated but restoration and preservation could be accomplished with little difficulty. The structure is associated with a balloon-frame cattle barn, CA. 1940 (Site AB1304-2B), and is probably associated with the Harper Farm Complex (Site AB1304).

(CONT OVER)

18 ORIGINAL USE

Residence

PRESENT USE

Abandoned Storage Barn

ADAPTIVE USE

19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER

Unknown

(CONT OVER)

20 URBAN AREA 50,000 POP OR MORE?

☐ YES ☒ NO

21 NCRS Region

22 PUBLIC ACCESSIBILITY

☐ YES LIMITED☐ YES UNLIMITED☒ NO☐ UNKNOWN

23 EDITOR

INDEXER

24 LOCATED IN AN HISTORIC DISTRICT?

☐ YES☒ NO

NAME

DISTRICT ID NO

1

2



3

4

5

6

25 PHOTOS AND SKETCH MAP OF LOCATION

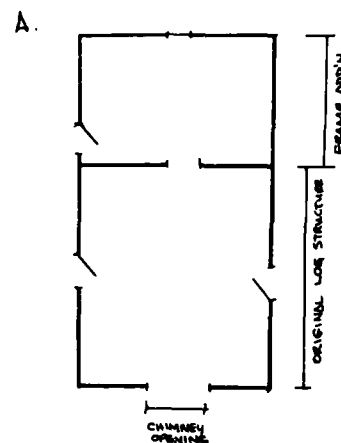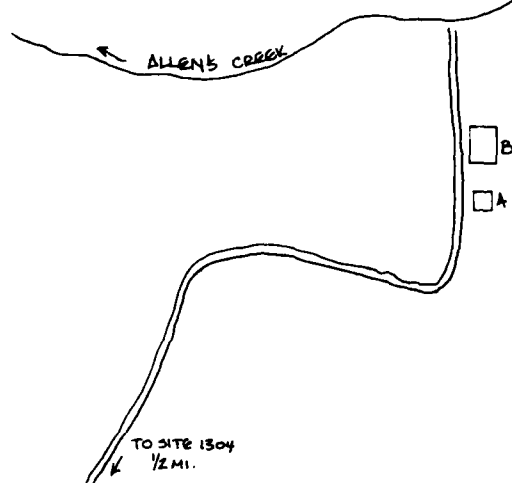

Significance

Significance
It is possible that this small one-room log cabin was constructed as a slave quarters or other dependency for the Harper Farm (Site AB1304), and later moved to its present location. The age, size and construction methods of the original structure closely parallel those of site AB1304-3A, which may indicate that the two buildings were related and/or had similar uses. The addition to the log structure and its use for hay storage make it a good example of the ways in which farm structures were adapted to changing needs.

[illegible]

11. (continued) then southwest on Co. 81 3.1 miles to an unpaved private dirt road, then northeast .6 mile to the site.

[illegible]

INT 4575-71

FHR-8-730 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		A B 1 3 0 4 - 2 B		2 CLASSIFICATION		Barn		3 PRIORITY		4 DANGER OF DEMOLITION (SPECIFY THREAT)		5 YES <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN <input type="checkbox"/>		6 GOVT SOURCE OF THREAT		OWNER		ADMIN													
								CA. 1940				Corps of Engineers (Demolition)																			
7 NAME OF SITE STRUCTURE		Barn		8 OWNER'S ADDRESS		c/o Mr. R. B. Curry 201 N. Main Street Greenwood, South Carolina 29646																									
9 STATE		S C		COUNTY NAME		Abbeville		CITY VICINITY		Lowndesville		CONG DIST		0 9		STATE		S C		COUNTY NAME		Greenwood		CITY VICINITY		Greenwood		CONG DIST			
10 SITE ADDRESS, STREET & NO		Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.		11 EXISTING SURVEYS		<input type="checkbox"/> NR <input type="checkbox"/> VHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6		12 SPECIAL FEATURES (DESCRIBE BELOW)		<input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT																					
13 UTM ZONE		1 7		EASTING		3 4 1 8 1 5		NORTHING		3 7 8 1 9 1 5		SIGN		SCALE		<input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:24		QUAD NAME		Lowndesville, S.C. - GA.											
14 UTM ZONE				EASTING				NORTHING				SIGN		SCALE		<input type="checkbox"/> 1:24 <input type="checkbox"/> 1:24		QUAD NAME													
15 CONDITION		70 <input type="checkbox"/> EXCELLENT		71 <input checked="" type="checkbox"/> GOOD		72 <input type="checkbox"/> FAIR		73 <input type="checkbox"/> DETERIORATED		74 <input type="checkbox"/> RUINS		75 <input type="checkbox"/> UNEXPOSED		76 <input type="checkbox"/> ALTERED		80 <input type="checkbox"/> DESTROYED		85 <input type="checkbox"/> DEMOLISHED													
16 INVENTORIED BY		John L. Hopkins, Emily J. Harris		AFFILIATION		Historic American Buildings Survey		DATE		May 1, 1979																					

17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.

One-story balloon frame cattle barn, 80' X 37'. Gable roof covered with sheetmetal; horizontal board sheathing with boards near eaves spaced for ventilation; foundations of fieldstone granite piers. Interior divided lengthwise into two areas for cattle stalls, manger on one side. This building is relatively well preserved. It is associated with a log cabin converted into a hay barn (Site AB1304-2A), and may be associated with the Harper Farm Complex (Site AB1304).

18 ORIGINAL USE		Barn		PRESENT USE		Abandoned		ADAPTIVE USE				(CONT OVER)	
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER													
Unknown													

20 URBAN AREA 50,000 POP OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		21 NCAS Region		22 PUBLIC ACCESSIBILITY		<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN		23 EDITOR INDEXER				(CONT OVER)	
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		NAME		DISTRICT ID NO									

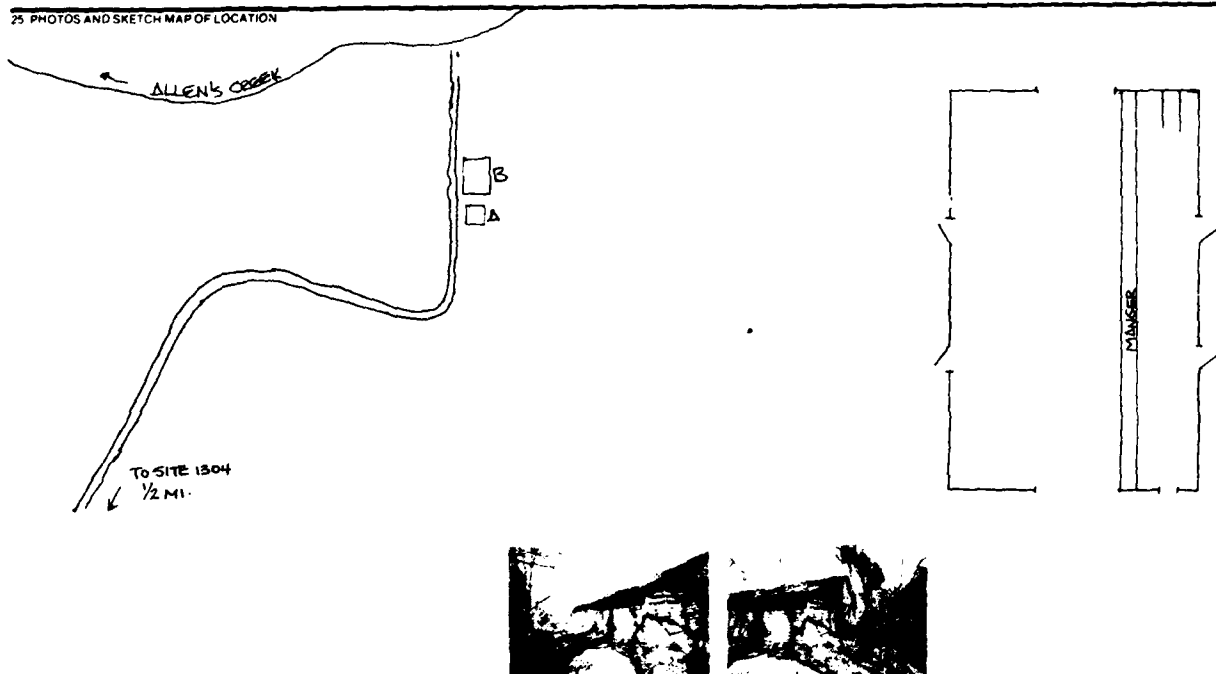

Significance

This structure displays the characteristics of a modern farm outbuilding. Its relationship to Site ABL304-2A, a log cabin adapted as a hay barn and to the Harper Farm Complex, demonstrates the continual evolution of the Southern farm.

RESEARCH DESIGN

11. (continued) then southwest on Co. 81 3.1 miles to an unpaved private road, then northeast .6 mile to the site.

[illegible]

AD-A138 418

ALL THAT REMAINS THE TRADITIONAL ARCHITECTURE AND
HISTORIC ENGINEERING ST..(U) NATIONAL PARK SERVICE
ATLANTA GA ARCHEOLOGICAL SERVICES BRANC.. L H WORTHY

UNCLASSIFIED 1983


F/G 5/6

NL

3/3



END
DATE
FILMED
3 84
DTIC

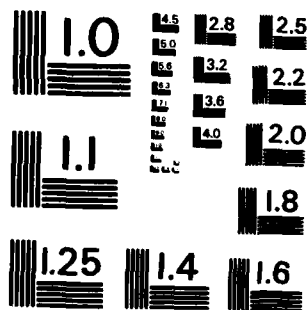

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

OAHF INVENTORY



Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO		A B 1 3 0 4 - 3 A											
2 Classification		3 PRIORITY		4 DANGER OF DEMOLITION? SPECIFY THREAT									
Residence				Corps of Engineers (Demolition)									
		5 DATE		6 GOVT SOURCE OF THREAT									
		CA. 1830-1840		OWNER ADMIN									
				Estate of Douglas Featherstone									
8 NAME(S) OF STRUCTURE		9 OWNER'S ADDRESS											
Residence		c/o Mr. R. B. Curry, Jr. 201 N. Main Street Greenwood, South Carolina 29646											
10 STATE		COUNTY NAME		VICINITY		CONG DIST		STATE		COUNTY NAME		CITY	
S C		Abbeville		Lowndesville				S C		Greenwood		Greenwood	
11 SITE ADDRESS: STREET & NO.													
Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.													
12 EXISTING SURVEYS													
13 SPECIAL FEATURES: DESCRIBE BELOW													
14 UTM ZONE EASTING NORTHING SIGN SCALE QUAD NAME													
15 CONDITION													
16 INVENTORIED BY													
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S); HISTORICAL DATE(S); PHYSICAL DIMENSIONS													
18 ORIGINAL USE													
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER													
20 URBAN AREA 50,000 POP OR MORE?													
21 LOCATED IN AN HISTORIC DISTRICT?													
22 PUBLIC ACCESSIBILITY													
23 EDITOR													

(CONT OVER)

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

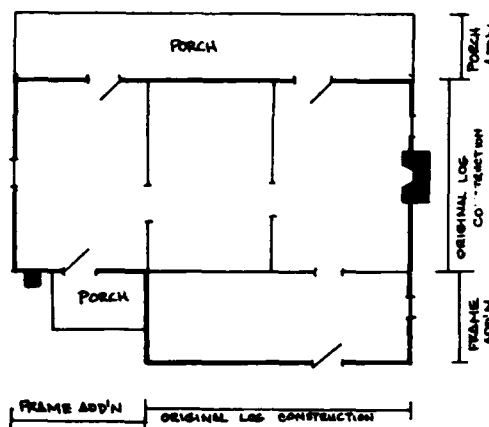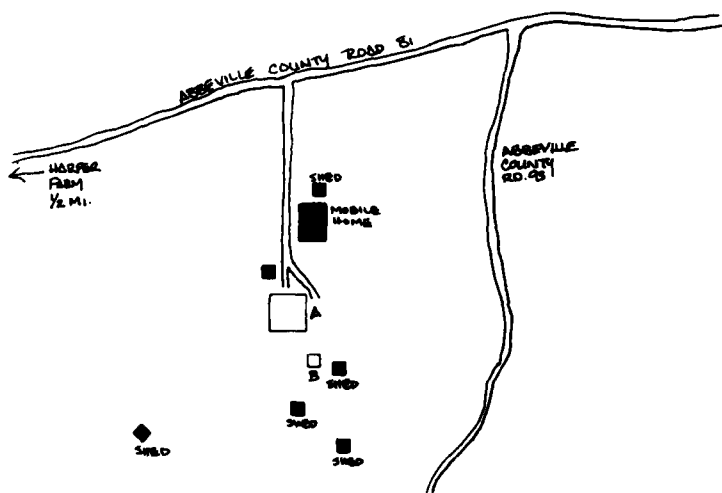

Significance
This small dwelling is a fine example of an early one-room log cabin, later adapted for continued use. It is possible that this structure was constructed as a slave quarters or other dependency for the Harper Farm (Site AB1304), and later moved to its present location. The age, size and construction methods of the original structure closely parallel those of Site AB1304-2A, which may indicate that the two buildings were related and/or had similar uses.

Access
11. (continued) then southwest on Co. 81 2.2 miles to an unpaved private drive then south on the unpaved private drive then south on the unpaved drive .1 mile to the site.

ABSTRACT																			
HA	NO	LC	TECH	REPORT	HIST	REPORT	CONTEMP	PHOTO	HIST	PHOTO	CONTEMP	DRWG	HIST	DRWG	COLOR	PLAYE	PHOTO	GRAM	SW

INT 4575-78
NEW BRIDGE

FHR-8-230 June 1978

1 SITE ID NO **A B 1 3 0 4 - 3 B****OAHF INVENTORY**Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

2 Classification Shed		3 PRIORITY	4 DANGER OF DEMOLITION? (SPECIFY THREAT) Corps of Engineers (Demolition)
		5 DATE CA. 1900	6 GOVT SOURCE OF THREAT OWNER ADMIN
		7 OWNER ADMIN Estate of Douglas Featherstone	
8 NAME(S) OF STRUCTURE Shed		9 OWNER'S ADDRESS c/o R. B. Curry 201 N. Main Street Greenwood, South Carolina 29646	
10 STATE SC	COUNTY NAME Abbeville	CONG DIST 09	CITY/TOWNSHIP Greenwood
11 SITE ADDRESS STREET & NO. Beginning at the intersection of South Carolina State Highway 81 and Abbeville County Road 65 in the town of Lowndesville, proceed southwest on Co. 65 3.0 miles to the intersection with Abbeville County Road 81.		12 EXISTING SURVEYS <input type="checkbox"/> NPL <input type="checkbox"/> NML <input type="checkbox"/> HABS <input type="checkbox"/> HAER-1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> FLS <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER	
13 SPECIAL FEATURES (DESCRIBE BELOW) <input checked="" type="checkbox"/> INTERIOR INTACT <input checked="" type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT			
14 UTM ZONE 17	EASTING 342735	NORTHING 3781525	SCALE <input checked="" type="checkbox"/> 1:24 <input type="checkbox"/> 1:624
15 CONDITION <input type="checkbox"/> EXCELLENT <input checked="" type="checkbox"/> GOOD <input type="checkbox"/> FAIR <input type="checkbox"/> DETERIORATED <input type="checkbox"/> RUINS <input type="checkbox"/> UNEXPOSED <input type="checkbox"/> ALTERED <input type="checkbox"/> DESTROYED <input type="checkbox"/> DEMOLISHED	QUAD NAME Lowndesville, S.C. - GA		
16 INVENTORIED BY John L. Hopkins, Emily J. Harris		AFFILIATION Historic American Buildings Survey	
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC. Log shed, 10' (one bay) X 12'. Gable roof covered with sheetmetal, small unhewn logs, V-notch joinery, horizontal sheathing covering spaces between logs, clapboard on gable end; foundations of logs directly on ground partially supported by bricks and fieldstone granite. Plan of one room. This structure is well preserved. It is associated with Site AB1304-3A, a log cabin with frame additions, and six other structures that are extremely deteriorated and overgrown, most of which date after 1940.		DATE May 1, 1979	



(CONT OVER)

18 ORIGINAL USE Storage Shed	PRESENT USE Abandoned	ADAPTIVE USE
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS AND/OR OTHER Unknown		

(CONT OVER)

20 URBAN AREA 50,000 POP. OR MORE? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO	21 NCRS Region 1	22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input checked="" type="checkbox"/> NO <input type="checkbox"/> UNKNOWN	23 EDITOR INDEXER
24 LOCATED IN AN HISTORIC DISTRICT? <input type="checkbox"/> YES <input checked="" type="checkbox"/> NO		DISTRICT ID NO	

25 PHOTOS AND SKETCH MAP OF LOCATION

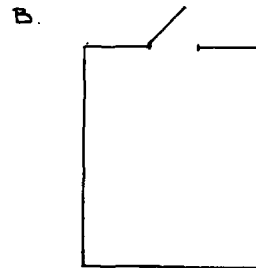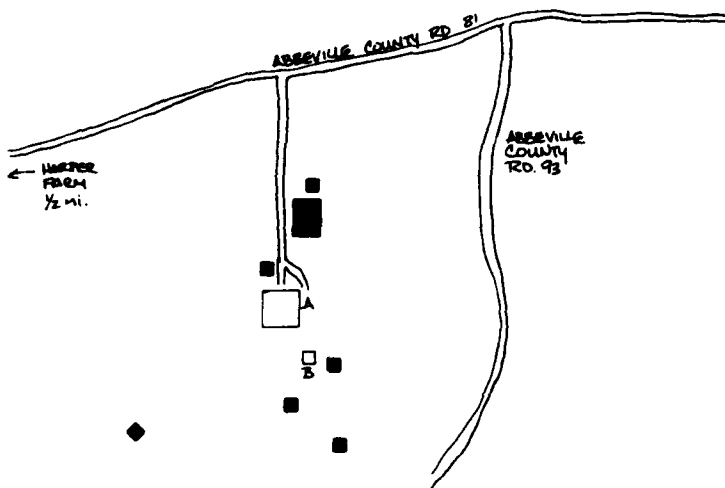

Significance

This small shed exemplifies the survival of log construction techniques in the late nineteenth and early twentieth centuries. The late date is indicated by the use of V-notch joinery.

11. (continued) then southwest on Co. 81 2.2 miles to an unpaved private drive, then south on the unpaved drive .1 mile to the site.

ABSTRACT																			
HAZ. NO.	LC	TECH. REPORT	HIST. REPORT	CONTEMP. PHOTO	HIST. PHOTO	CONTEMP. DRAWG	HIST. DRAWG	COLOR. PLATE	PHOTOGRAM	SW	FILM								

INT 4575-78
1100 4575-78

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO										2 PRIORITY										3 DANGER OF DEMOLITION (SPECIFY THREAT)									
4 Classification Spec. Struc. (Dam)										7 9 5 0										6 GOVT SOURCE OF THREAT OWNER ADMIN									
5 DATE										1940										7 OWNER ADMIN City of Abbeville, S.C.									
8 NAME OF STRUCTURE Lake Secession Dam										9 OWNER'S ADDRESS City Hall Abbeville, S.C.																			
10 STATE S C										COUNTY NAME Abbeville										CITY VICINITY Abbeville									
11 SITE ADDRESS (STREET & NO) Beginning at the intersection of South Carolina State Highway 281 and Abbeville County Road 72, proceed west on Co. 72 3.2 miles to the site located across the Rocky River.										12 EXISTING SURVEYS <input type="checkbox"/> NPS <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CLR										13 SPECIAL FEATURES (DESCRIBE BELOW) <input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT									
14 UTM ZONE 17										EASTING 3511800										NORTHING 3791680									
15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOL										16 INVENTORIED BY JLH, FJH, DCJ										AFFILIATION HABS/HAER									
17 DESCRIPTION AND BACKGROUND HISTORY INCLUDING CONSTRUCTION DATE(S), HISTORICAL DATE(S), PHYSICAL DIMENSIONS, MATERIALS, EXTANT EQUIPMENT, AND IMPORTANT BUILDERS, ENGINEERS, ETC.										18 ORIGINAL USE Dam										PRESENT USE Dam									
19 REFERENCES - HISTORICAL REFERENCES, PERSONAL CONTACTS, AND/OR OTHER										20 URBAN AREA 50,000 POP. OR MORE <input type="checkbox"/> YES <input type="checkbox"/> NO										21 NCRS Region									
22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR INDEXER																			
24 LOCATED IN AN HISTORIC DISTRICT <input type="checkbox"/> YES <input type="checkbox"/> NO										NAME										DISTRICT ID NO									

Constructed in 1940, the Secession Lake Dam is a reinforced concrete multiple arch dam 85 feet high and 370 feet long. The structure consists of nine arch-rings supported on ten buttresses. The dam was built by J. Ray Pennell Co. for the city of Abbeville. The lake has a capacity of 90,000 acre feet and the dam is used for hydroelectric power. The reinforced concrete multiple arch dam was first built in California in 1908 and was an important American development in dam design subsequently used throughout the Americas, Europe and Asia. The Secession Lake Dam is an excellent example of the structural form and the only one of its type known to exist in South Carolina.

Register of Dams in the United States, U.S. Committee of International Commission on Large Dams, 1963.

20 URBAN AREA 50,000 POP. OR MORE <input type="checkbox"/> YES <input type="checkbox"/> NO										21 NCRS Region										22 PUBLIC ACCESSIBILITY <input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> NO <input type="checkbox"/> UNKNOWN										23 EDITOR INDEXER									
24 LOCATED IN AN HISTORIC DISTRICT <input type="checkbox"/> YES <input type="checkbox"/> NO										NAME										DISTRICT ID NO																			

25 PHOTOS AND SKETCH MAP OF LOCATION

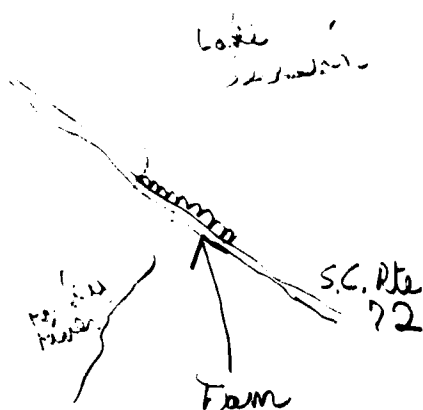

Significance A regionally significant example of multiple arch dam construction. It is the oldest example of this kind of construction in the state. Though not a dam of monumental proportions it is exceptional in terms of water power development in the South.

REFERENCES (CONTINUED)

[illegible]

INT 4575-78

FHR-8-230 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240


1 SITE ID NO		2 Classification		3 PRIORITY		4 DANGER OF DEMOLITION? (SPECIFY THREAT)	
7 9 0 0		Spec. Struc. (Dam)		7 9 0 0		Inundation	
5 DATE		6 GOVT SOURCE OF THREAT		OWNER		ADMIN	
ca. 1905-1907							
8 NAME(S) OF STRUCTURE		9 OWNER(S) ADDRESS		10 STATE		11 COUNTY NAME	
Gregg Shoals Dam		C/O Richard B. Russell Project P.O. Box 1050 Elberton, Ga. 30635		GA		Elberton	
12 EXISTING SURVEYS		13 SPECIAL FEATURES (DESCRIBE BELOW)		14 UTM ZONE		15 CONDITION	
NR NHL HABS HAER-1 HAER NPS CLG		INTERIOR INTACT EXTERIOR INTACT ENVIRONS INTACT		17 3 3 9 4 8 0 3 7 8 6 9 0 0		70 EXCELLENT 71 GOOD 72 FAIR 73 DETERIORATED	
CONF STATE COUNTY LOCAL OTHER				18 UTM ZONE		19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER	
				19 1 7			
				20 UTM ZONE			
				21 NERS Region			
				22 PUBLIC ACCESSIBILITY			
				23 EDITOR			
				24 LOCATED IN AN HISTORIC DISTRICT?			
				25 DISTRICT ID NO			

This is the archaeological remains of a dam constructed ca. 1905-1907. In 1904 O.H. Sheffield and associates were authorized to construct this dam "for the purpose of developing water power for commercial and other purposes" (ACFS, State of Georgia, August 11, 1904). The dam was operated as a hydro-electric facility from 1907 to ca. 1940 by the Duke Power Company. It ceased production after 1940 because of its inability to create enough power for the region, and was replaced by Hartwell Dam ca. 1950. Gregg Shoals Dam was partially blown up by the U.S. Army Corps of Engineers in conjunction with construction of Hartwell Dam. The present site includes a small wood and rockfill crib dam perhaps used to facilitate construction of the original dam in 1905-1907 or perhaps indicative of 19th hydropower development at the site. According to informant evidence, the large bolts were placed on top of the dam after the flood of 1908 to support flashboards and extend the height of the dam, thereby increasing the

(CONT OVER)

25 PHOTOS AND SKETCH MAP OF LOCATION

Sketch map showing location of dam. The map includes a river labeled "Chickamauga River" and a dam structure. A handwritten note "6 miles 72" is visible near the dam.

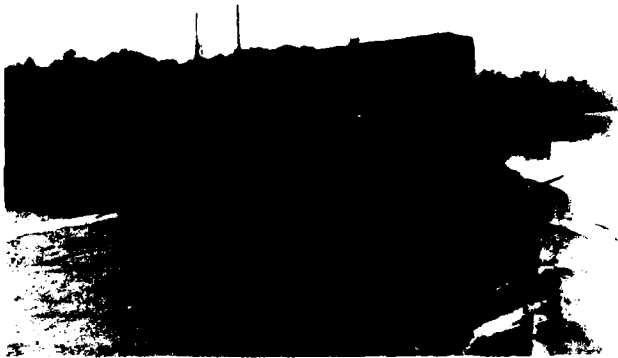

Significance

A regionally significant water power site which is likely to yield important information about the development of hydropower in the South. It retains considerable integrity of design.

depth of water behind it. The height of the reinforced concrete portions of the dam is approx. 10 feet above normal water level.

ABSTRACT		HIST. PHOTO		CONTEMP. PHOTO		HIST. DRWG		CONTEMP. DRWG		COLOR PLATE		PHOTOGRAPH		SW		FILM	

INT 4575-78
1100 6/10/78



FHR-8-730 June 1978

OAHF INVENTORY

Office of Archeology and Historic Preservation
Department of the Interior, Washington, D.C. 20240

1 SITE ID NO										2 Classification										3 PRIORITY										4 DANGER OF DEMOLITION? (SPECIFY THREAT)									
BT & A (Truss)										6 0 3 0										ca. 1925										Inundation									
5 NAME(S) OF STRUCTURE										5 DATE										6 GOVT SOURCE OF THREAT										7 OWNER ADMIN									
S.C. Route 187										ca. 1925										South Carolina DOT										South Carolina DOT									
8 STATE										COUNTY NAME										CITY VICINITY										CONG DIST									
S.C.										Abbeville										Calhoun Falls										09									
11 SITE ADDRESS (STREET & NO.)										12 EXISTING SURVEYS										13 SPECIAL FEATURES: DESCRIBE BELOW										14 UTM ZONE									
Beginning at the intersection of South Carolina State Highway 184 and South Carolina State Highway 187, proceed south on State Highway 187 0.4 miles to the bridge.										<input type="checkbox"/> NR <input type="checkbox"/> NHL <input type="checkbox"/> HABS <input type="checkbox"/> HAER - 1 <input type="checkbox"/> HAER <input type="checkbox"/> NPS <input type="checkbox"/> CL6 <input type="checkbox"/> CONF <input type="checkbox"/> STATE <input type="checkbox"/> COUNTY <input type="checkbox"/> LOCAL <input type="checkbox"/> OTHER										<input type="checkbox"/> INTERIOR INTACT <input type="checkbox"/> EXTERIOR INTACT <input type="checkbox"/> ENVIRONS INTACT										15 CONDITION 70 <input type="checkbox"/> EXCELLENT 71 <input type="checkbox"/> GOOD 72 <input type="checkbox"/> FAIR 73 <input type="checkbox"/> DETERIORATED 74 <input type="checkbox"/> RUINS 75 <input type="checkbox"/> UNEXPOSED 76 <input type="checkbox"/> ALTERED 82 <input type="checkbox"/> DESTROYED 85 <input type="checkbox"/> DEMOLISHED									
16 INVENTORIED BY										AFFILIATION										DATE																			
JLH, EJH, DCJ										HABS/HAER										May 24, 1979																			

The structure is a single span, bolt connected Warren pony truss. It is 56'5" long and 21'6" wide and rests on reinforced concrete abutments. There are foundations indicating the existence of two early bridges, both of which have been demolished.

18 ORIGINAL USE										PRESENT USE										ADAPTIVE USE										(CONT OVER)									
Bridge										Bridge																													
19 REFERENCES - HISTORICAL REFERENCES PERSONAL CONTACTS AND/OR OTHER																																							
"A Guide to Identifying and Dating Trusses" AASLH Technical Leaflet No. 95, T. Allan Comp and Donald C. Jackson.																																							
20 URBAN AREA 50 000 POP OR MORE?										21 NCRS Region										22 PUBLIC ACCESSIBILITY										23 EDITOR INDEXER									
<input type="checkbox"/> YES <input type="checkbox"/> NO										<input type="checkbox"/> YES LIMITED <input type="checkbox"/> YES UNLIMITED <input type="checkbox"/> UNKNOWN										<input type="checkbox"/> NO																			
24 LOCATED IN AN HISTORIC DISTRICT?										NAME										DISTRICT ID NO																			
<input type="checkbox"/> YES <input type="checkbox"/> NO																																							

25 PHOTOS AND SKETCH MAP OF LOCATION



Significance A locally significant example of an early 20th century bolted Warren pony truss. It has played a role in the local travel and commerce of the area.

REFERENCES (CONTINUED)

ABSTRACT		HIST NO		LC	TECH REPO	HIST REPO	CONTEMP PHOTO	HIST PHOTO	CONTEMP DRWG	HIST DRWG	COLOR PLATE	PHOTOGRAM	SW	FILM

INT 4575-78
1100 1100000000



ATE
LMED
8